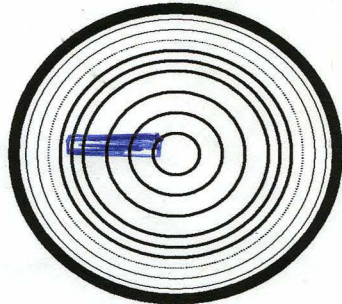


DB 11/2/8

Cow Tag 159	Function Code P6.6	
Brief Description: [timber element, p/s, condition, fragments] Plank		
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos <ul style="list-style-type: none"> - SEVERAL ADDITIONAL NAILS AT EDGE OF SCARF INBD. - 1 BLIND NAIL HOLE ON LAND RIGHT NEXT TO SCARF INBD. - 1 PLUGGED HOLE LAND - DOUBLE TREE NAILS - at every station. 		
Wood Science: [rings, ARW, knots, sapwood, conversion] <p>Not clear c 80H Near radial. ARW: 200/80 Centre beyond upper edge. Timber has some heavy grain esp aft scarf. Also a number of minor knots.</p> 		
Recommended action: [samples, additional photos, moulding, queries and problems] Good pair of trees with one augered through edge of other to be photo'd @ stem end. Lots of shots of work experience people on this cone. <p style="text-align: right;">Perce. 14/09/07 VBS</p>		
Cleaned: 20/10/05 Callum Watts, Shiraz Yasmin Emma Tamplin 21.10.05 AK	Recorded: <input checked="" type="checkbox"/> 25/10/05 MMR.	Photos: 17/03/06 MMR IN: DOUBLE TREEMILLS + ADD NAILS OUT: --- + DIMPLES + ---
Checked: [corrections needed]		Initials & Date: NN 28/10/5.
Corrections Done [desktop, Faro Arm?]:		Initials & Date:

need to check these breaks in framing lines. F37?


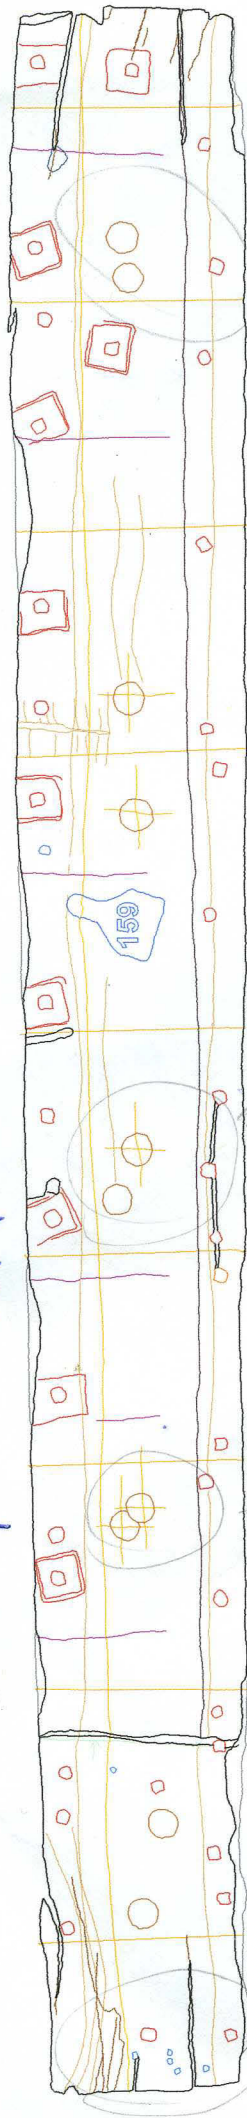


photo
ex 3

photo
ex 2

ex 1
blind averaged photo
size ~ 8mm diam
20mm deep
rounded bottom
photo

159.P6_6 Monika Maleszka-Ritchie 25.10.2005

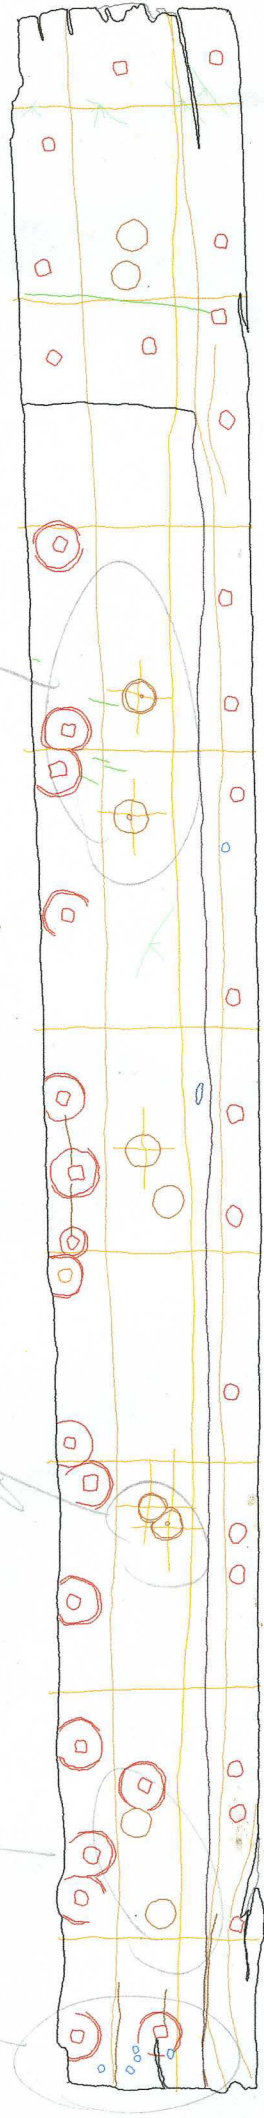

photo

photo

photo