
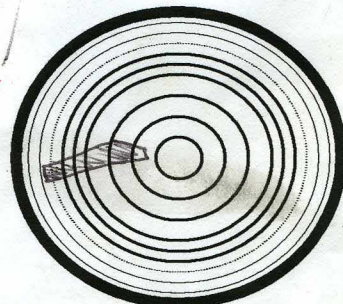



23 18/01/2013

| | | |
|--|--------------------------------|--|
| Cow Tag 207 | | Function Code 54.4 |
| Brief Description: [timber element, p/s, condition, fragments] VERY WELL PRESERVED PLANK | | |
| Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos 6 INSCRIBED LINES AFT OF FORW. END, INBD. - Type 2. Several tear tears on inboard face near knots. | | |
| Wood Science: [rings, ARW, knots, sapwood, conversion] Substantial Sapwood, Tight grain - good dendro candidate. Interesting variety of treenail heads - narrow + wide mid ft. knots. Some knots off radial aft becoming radial forward. c 125H + 10'S ARW = 233/135. Pith beyond lower edge. | |  |
| Recommended action: [samples, additional photos, moulding, queries and problems] Check inboard cross nail (see plot) against relevant framing timber for spike. DENJ. Photos - see plot. | | |
| Cleaned: 10.03.06 MHR, AK | Recorded: TMS 15 March 2006 | Photos: 27/02/08 PM JV |
| Checked: [corrections needed] ✓ | | Initials & Date: NN 25/4/6. |
| Corrections Done [desktop, Faro Arm?]: | | Initials & Date: |

photos

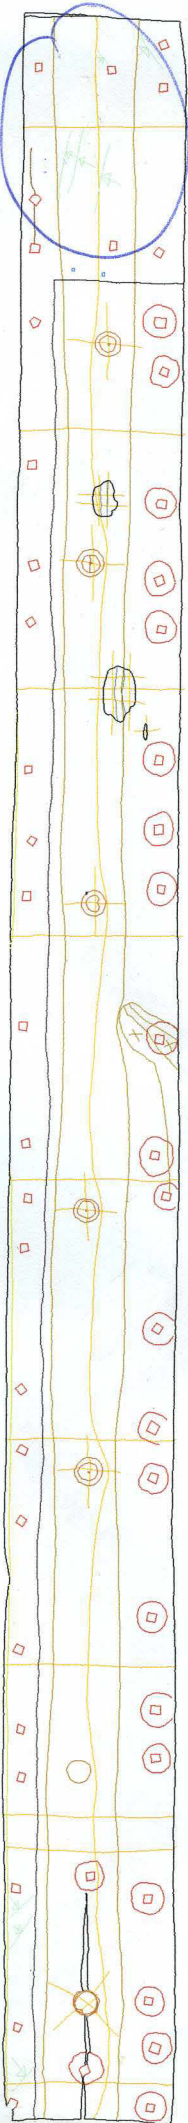

photos

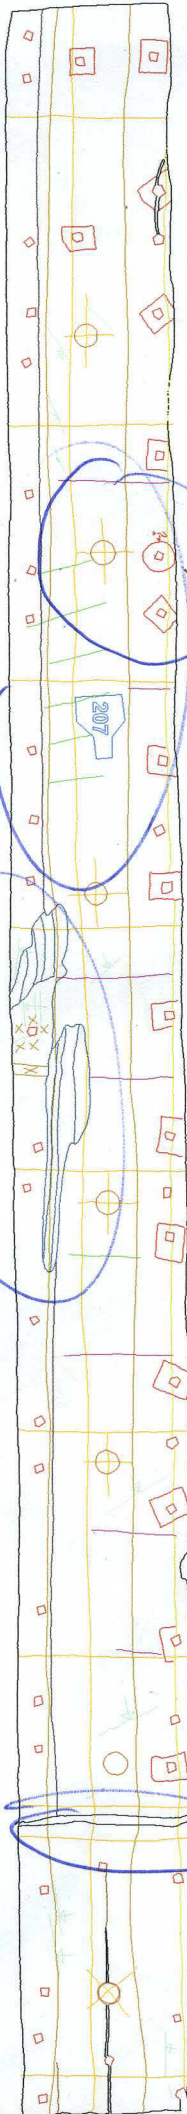

press
 possible reverse nail
 but not ~~just~~ not
 - check v frame

ears

this is large
 worn (damaged?)



207 S4_4 Toby N. Jones 15 March 2006

tool marks