

DB 19/2/8

Cow Tag 238 Function Code 52.1

Brief Description: [timber element, p/s, condition, fragments]  
DAMAGED GENERALLY GOOD CONDITION, HOWEVER BADLY DAMAGED BY CONCRETE POST (?) ON THE AFT END. END OF THE PLANK - BOW SITE - IS CURVED \* MANY CRACKS WHICH HAVE BEEN FILLED WITH COULMING MATERIAL (ANIMAL HAIR & PLANT MATERIAL) OUTBOARD FACE →

Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos COVERED WITH THICK LAYER OF TAR.  
\* IN HISTORICAL TIME.


REMAINED WOODEN NAILS, SOME <sup>IMBEDDED</sup> WITH 45° ANGLE PLANK LACKING TREENAILS / EX: ONE ON THE AFT END  
OUTBOARD FACE - LOOK LIKE HAVE 2 LANDS (?)  
INBOARD: MANY TOOL MARKS - MOSTLY <sup>ON</sup> UNDER SCARP + INSCRIBED LINE

This plank have two fragments 238 52.1a and 238 52.1b

HOOD END 7 ROVES ON OUTBOARD ~~lower~~ edge

Wood Science: [rings, ARW, knots, sapwood, conversion]

c 1204 + c95 (forward end)  
radial. Very straight grained. Clear age trend with sapwood on upper edge.

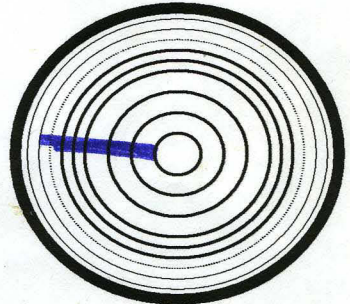

Recommended action: [samples, additional photos, moulding, queries and problems]

DENDRO BUT prime sample location in sensitive area close to hood end.

Cleaned: 27/09/05  
AK, TN7, MM

Recorded: 30/09/05  
MM

Photos: 09/08/06 MMR  
IN: INS. LINES, ADD NAILS + ~~PEELS~~ PEGS  
OVS: ADD NAILS, NAIL HEADS + ROVES.

Checked: [corrections needed]  
✓ check for photos - some important features  
Nails around split, hood end; reverse roves

Initials & Date:  
NN 4/10/05.


Corrections Done [desktop, Faro Arm?]:

Initials & Date:

ok Scarf  
Scarf were removed  
a given -  
Gowkay  
2594




5

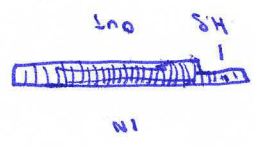

Dead?




n.o. exposed

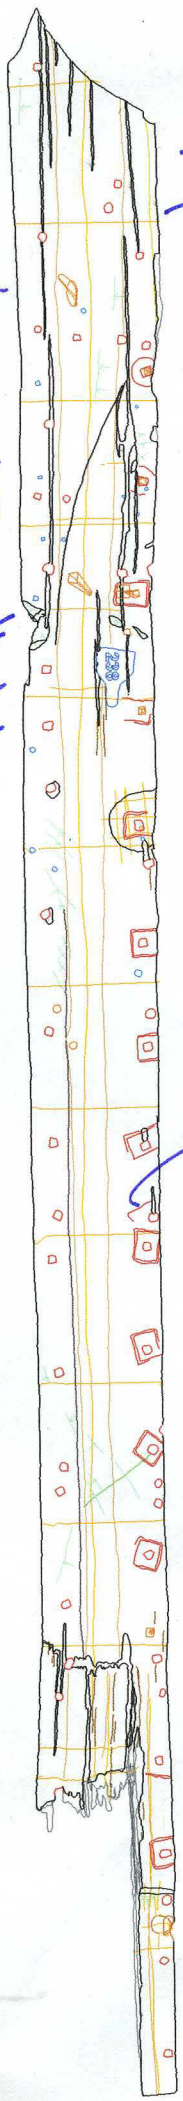

wooden nail?  
 Fe small nail?  
 smaller iron nails.  
 irregular rows? and pairs?

packed.

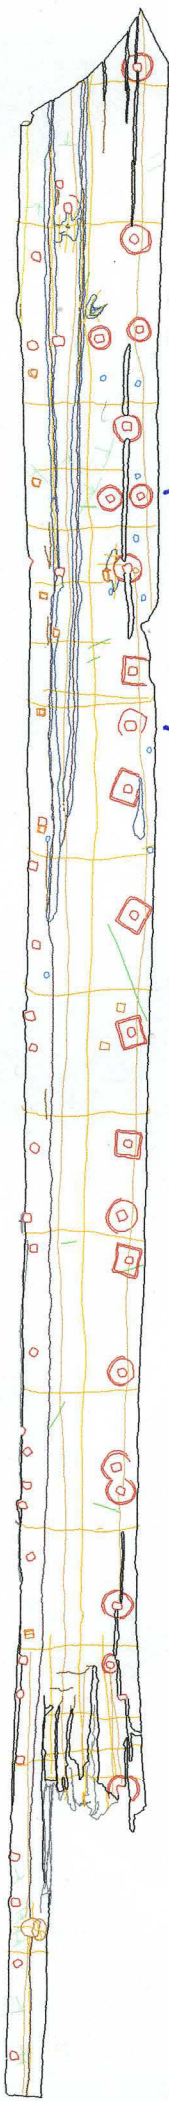

238 S2\_14 Monika Melzer-Richter 30.09.2005

Only Fe nail

