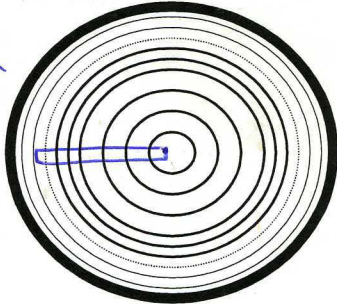


DB 26/2/08

Cow Tag 314	Function Code S18.5 S18,5	
Brief Description: [timber element, p/s, condition, fragments] Very tough corrosion. Bendy/crivy plank otherwise solid.		
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos IB several lines Type 1, some vague. OB, Type 3, vague - just aft of scarf (crack end) > 3 in a row Lines diagonal (toolmarks) / / / just on edge of scarf. several lines Type 1 scraper, parallel with land, 1m. aft of scarf. forward: < shape, crack of edge and on other side of 1st nail head in the middle of face. several lines around large crack alternate large # small nail heads, OB Add. nail, 0.20m forw. of aft edge (see other side →)		
Wood Science: [rings, ARW, knots, sapwood, conversion] Radial = 70H+5S. Pith beyond upper edge ARW = 230/75 		
Recommended action: [samples, additional photos, moulding, queries and problems]		
Cleaned: LB, RG, MS 14/08	Recorded: 16/8/06 DV	Photos:
Checked: [corrections needed] ✓	Initials & Date: NN 17/8/6	
Corrections Done [desktop, Faro Arm?]:	Initials & Date:	

DR 2515/08

~~Inboard~~

- Inboard: - type 2 lines (well, everything else which isn't type 2, 3, 4)
- small step on land
 - big knot

Outboard: - forward end type 2 diamond → the crack has caulking material in it! 2526 sample nr.

- possible type 2 lines (grouped) on aft end of plank

- crack at aft end caulked sample nr 2527