

DB 03/12/09

Cow Tag 003 Function Code Beam

Brief Description: [timber element, p/s, condition, fragments]  
 Original Wood # 1064 OA3  
Dried out crossbeam - was attached to standing knee complex


Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING

Large cracks and splits - Difficult to discern edges in certain areas.  
- Original edges are notional in places.  
idealised  
Iron Bolts  
Treenails  
Blind Treenail on outboard face?  
5 additional spike nails on 'O' face  
2 pairs seem to be related - similar depths + spacings along a line.  
Bevel on edge of O/Inboard face  
Chamber  
1 End cut on site for dendro analysis  
1 End hacked off in antiquity w/ axe.

T.1	T.2	T.3	T.4	T.5	T.6	T.7	T.8

Wood Science: [rings, ARW, knots, sapwood, conversion]

Interesting 'Tab' on Iron Bolt Head  
Rebates - Inboard/x face, Out face,

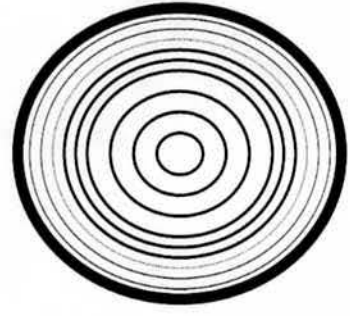

Recommended action: [samples, additional photos, moulding, queries and problems]

Laser Scan Axe marks on end of crossbeam

Cleaned: / Recorded: TNJ 27/11/2009 Photos:

Checked: [corrections needed] Initials & Date:

Corrections Done [desktop, Faro Arm?]: Initials & Date: