

DB

5/3/2008

Cow Tag	1118 415	Function Code	P6.7
---------	---------------------	---------------	------

Brief Description: [timber element, p/s, condition, fragments]
 portside plank, fairly knotty, both aft and forward edge thin, aft edge = 2 splits, otherwise good condition.

Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos


Double treenails all along plank. Fe nail sampled (label on OB face)
 1B: 2 add. iron nails, poss. repairs of crack from treenail; 15 and 12 cm aft of forward edge. 3 add. nails 32 cm aft of forward edge
 Add. treenail, still in situ and situated underneath edge of rope, 1.09 m aft of forward edge. ~~Does not go all~~
 Piece of wood combining two treenails at 0.82 m aft of forward edge

Overlapping double treenails towards aft end with checking as order of timbers clear of framing timbers

No
 wood
 head

Wood Science: [rings, ARW, knots, sapwood, conversion]

Numerous pin knots Radial
 c80 H. Pith beyond lower edge
 ARW = 190/80

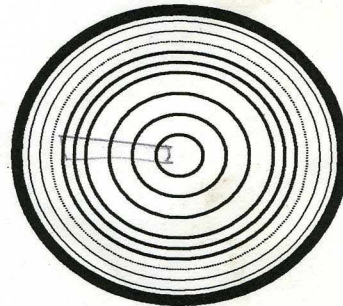

Recommended action: [samples, additional photos, moulding, queries and problems]

Cleaned: 26/04/06 LB & MS	Recorded:	Photos:
Checked: [corrections needed] ✓	Initials & Date: NN 12/5/7	
Corrections Done [desktop, Faro Arm?]:	Initials & Date:	