
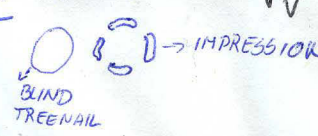
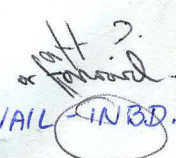
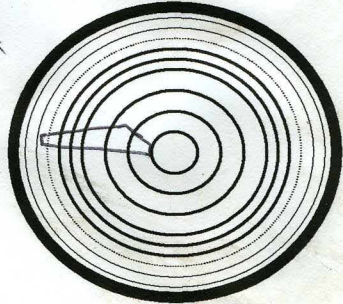



13/3/8

12

Cow Tag <u>586</u>		Function Code <u>53.2</u>
Brief Description: [timber element, p/s, condition, fragments] <u>WELL PRESERVED PLANK</u> <u>SLIGHTLY DAMAGED ON FORW. END</u>		
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos <u>SMALL ADDITIONAL NAILS ON EITHER END</u> <u>SOME TREENAILS WITH DIMPLES OR CUT-MARKS</u> <u>2 WOODEN SPIKES - LAND INBD.</u> <u>1 BLIND TREENAIL HOLE - INBD. - STRANGE IMPRESSION</u> ✓ <u>NEXT TO IT</u>  <u>BLIND TREENAIL</u> → IMPRESSION		
<u>SMALL ADDITIONAL NAIL</u>  <u>INBD. SCARF - HAD NO FE - CORROSION PRODUCTS</u>		
Wood Science: [rings, ARW, knots, sapwood, conversion] <u>Supposed radial - straight grained except at forward scarf: P.H. beyond lower edge</u> <u>At step in aft scarf: 86 H + 45. ARW = 195/90</u> 		
Recommended action: [samples, additional photos, moulding, queries and problems] <u>Photograph central treenail outboard face - perspective + plan view</u> <u>" impression + blind treenail on inboard face</u>		
Cleaned: <u>03.02.06 T7, AK</u>	Recorded: <u>TNS 05.02.06</u>	Photos: <u>VT</u> <u>25/10/06</u>
Checked: [corrections needed] ✓		Initials & Date: <u>NN 20/4/6.</u>
Corrections Done [desktop, Faro Arm?]:		Initials & Date:

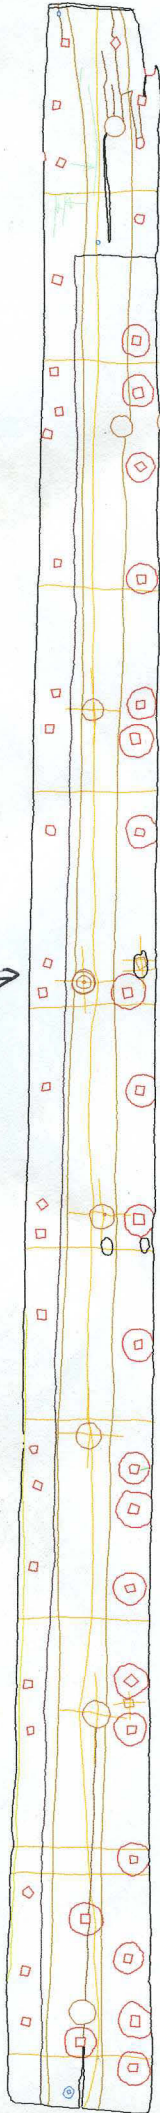

←
pays

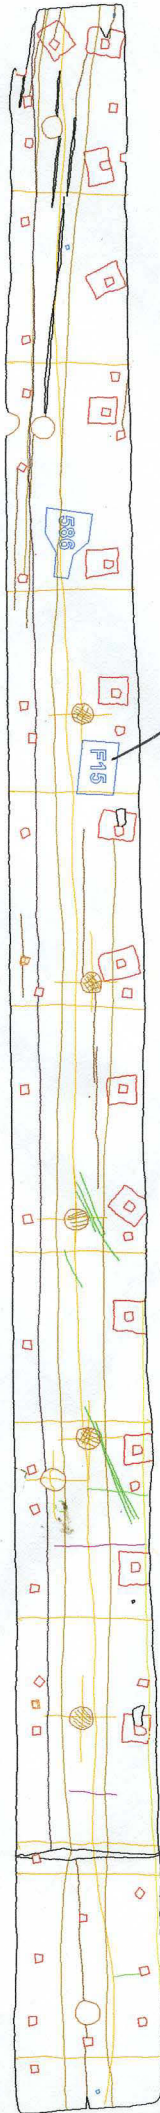

one of two of the
at F15 for observation

↑
pays

586 S3_2 Toby N. Jones 05 February 2006