


DB 17/3/8

Cow Tag 589	Function Code P 3.1 A
Brief Description: [timber element, p/s, condition, fragments] PLANK IS DISTORTED AND BROKEN / CRACKED IN PLACES OUTBD. TINGLE 761 ASSOCIATED WITH TIMBER	
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos 3 OUTBD. ROVES HOODED END AT FORW. END (?) SET OF INSCR. LINES APPR. 1m away from FORW. END 3 PLUGGED HOLES LAND INBD. NUMEROUS ADDITIONAL NAILS AT AREA OF TINGLE 4 NAILHEADS INBD. 1 PLUGGED HOLE AT UPPER EDGE APPR. 1.20m away from AFTEND	
Wood Science: [rings, ARW, knots, sapwood, conversion] Radial at wood end c 100H + 10S Pith beyond lower edge. ARW = 215/110	
Recommended action: [samples, additional photos, moulding, queries and problems] - star on nailhead impression, outboard face, aft end. note: - nail cluster on inboard face (mid-section) D6ND - complete } ← axe blade impression under tingle on outboard face MOULD - axe cuts on kee nail under tingle on outboard face (mid-section) - square impression (very clear) on outboard face which shows the shape of the rove NB: nail angles are taken with the needle-pins, therefore length of the angle tells you nothing about the depth of the nail holes. Also because of the difficulty of using the pins instead of the solid 15 cm rod, nail angles are less accurate.	
Cleaned: 24.02.06 AK	Recorded: DV 16/5/6.
Photos: 10/08/08	Checked: [corrections needed]
Corrections Done [desktop, Faro Arm?]:	Initials & Date:

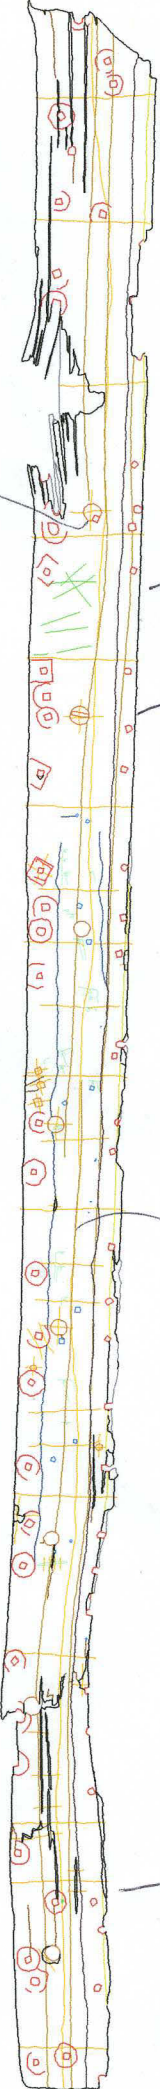


Ingr 3? wedge in tunnel?

tingle

star impression

OUT

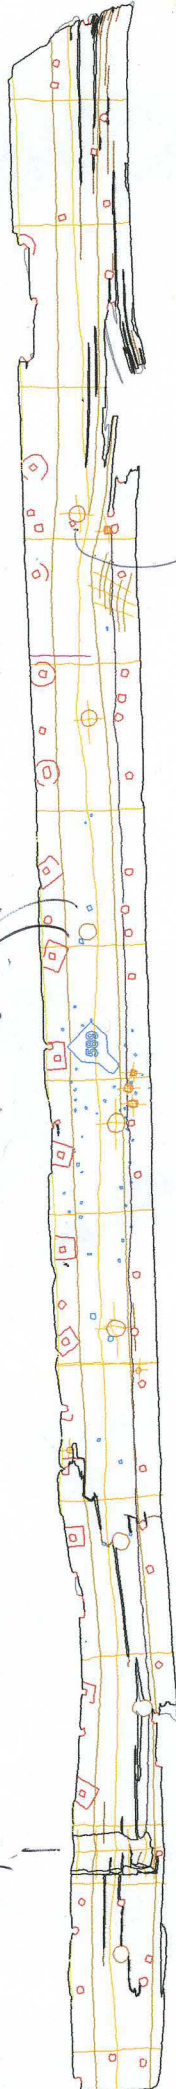

change is additional

drawn from internal

Pit damage?

IN