

DB 28/02/08

Cow Tag 636 Function Code F 50-0

Brief Description: [timber element, p/s, condition, fragments]  
floor timber, slight damage to ends

Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING

O.B - v. nice see work, pocket in timber hole  
for - all work, poss T.4 lines  
gt -


NUMEROUS T4, some double + triple marks. It is possible that some of these mark RFR's as well as joggle portions  
Rebated Fe nails (1 each) on both sides, saw marks - 1B.  
Deep Axe marks on outboard face in the timber hole.  
Nail Angles + Depth on outboard: Suspect - not cleaned out well.

T.1	T.2	T.3	T.4	T.5	T.6	T.7	T.8
			✓?				

Wood Science: [rings, ARW, knots, sapwood, conversion]

Starboard arm = bole of tree, port arm = branch

C + 60H + 1SS + B ARW =

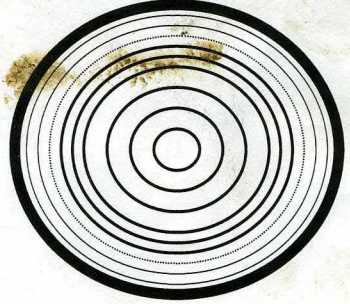

Recommended action: [samples, additional photos, moulding, queries and problems]

Reclean nail? Had 2nd clean 12/11/7 but could be more to do on this timber.

Cleaned: 05J DAVE Recorded: 02 March 2007 Photos:  
1/12/08 CEE-ANNE TNJ

Checked: [corrections needed] Initials & Date:  
/ NN 12/11/7

Corrections Done [desktop, Faro Arm?]: Initials & Date:

636 F50\_0 Toby N. Jones 02 March 2007

