


DB 21/2/8

Cow Tag **90**

Function Code **S8-8**

Brief Description: [timber element, p/s, condition, fragments]


Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING

Wide distal bevel on inboard surface between land and upper edge
 4 Type 8 ^{odd use?} staple holes - possibly to hold ~~plank~~ ^{plank} up - as a sort of jig - during construction.
 wooden spikes / additional nails
 Narrow inboard land  on land
 6+ Type 5 clamp marks
 1 Type 3 outboard Aft Edge - damaged


T.1	T.2	T.3	T.4	T.5	T.6	T.7	T.8
✓		✓		✓			✓

Wood Science: [rings, ARW, knots, sapwood, conversion]

No sapwood. Some Resin + tears -
 Radial. Pith beyond lower edge.
 95H. ARW = 190/95.

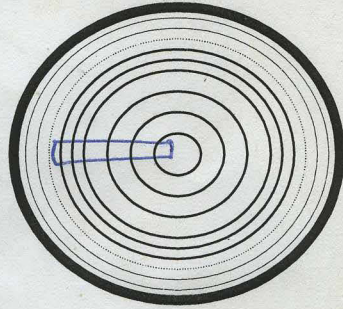

Recommended action: [samples, additional photos, moulding, queries and problems]

Photo clamp marks + ^{odd use?} staple holes + Type 3

 on land.

Re-recorded 06/02/2007 TNJ

Cleaned:

Recorded:

Photos:

~~AK 21/03/2005~~

29/1/2008 SC

Checked: [corrections needed]

Initials & Date:

NN 2/11/7

Corrections Done [desktop, Faro Arm?]:

Initials & Date: