

maparch

MAP Archaeological Practice



Glebe Farmhouse, Coleby Road, West Halton

MAP 5-07-2017
Historic Building Recording
(Photographic and Descriptive Record)
SE 90462 20685

**Glebe Farmhouse
Coleby Road
West Halton
North Lincolnshire**

MAP 5.07.2017

PA/2016/2021 & PA/2016/2025

SE 90462 20685

**HISTORIC BUILDING RECORDING
(PHOTOGRAPHIC & DESCRIPTIVE RECORD)**

Contents	Page
Figure List	2
Plate List	3
Non Technical Summary	5
1. Introduction	5
2. Site Description	7
3. Archaeological and Historical Background	8
4. Aims and Objectives	8
5. Methodology	9
6. Results	9
7. Conclusions	13
8. References and Bibliography	15
9. List of Contributors	15
Appendices	
1. Photographic Listing	42

Figure List	Page
1. Site Location. Scale 1:50,000.	16
2. Proposed Development Area. Scale 1:1,250.	17
3. Farmhouse Ground Floor Plan. Scale 1:100.	18
4. Farmhouse: First Floor Plan. Scale 1:100.	19
5. Farmhouse: South and East Elevations. Scale 1:100.	19
6. Farmhouse: North and West Elevations. Scale 1:100.	20
7. Phasing Plan. Scale 1:100.	21

Plate List	Page
1. Farmhouse: Exterior East and South Elevations. Facing North-west.	22
2. Farmhouse: Exterior South Elevation. Facing North.	22
3. Farmhouse: Exterior South Elevation (East). Facing North.	23
4. Farmhouse: Exterior South Elevation (West). Facing North.	23
5. Farmhouse: Exterior East Elevation. Facing West.	24
6. Farmhouse: Exterior West and North Elevations. Facing South-east.	24
7. Farmhouse: Exterior North Elevation. Facing South.	25
8. Farmhouse: Exterior North Elevation (West). Facing South.	25
9. Farmhouse: Exterior East and North Elevations. Facing South-west.	26
10. Farmhouse: Exterior East Elevation. Facing West.	26
11. Farmhouse: Interior Ground Floor. Facing South-east.	27
12. Farmhouse: Interior Ground Floor. Facing South.	27
13. Farmhouse: Interior Ground Floor. Facing West.	28
14. Farmhouse: Interior Ground Floor. Facing North.	28
15. Farmhouse: Interior Ground Floor. Facing East.	29
16. Farmhouse: Interior Ground Floor. Facing South-west.	29
17. Building B Exterior: North Elevation. Facing North.	30
18. Farmhouse: Interior Ground Floor. Facing North-west.	30
19. Farmhouse: Interior Ground Floor. Facing South.	31
20. Farmhouse: Interior Ground Floor. Facing North.	31
21. Farmhouse: Interior Ground Floor. Facing South-east.	32
22. Farmhouse: Interior Ground Floor. Facing West.	32
23. Farmhouse: Interior Ground Floor. Facing South-west.	33
24. Farmhouse: Interior Ground Floor. Facing South-east.	33

25. Farmhouse: Interior Ground Floor. Facing West.	34
26. Farmhouse: Interior First Floor. Facing East.	34
27. Farmhouse: Interior First Floor. Facing North.	35
28. Farmhouse: Interior First Floor. Facing South-west.	35
29. Farmhouse: Interior First Floor. Facing North.	36
30. Farmhouse: Interior First Floor. Facing West.	36
31. Farmhouse: Interior First Floor. Facing South-east.	37
32. Farmhouse: Interior First Floor. Facing West.	37
33. Farmhouse: Interior First Floor. Facing West.	38
34. Farmhouse: Interior First Floor. Facing South-west.	38
35. Farmhouse: Interior First Floor. Facing East.	39
36. Farmhouse: Interior First Floor. Facing West.	39
37. Farmhouse: Interior First Floor. Facing East.	40
38. Farmhouse: Interior First Floor. Facing West.	40
39. Farmhouse: Interior First Floor. Facing West.	41
40. Farmhouse: Interior First Floor. Facing East.	41

**Glebe Farmhouse
Coleby Road
West Halton
North Lincolnshire**

MAP 5.07.2017

PA/2016/2021& PA/2016/2025

SE 90462 20685

**HISTORIC BUILDING RECORDING
(PHOTOGRAPHIC & DESCRIPTIVE RECORD)**

Non Technical Summary

This report has been undertaken by MAP Archaeological Practice Ltd under the instruction of Edwardson Associates on behalf of Mr. & Mrs. Stephenson, to record the Grade II Listed farmhouse at Glebe Farm, Coleby Road, West Halton, North Lincolnshire, prior to its renovation and remodelling.

The Building Recording surveyed farmhouse, which was a late eighteenth with a nineteenth century extension to the rear to form a service wing and additional bedrooms. The house and extension were constructed of stone with some brick details including quoins, tumbled gable and dentillated eaves and both with modern concrete tile roofs. The farmhouse was butted by Barn D to the west.

1. Introduction

- 1.1 The Historic Building Recording has been commissioned by Edwardson Associates on behalf of Mr. and Mrs. Stephenson to record the Grade II Listed farmhouse at Glebe Farm, Coleby Road, West Halton, North

Lincolnshire in advance of their alteration and refurbishment as a permanent archive record of the buildings to inform future study and management, prior to its renovation as part of the proposed residential development (SE 90462 20685: Fig. 1).

- 1.2 In accordance with the recommendations of the National Planning Policy Framework (March 2012) states that the '*Local Planning Authority... should also require developers to record and advance understanding of the significance of any heritage assets to be lost (wholly or in part) in a manner proportionate to their importance and the impact, and to make this evidence (and any archive generated) publicly accessible [within the Historic Environment Record].*' The Historic Building Recording and Report will be undertaken to satisfy Conditions 9, 10 & 11 on the Planning Permission (**PA/2013/0847**) & Conditions 4, 5 & 6 on the Planning Permission (**PA/2013/0848**):-

Condition 9/4

No alteration or development shall take place until the applicant, or their agents or successors in title, has produced an historic building record in accordance with a written specification, including a timetable for the recording, which has been submitted by the applicant and approved in writing by the Local Planning Authority.

Reason

To comply with policy HE9 of the North Lincolnshire Local Plan as the traditional agricultural buildings are heritage assets of local significance.

Condition 10/5

The historic building recording shall be carried out in accordance with the approved details and timings, subject to any variations agreed in writing by the local planning authority.

Reason

To comply with policy HE9 of the North Lincolnshire Local Plan as the traditional agricultural buildings are heritage assets of local significance.

Condition 11/6

The historic building archive shall be deposited at the North Lincolnshire Historic Environment Record within six months of the date of commencement of the development hereby approved by this permission or such other period as may be agreed in writing by the local planning authority.

Reason

To comply with policy HE9 of the North Lincolnshire Local Plan as the traditional agricultural buildings are heritage assets of local significance.

- 1.3 A Written Scheme of Investigation was submitted to and approved by the North Lincolnshire Conservation Officer in February 2017. The Building Record was undertaken on Thursday 15th February 2017.
- 1.4 This report was funded by Mr and Mrs Stephenson.
- 1.5 All maps within this report have been produced from Ordnance Survey with the permission of the Controller of Her Majesty's Stationery Office, Crown Copyright. License No. AL 50453A.

2. Site Description

- 2.1 The Proposed Development Area comprises the farmhouse and outbuildings at Glebe Farm; which is located south-west of the village of West Halton on the west side of Coleby Road (Figs. 1 & 2). The village of West Halton is located seven miles north of Scunthorpe. The Proposed Development Area comprises the farmhouse and a range of five farm buildings dating from the 18th to mid 20th centuries. The farm buildings were surveyed and recorded in August 2016.
- 2.2 The site is roughly rectangular in plan and is 140m by 600m in size and stands at a height of c. 11.6m AOD.

- 2.3 The Proposed Development Area stands on soils of the Banbury Soil Association (544: Mackney et al. 1984, 10) described as *"well drained brashy fine and coarse loamy ferruginous soils over ironstone. Some deep fine loamy over clayey soils with slowly permeable subsoils and slight seasonal waterlogging"*.

3. Archaeological and Historical Background

- 3.1 The village of West Halton dates from the early Saxon period and early and mid Saxon finds and occupation have been recorded at excavations on the village green. The Parish Church is dedicated to St. Etheldreda, which was the focus of the village.
- 3.2 The Glebe Farm is located south-west of the village of West Halton and comprises, a group of farm buildings (Barns, cartsheds and stables). The Farmhouse, not part of the Proposed Development, is a Grade II Listed Building dating to the late 18th century with a barn attached to the west (HER Ref. 8508). The barn (Building D) is within the curtilage of the Farmhouse. Building A, B and E are located south-west of the farmhouse and Building C is located north-west of the Farmhouse. These buildings date to the eighteenth/nineteenth centuries and are non-designated heritage assets on the North Lincolnshire Historic Environment Record (HER Ref. 25159).

4. Aims and Objectives

- 4.1 The Aim of the Historic Building Recording of the farmhouse on site was to:-

-
- Provide a systematic historic building recording of farmhouse prior to the commencement of any alterations
 - to determine the original nature, date and survival of any earlier structure and fabric and their development to present day

5. Methodology

5.1 The interior and exterior of the building were observed and notes taken on the layout, construction materials and architectural details. A photographic record using 35mm monochrome film and 14 megapixel digital cameras was undertaken.

5.2 The photographic record for the building assessment comprised 47 monochrome print film exposures and 53 digital shots. The Photographic Record of the buildings are included on a film register noting film number, shot number, location of shot, direction of the shot, and a brief description of the subject (Appendix 1).

6. Results

6.1 The Building Record was undertaken at Glebe Farm on the 15th February 2017. The weather conditions were dry with cloud and occasional sunny spells. The farmhouse was surveyed and photographed.

6.2 Farmhouse: Exterior Description (Figs. 3, 4, 5 & 6; Pls. 1-10)

6.2.1 The farmhouse is a two storey stone built structure comprising a four bay farm house and a later rear extension, with brick details such as quoining in English Garden Wall bond and later brick chimney stacks. The rear extension was offset to the west. Both builds had gable roofs covered with modern concrete tiles. The front (southern) elevation had a dog-

tooth dentilled cornice and the east elevation of the southern built farmhouse had tumbled eaves.

6.2.2 The front eighteenth century farmhouse has three central chimneys on the gable ends (east and west) and one west of the front door. The rear later extension has two central chimneys, one on the east gable and one

6.2.3 The oldest part of the house comprised eighteenth century south facing elevation. The front (south) elevation has asymmetrical frontage. There are two lines of brick quoins on either side of the door as decoration. With two windows to the west, on the ground and first floor, and one to the east of the door and an additional window on the first floor above the door. The door is modern with glazing panels to the east and west in a moulded surround. The windows on the ground floor are tall vertical sash casements with twelve panes, from near floor to ceiling height. The four windows of the first floor on this elevation and one window to the rear (north elevation are squatter almost square vertical sash windows with twelve pane fenestration.

6.2.4 There is a blocked window in the east elevation on the ground floor, south of the gable chimney and a recent glazed door and window located north of the chimney. The west elevation butts the large barn surveyed and photographed in 2016, where there is a block window to the first floor.

6.2.5 The rear elevation (north) of the main farmhouse has one window on the first floor.

6.2.6 The later extension west elevation has a later door and window on the

ground floor and a larger window on the first floor. The rear (north) elevation has a blocked door to the west, west of the windows with a brick repair replacing the lower quoining. There are three windows of different sizes and styles on both the ground floor and first floor, none are symmetrical. The east elevation has a small window on the ground floor and an external door into the yard.

6.3 *Farmhouse: Interior Description (Figs. 3 & 4 and Pls. 11-40)*

6.3.1 The ground floor of the earlier farmhouse comprises the southern part of the farmhouse with an off-centre hall, slightly east of centre; with two reception rooms to the west of the hall and one reception room to the east and a rear (service) stair north of the westernmost room. From the main hall and the service staircase there was access into the rear extension.

6.3.2 The main hall has staircase on the west side with moulded handrail and plain balusters as noted on the listed building description and illuminated by the glazing by the front door and the window on the first floor landing. There are two doors into the side reception rooms and a linking hall to the rear extension (service wing). The door surrounds in these front rooms have a timber cornice, entablature, header and side jambs, showing the higher status of these rooms.

6.3.3 The two main reception rooms have later, modern fireplaces. The smaller reception room had a blocked fireplace in its north-west corner. The western room is smaller, a personal reception room or study linking to the rear stairs and the service wing. The rear stairs have a plain handrail and the hall has plain ceramic tiled floor.

- 6.3.4 The plasterwork throughout is plain. The hall landing as an arched niche. The hall and front rooms all have timber floors. The reception rooms on the west side of the hall has ceiling joists aligned north to south.
- 6.3.5 The rear service wing was split into scullery to the west, central kitchen then larder/dairy. A toilet has been inserted recently off the rear hall. There is a large chimney breast for the scullery and kitchen, both have blocked fireplaces. Both these rooms probably originally had ranges. The scullery to the west has a series of hooks in the ceiling. The kitchen has three bells on the interior (south) wall. The fittings for the bell-pulls have all been removed and plastered over both in the kitchen and the reception rooms they served. Probably three bells for the three reception rooms and possibly the main bedroom or a reception room on the first floor.
- 6.3.6 Recent changes including the remodelling off access with doors inserted in the eastern gable into the yard and garden and western gable to the farm and a new front door. A window in the eastern gable on the ground floor had been blocked as well. A window in the rear (northern) gable had been blocked. Central heating meant the fireplaces in the kitchen, scullery, smallest reception room and the bedrooms upstairs had been boarded over.
- 6.3.7 The floor plan for Barn D showed a corridor from the farmyard to the extension. The door into the extension had been blocked over, probably providing access direct to the farmyard from the scullery for clothes drying outside.

6.3.8 The first floor comprises five bedrooms and a bathroom. The older farmhouse has three bedrooms with internal access between and a rear hall to the north of the west two bedrooms with access between both staircases. There are two openings between this rear hall, one to the west two bedrooms of the later extension and another to the eastern bedroom in the later extension. The rear extension has two bedrooms and the modern bathroom. The eastern bedroom in the rear extension and the central and eastern bedroom in the farmhouse had blocked fireplaces. All the doors on the first floor have plain surrounds. There are built in cupboards in the front (southern) bedrooms on the west side. The cupboard in the western gable wall was formerly a window, now blocked in Barn D Interior. There were beams across the western two bedrooms and the rear hall, aligned north to south.

6.3.9 In the oldest (front) part of the house, there was a change in level between the western bedrooms and the main hall at the front, which was level with the eastern front bedroom. The three rooms in the rear (northern) extension are on the same level as the western bedrooms and rear hall.

7. Conclusions

7.1 The details on the southern elevation with brick coins on the east and west gables and two more brick quoins to the east and west of the door suggest the building was originally two phases of construction. The interior details of beams in the western part of the southern building, a change in level on the first floor between the western bedrooms and rear

hall and the central hall and eastern bedroom, suggest the western part was older. The construction of the barn to the west (Barn D) also covered over a window in the western gable of this earlier farmhouse. In the later eighteenth century the farmhouse was extended to the east, probably with a complete interior refurbishment to reflect the higher status ground floor details (larger windows and decorated door surrounds). With the stairs to the west becoming service access with the main hall now acting as the preferred access upstairs.

- 7.2 There are three phases of construction, with the original farmhouse expanded into a higher status building along with the expansion of the farm (Fig. 7). In the nineteenth century, the rear service wing was added, comprising scullery, kitchen, pantry and dairy
- 7.3 The interior details of the doors on the ground floor, the bell pulls and two separate staircases suggest that the separate high status front and service wing extension to the rear for the farmhouse.

8. Bibliography

Brunskill, R.W. 1987 Traditional Farm Buildings of Britain. Gollancz.

Historic England 2016 Understanding Historic Buildings. A Guide to Good Recording Practice.

Chartered Institute for Archaeologists. (2014) *Standard and Guidance for the Archaeological Recording of Buildings and Structures*. Reading: Institute for Archaeologists.

Chartered Institute for Archaeologists. (2014) Code of Conduct. Reading: Chartered for Archaeologists.

9. List of Contributors


Photographer, Report, Illustrations and Plates: Kelly Hunter

Film Processing by CC Imaging, Leeds

Floor Plans and Elevations based on drawings provided by Edwardson Associates



	TITLE: Site Location.	
SITE: Glebe Farmhouse, Coleby Road, West Halton	FIGURE: 1.	Scale: 1:50,000
CLIENT: Mr and Mrs Stephenson	DRAWN BY: KCH	

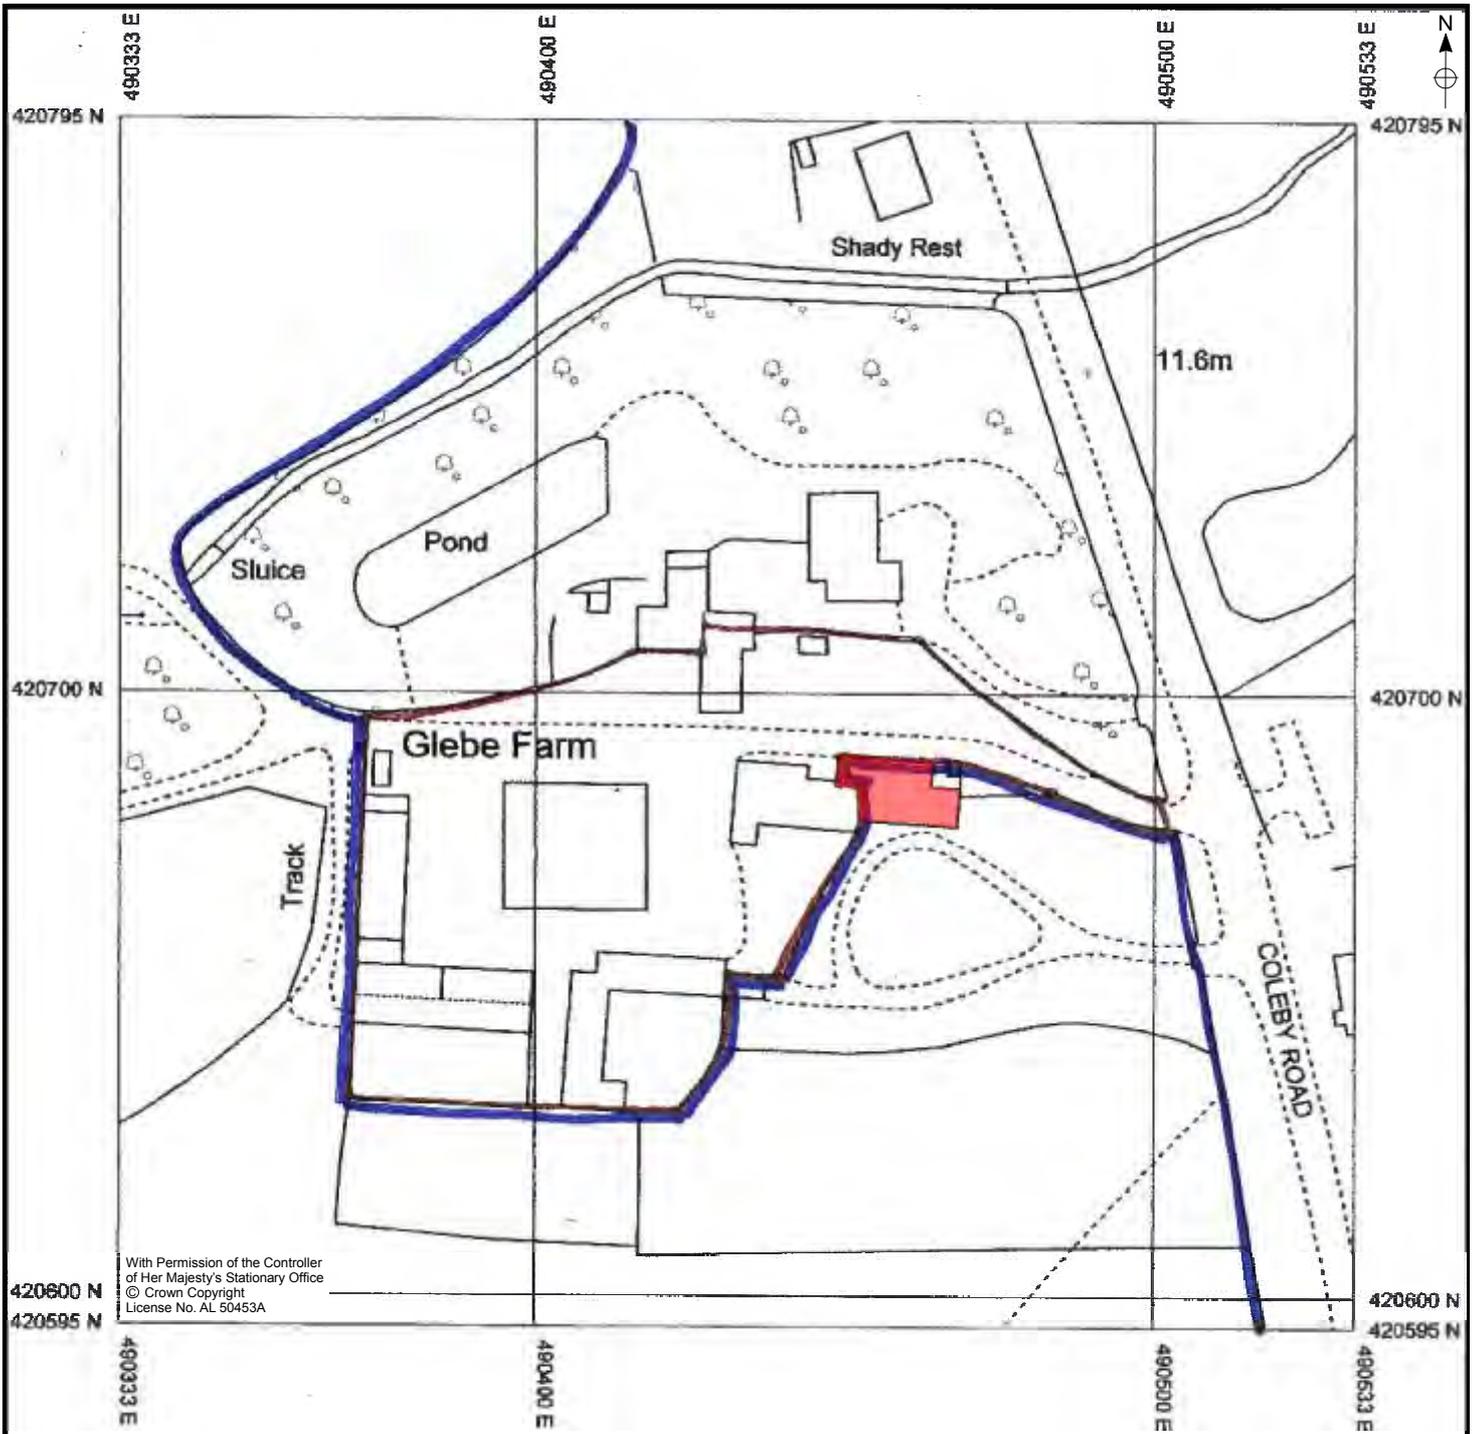

	TITLE: Development Area.	
SITE: Glebe Farmhouse, Coleby Road, West Halton	FIGURE: 2.	Scale: 1:1,250
CLIENT: Mr and Mrs Stephenson	DRAWN BY: KCH	

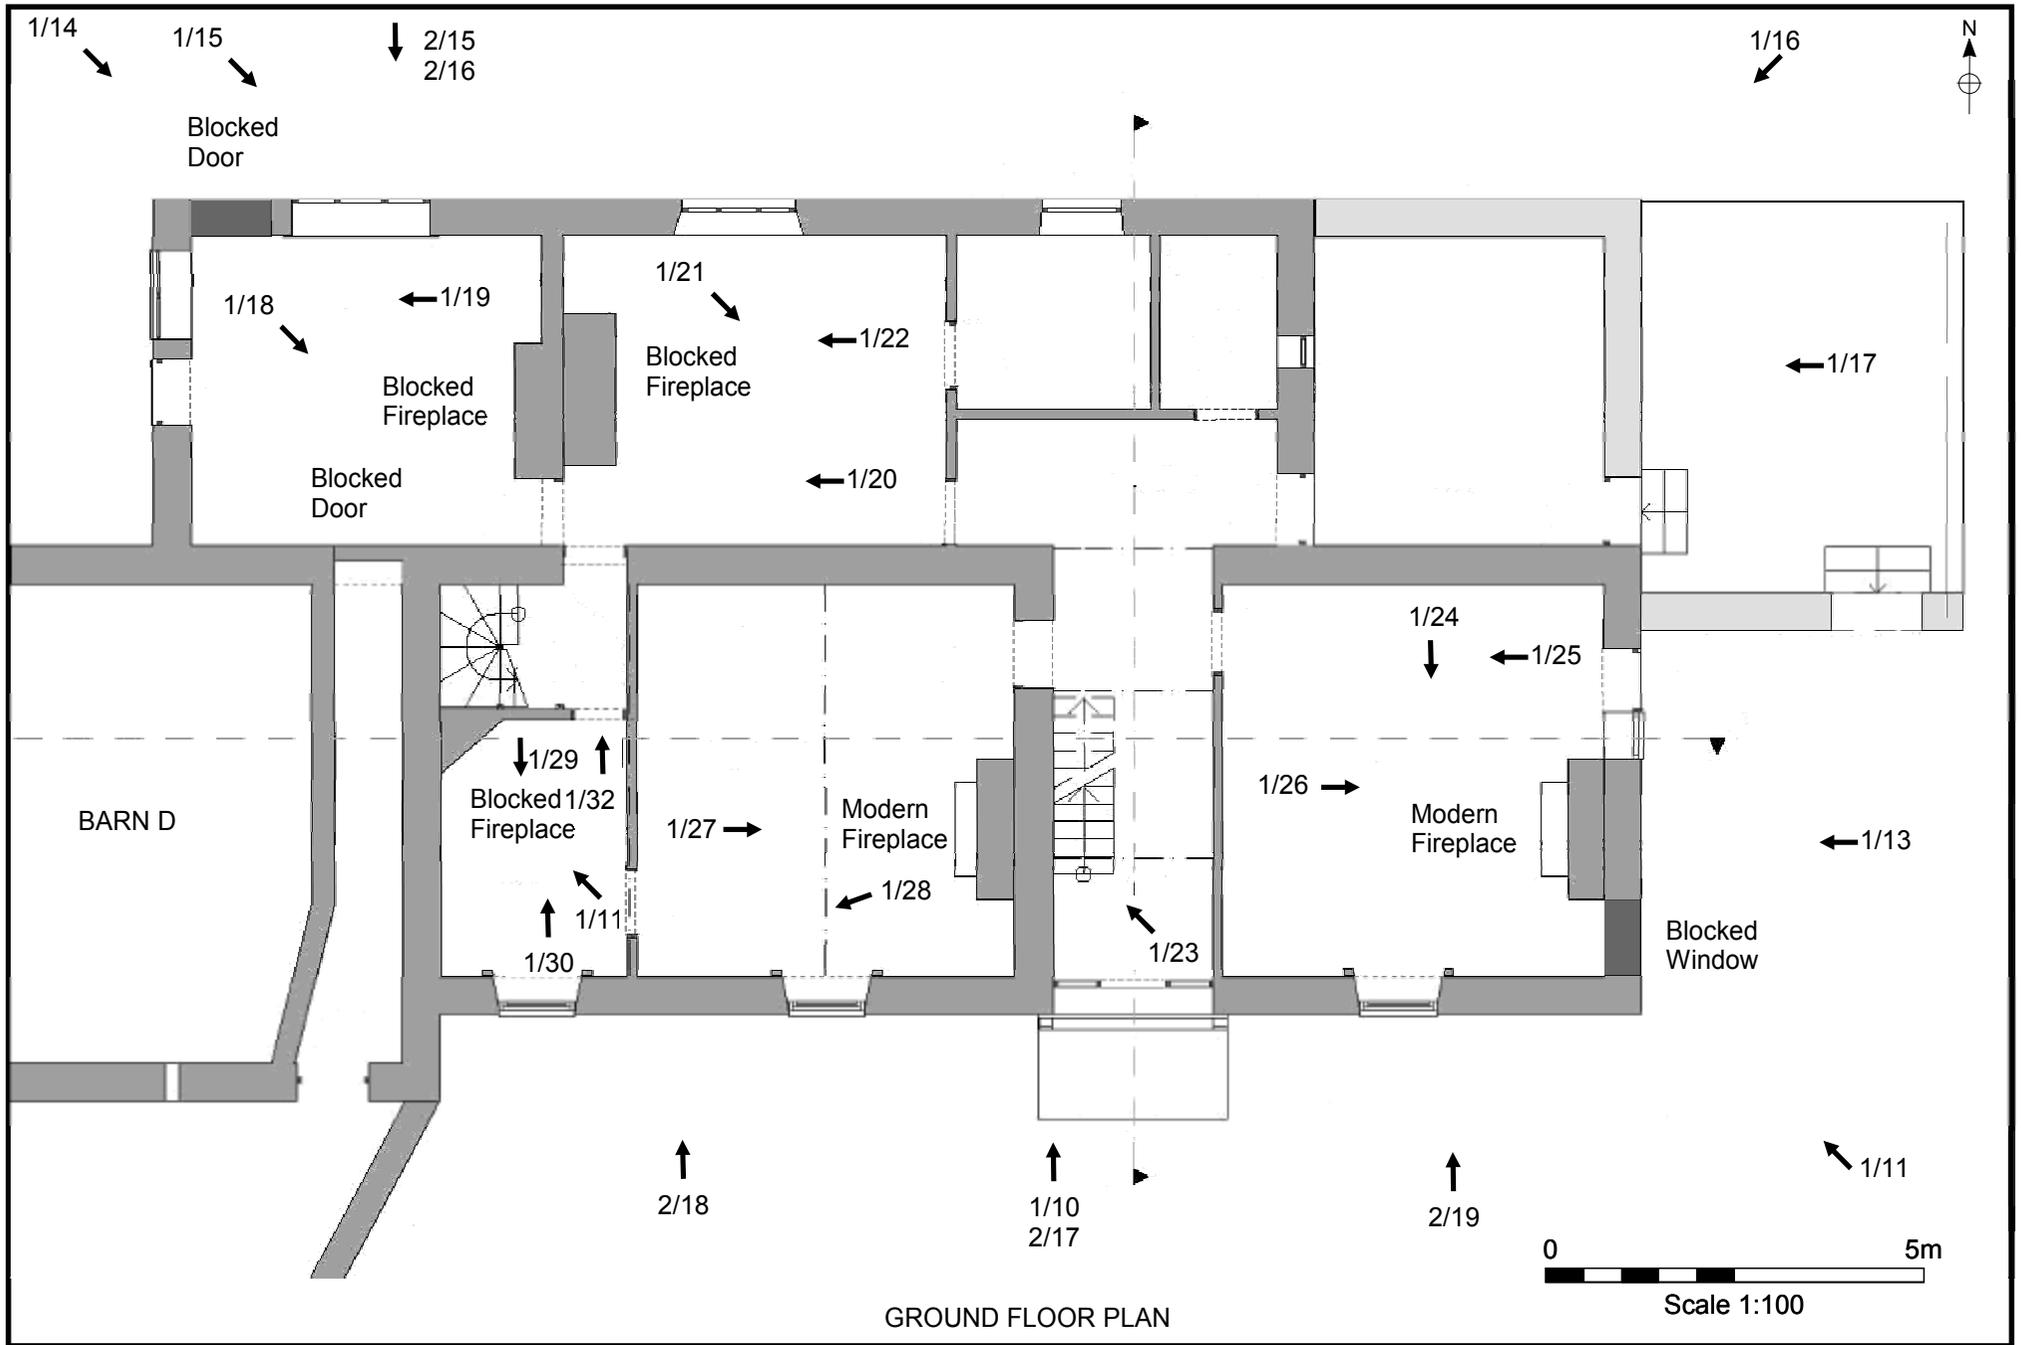


Figure 3. Glebe Farmhouse: Ground Floor Plan.
MAP 5.07.2017

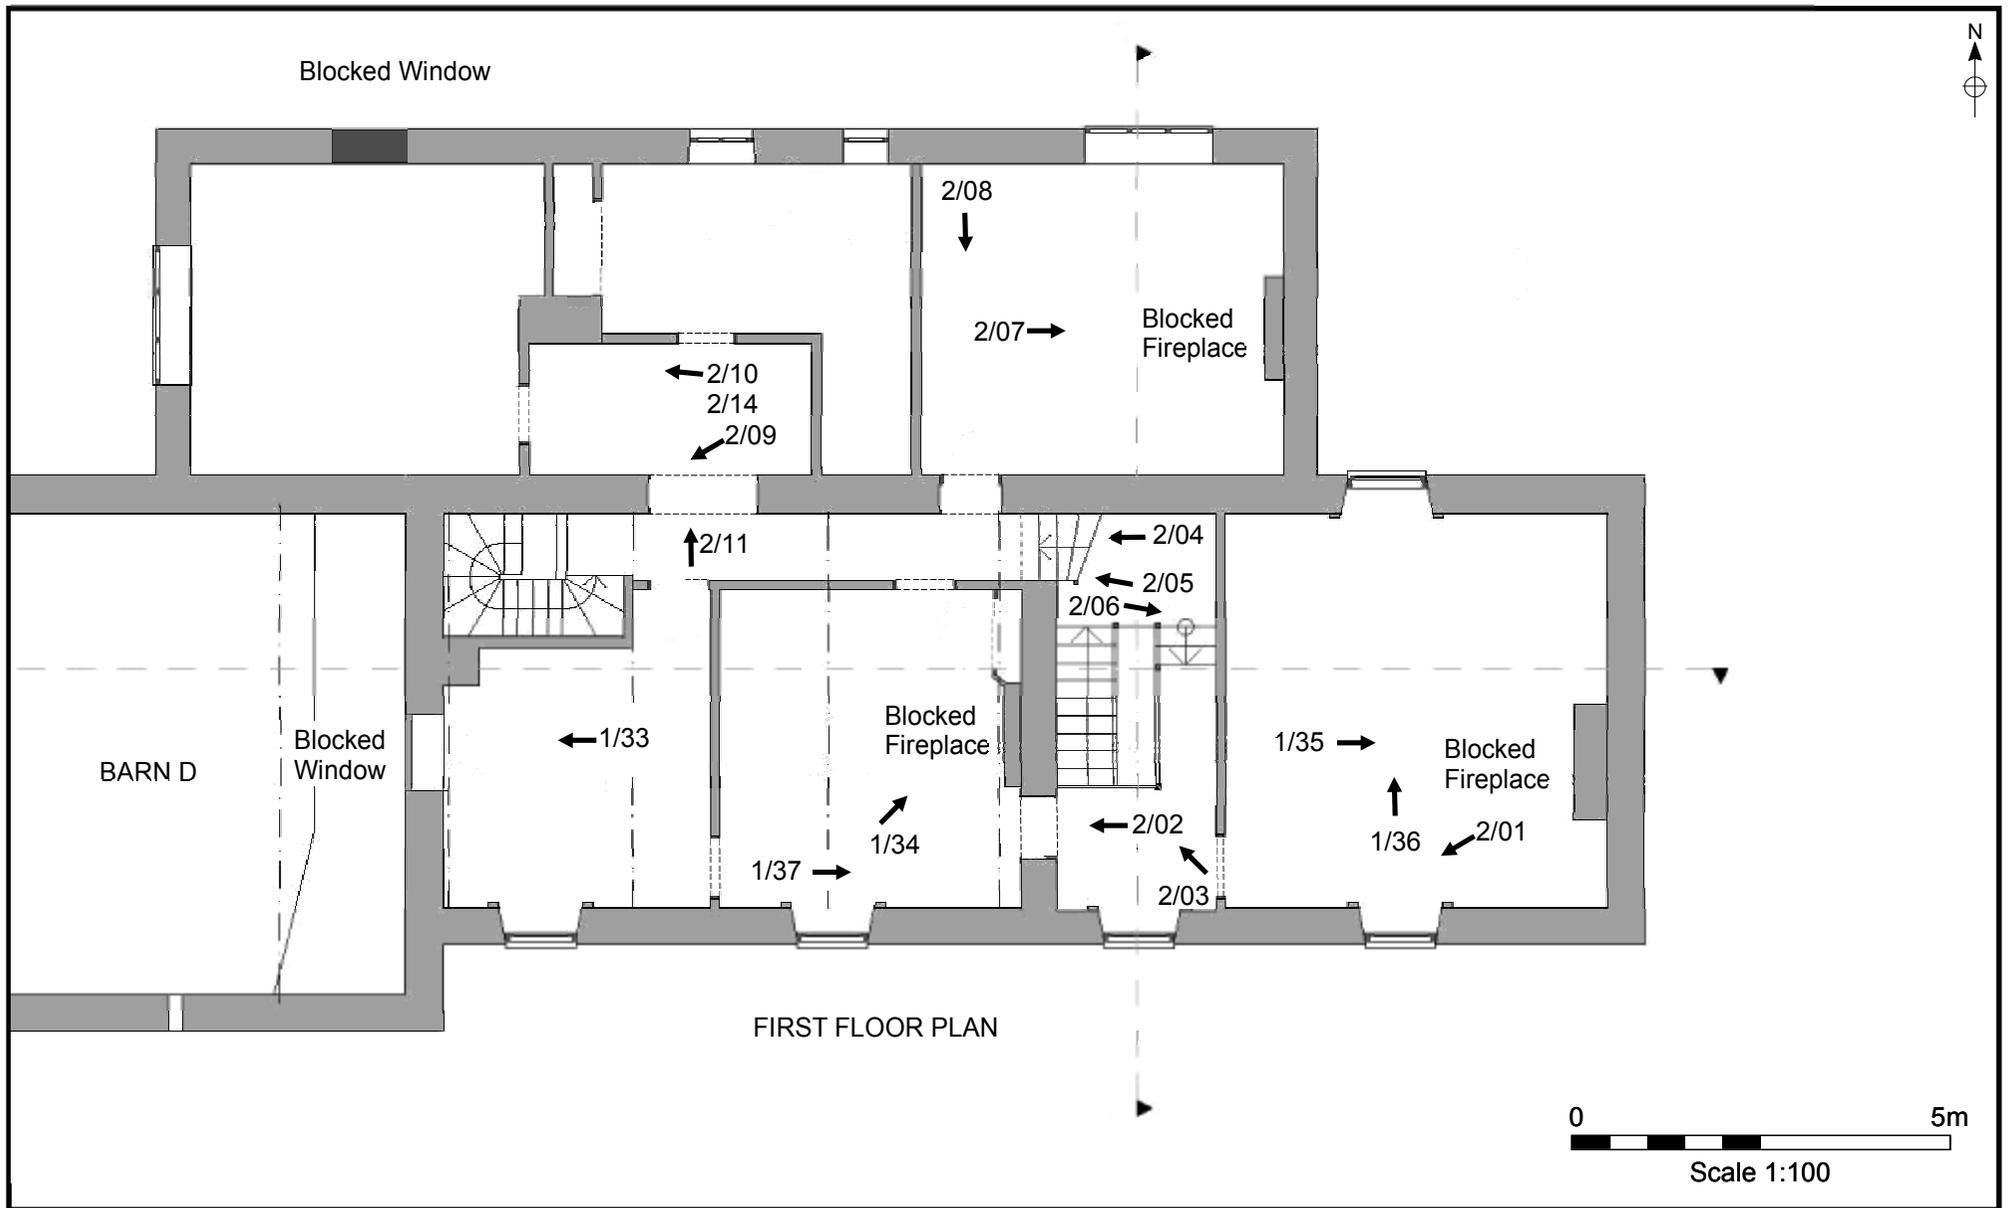


Figure 4. Glebe Farmhouse: First Floor Plan.



SOUTH ELEVATION

EAST ELEVATION

0 5m
Scale 1:100

Figure 5. Glebe Farmhouse: South and East Elevations.

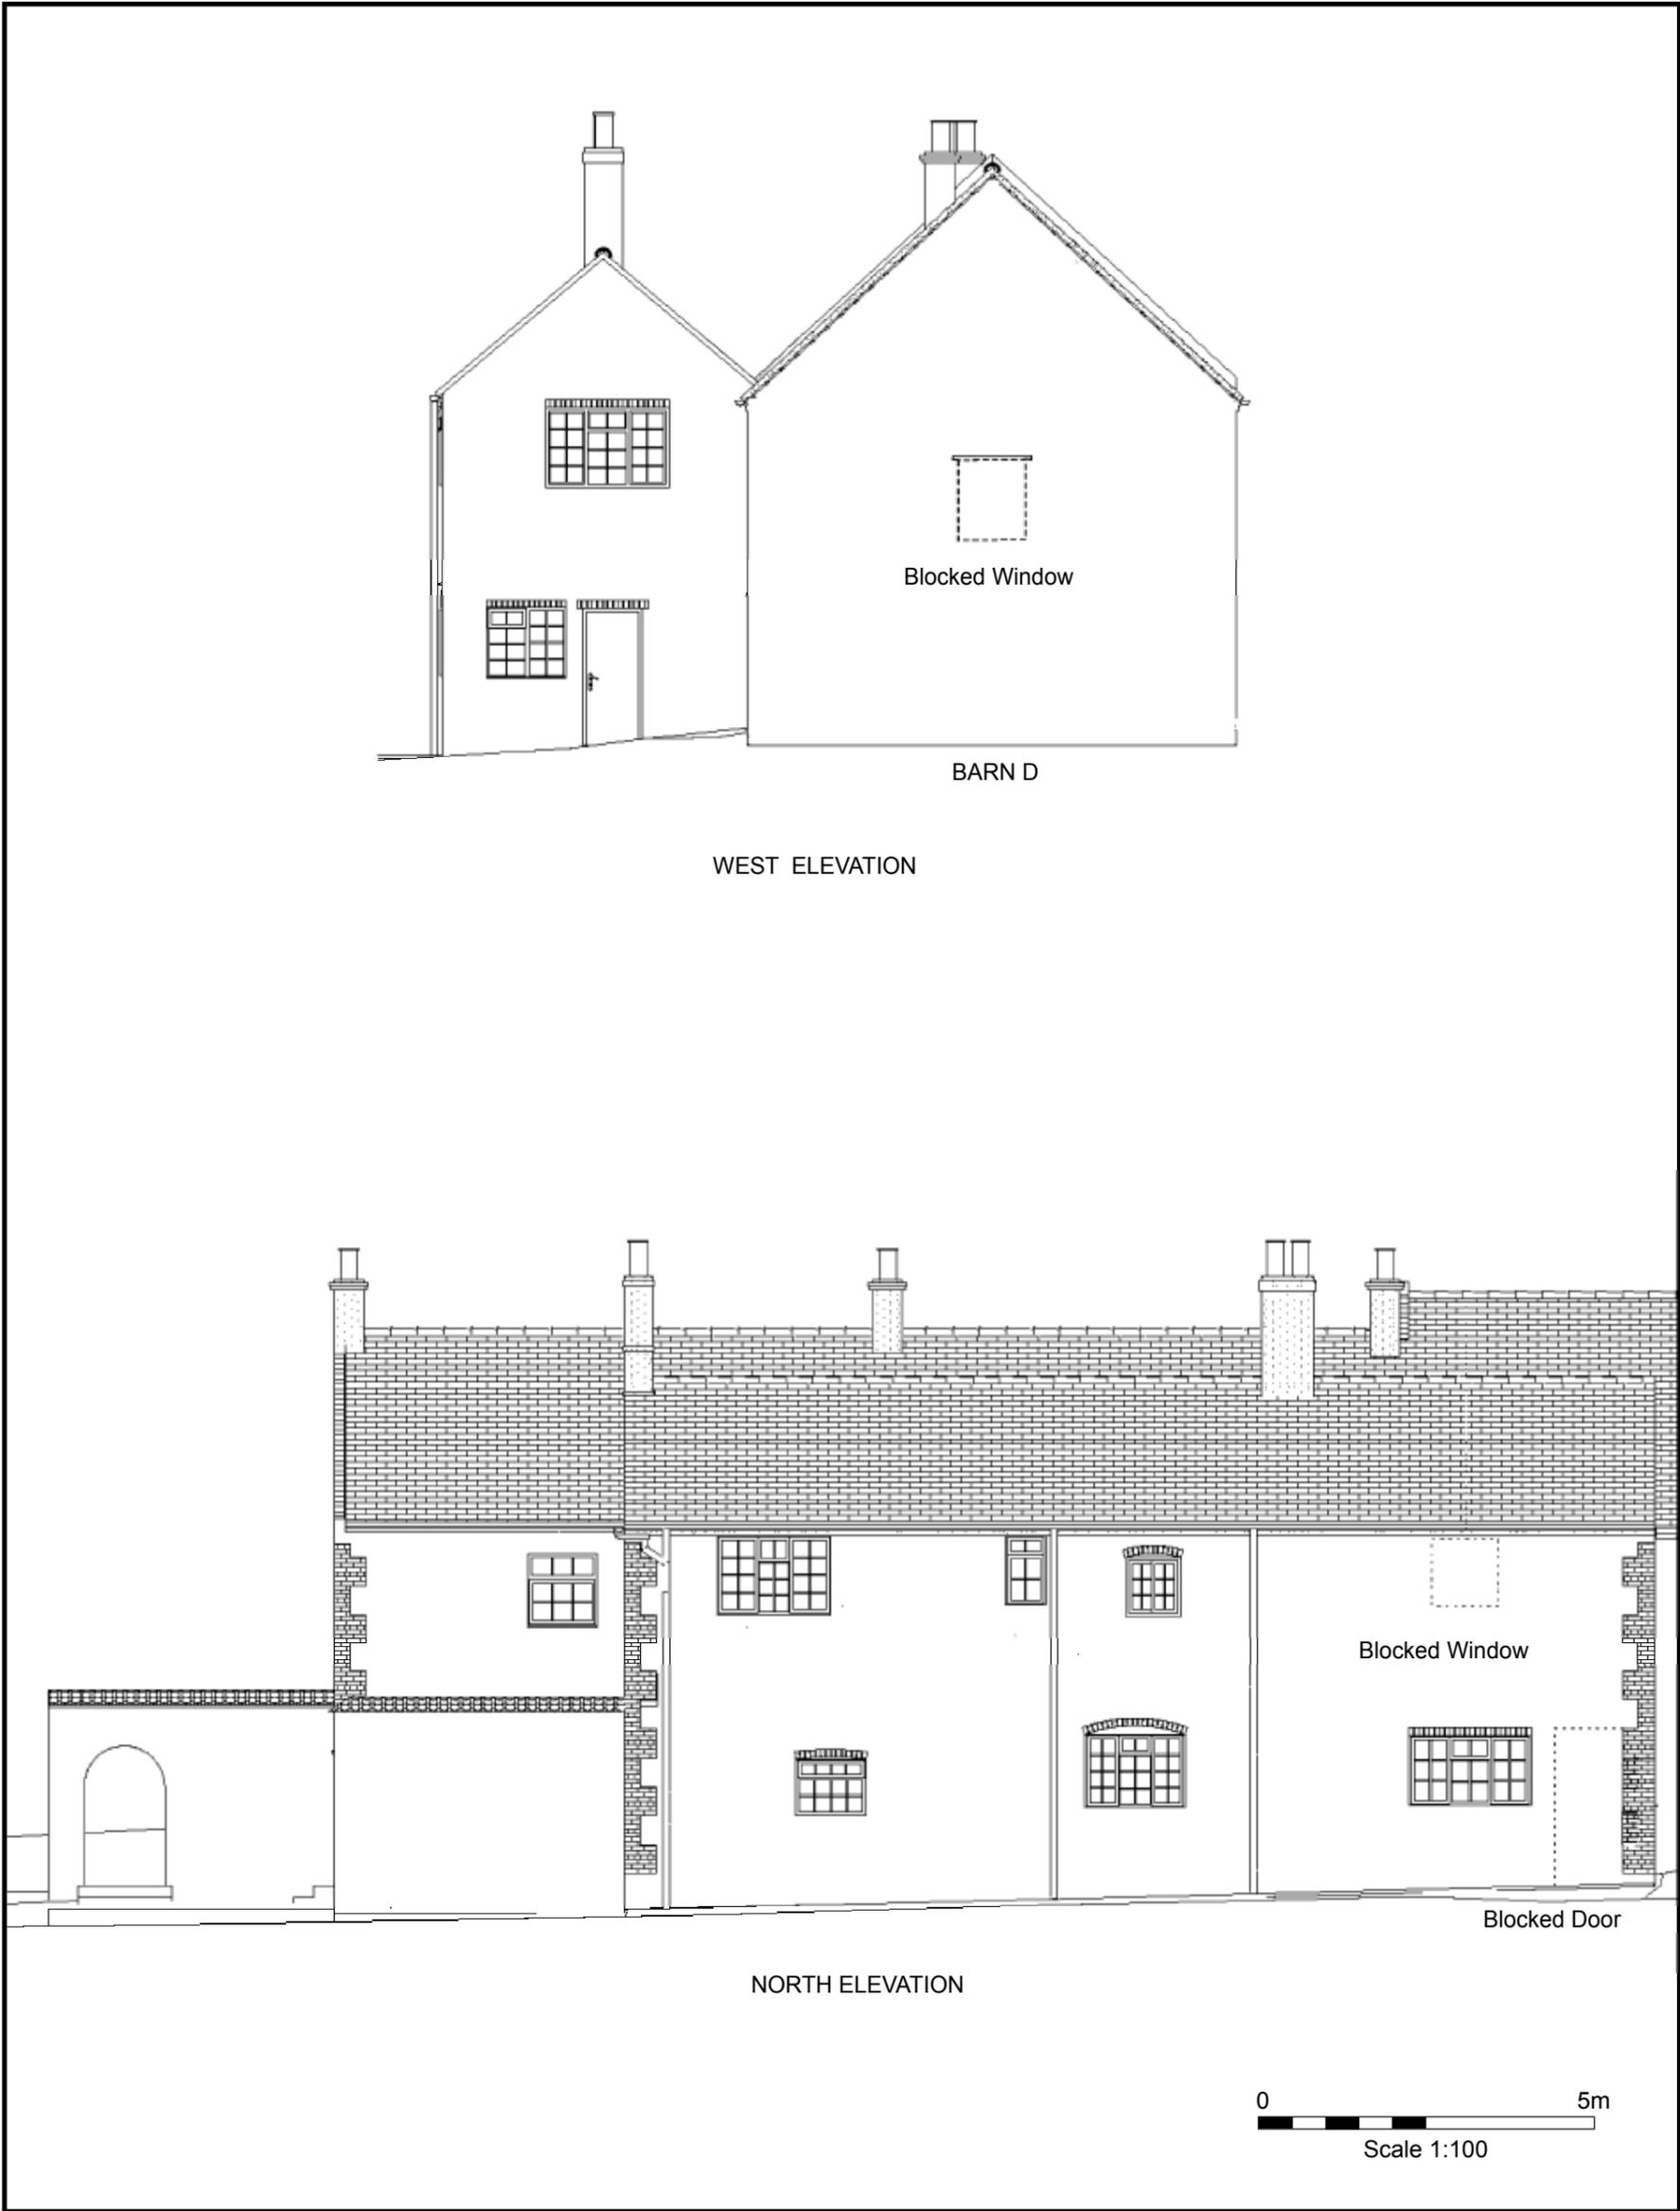


Figure 6. Glebe Farmhouse: West and North Elevations.

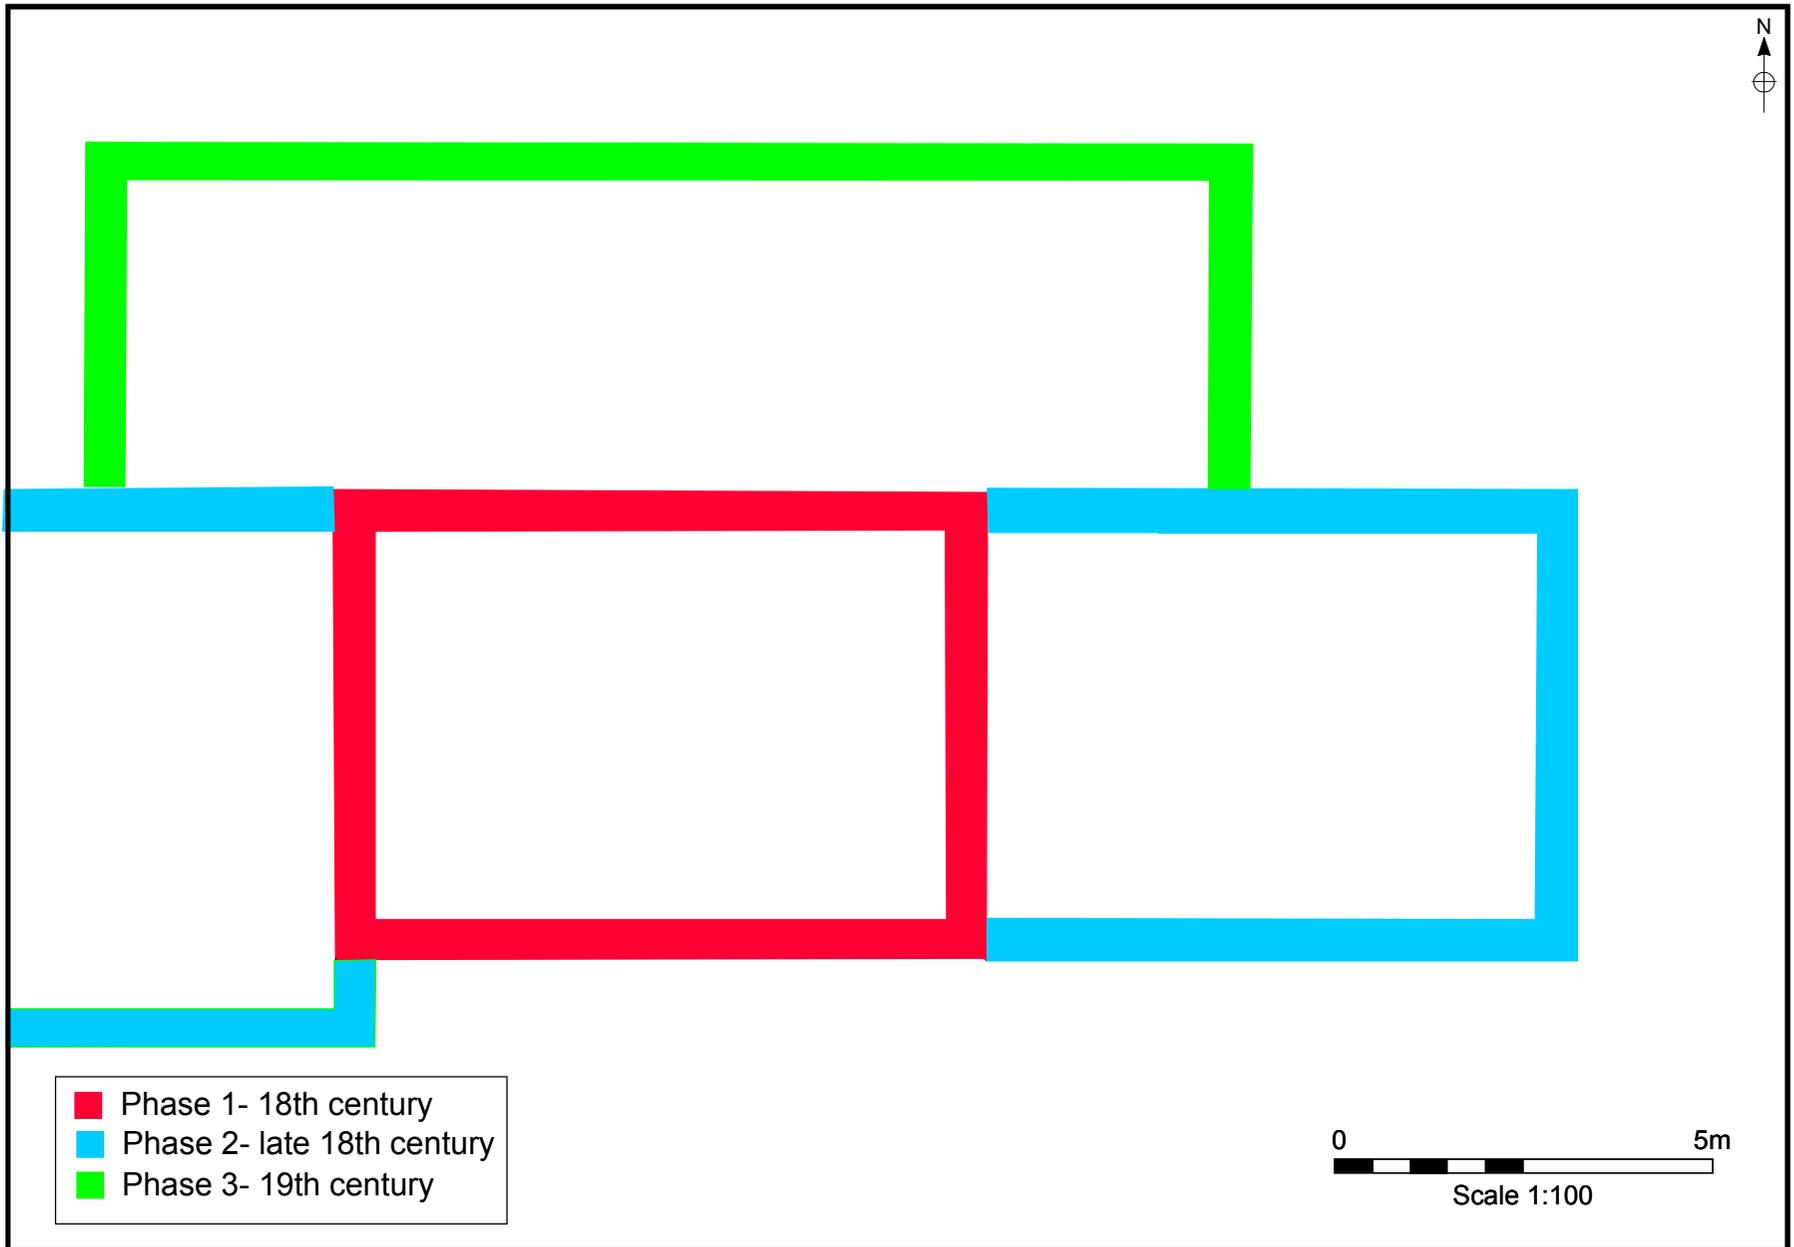


Figure 7. Glebe Farmhouse: Phasing Plan.



Plate 1. Farmhouse: Exterior East and South Elevations. Facing North-west.



Plate 2. Farmhouse: Exterior South Elevation. Facing North.



Plate 3. Farmhouse: Exterior South Elevation (East). Facing North.



Plate 4. Farmhouse: Exterior South Elevation (West). Facing North.



Plate 5. Farmhouse: Exterior East Elevation. Facing West.



Plate 6. Farmhouse: Exterior West and North Elevations. Facing South-east.



Plate 7. Farmhouse: Exterior North Elevation. Facing South.



Plate 8. Farmhouse: Exterior North Elevation (West). Facing South.



Plate 9. Farmhouse: Exterior East and North Elevations. Facing South-west.



Plate 10. Farmhouse: Exterior East Elevation. Facing West.



Plate 11. Farmhouse: Interior Ground Floor. Facing South-east.

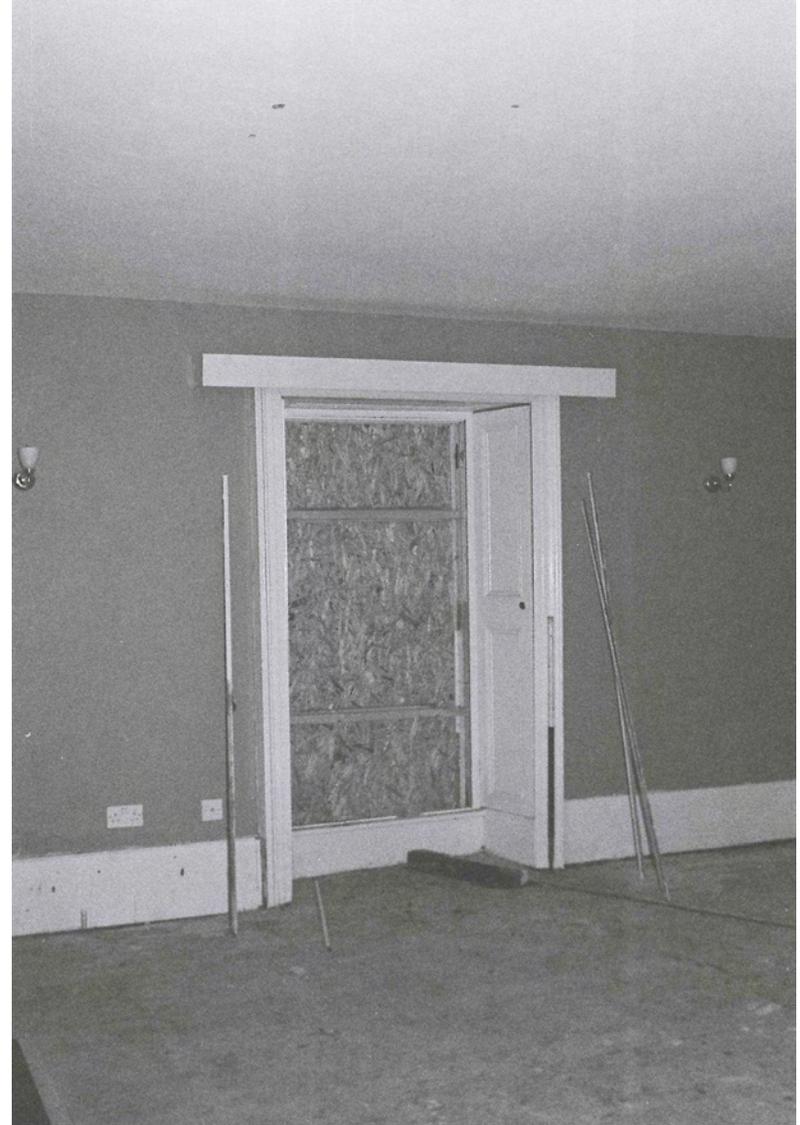


Plate 12. Farmhouse: Interior Ground Floor. Facing South.



Plate 13. Farmhouse: Interior Ground Floor. Facing West.



Plate 14. Farmhouse: Interior Ground Floor. Facing North.



Plate 15. Farmhouse: Interior Ground Floor. Facing East.



Plate 16. Farmhouse: Interior Ground Floor. Facing South-west.



Plate 17. Farmhouse: Interior Ground Floor. Facing North.



Plate 18. Farmhouse: Interior Ground Floor. Facing North-west.



Plate 19. Farmhouse: Interior Ground Floor. Facing South.



Plate 20. Farmhouse: Interior Ground Floor. Facing North.



Plate 21. Farmhouse: Interior Ground Floor. Facing South-east.



Plate 22. Farmhouse: Interior Ground Floor, Facing West. PA/2016/2021 & PA/2016/2025



Plate 23. Farmhouse: Interior Ground Floor. Facing South-west.



Plate 24. Farmhouse: Interior Ground Floor. Facing South-east.

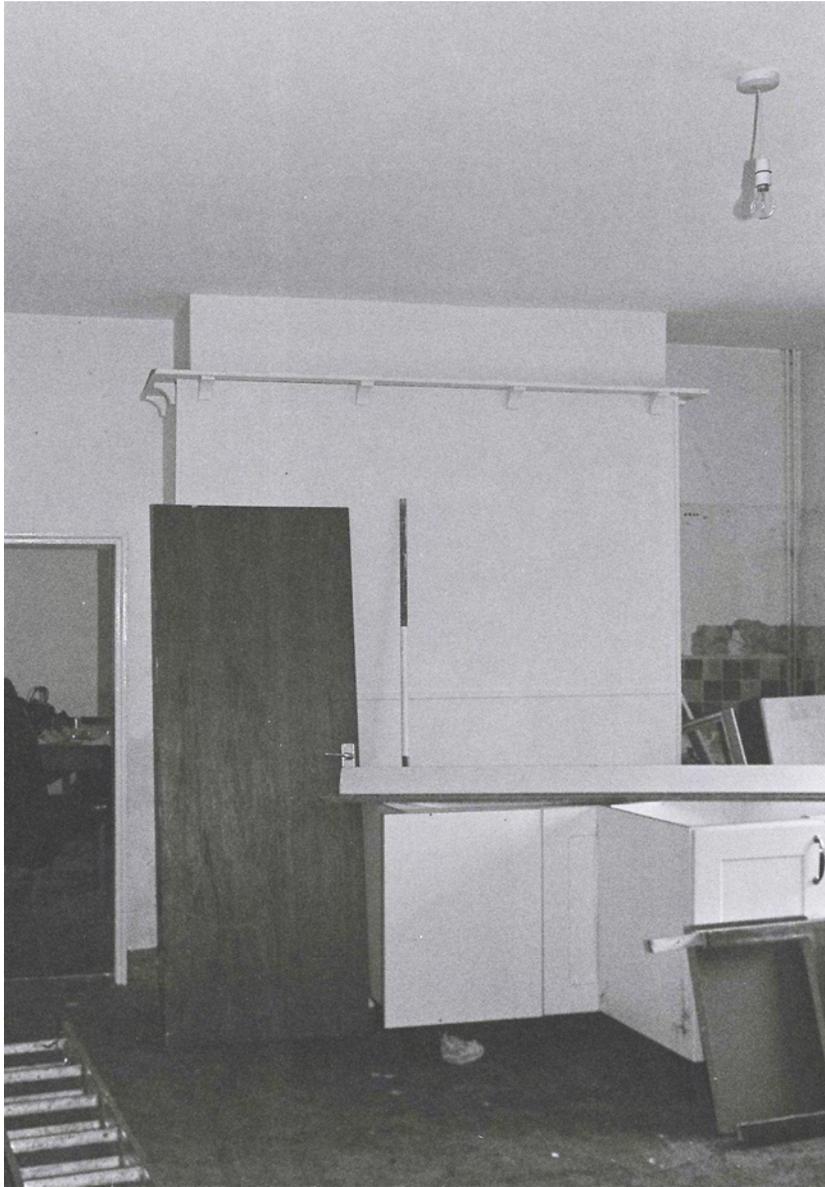


Plate 25. Farmhouse: Interior Ground Floor. Facing West.

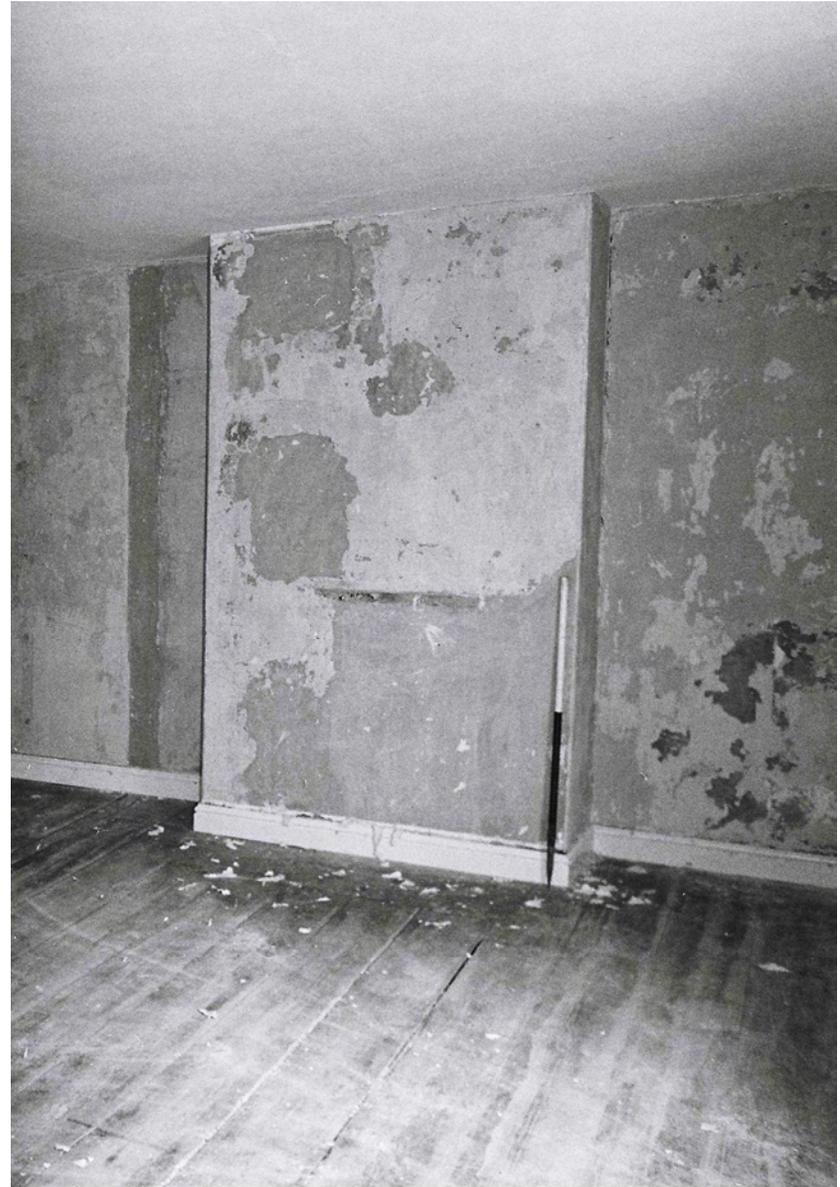


Plate 26. Farmhouse: Interior First Floor. Facing East

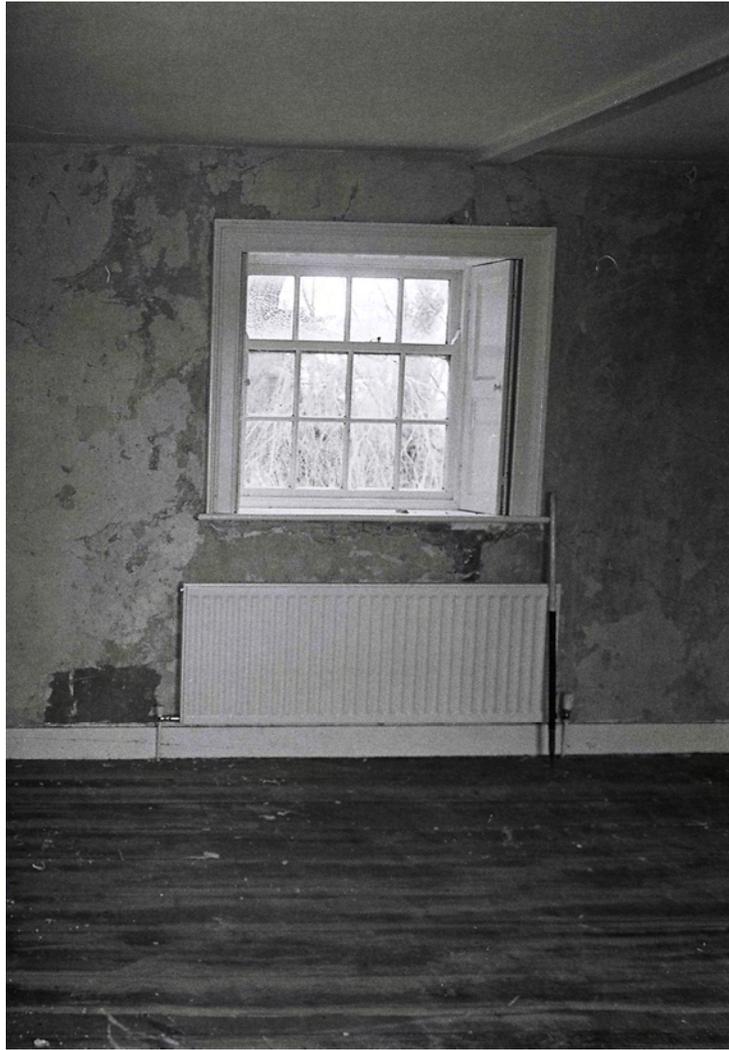


Plate 27. Farmhouse: Interior First Floor. Facing North.



Plate 28. Farmhouse: Interior First Floor. Facing South-west. PA/2016/2021 & PA/2016/2025



Plate 29. Farmhouse: Interior First Floor. Facing North.



Plate 30. Farmhouse: Interior First Floor. Facing West.



Plate 31. Farmhouse: Interior First Floor. Facing South-east.



Plate 32. Farmhouse: Interior First Floor. Facing West.



Plate 33. Farmhouse: Interior First Floor. Facing West.



Plate 34. Farmhouse: Interior First Floor. Facing South-west.



Plate 35. Farmhouse: Interior First Floor. Facing East.



Plate 36. Farmhouse: Interior First Floor. Facing West.



Plate 37. Farmhouse: Interior First Floor. Facing East.



Plate 38. Farmhouse: Interior First Floor. Facing West.



Plate 39. Farmhouse: Interior Attic. Facing West.



Plate 40. Farmhouse: Interior Attic. Facing East.

APPENDIX 1

Photographic Archive Listing

MAP 5.07.2017 - Glebe Farmhouse, Coleby Way, West Halton (SE 90462 20685)
PA/2016/2021 & PA/2016/2025

Monochrome Print (Ilford HP5 400 ASA) 35mm Format Kelly Hunter MAP Archaeological Practice Ltd

Film/ Negative	Date	Description	Exposure	Aperture
Film 1/10	15/02/2017	Glebe Farmhouse: Exterior - South North Elevation	15	f16
Film 1/11	15/02/2017	Glebe Farmhouse: Exterior - South North-west and East Elevations	60	f16
Film 1/13	15/02/2017	Glebe Farmhouse: Exterior - East West Elevation	60	f16
Film 1/14	15/02/2017	Glebe Farmhouse: Exterior - West South-east and North Elevations	60	f16
Film 1/15	15/02/2017	Glebe Farmhouse: Exterior - North South-east Elevation	60	f22
Film 1/16	15/02/2017	Glebe Farmhouse: Exterior - North South-west and East Elevations	60	f22
Film 1/17	15/02/2017	Glebe Farmhouse: Exterior - East West Elevation	60	f22
Film 1/18	15/02/2017	Glebe Farmhouse: Interior - Ground East Floor.	60	f5.6 (Flash)
Film 1/19	15/02/2017	Glebe Farmhouse: Interior - Ground West Floor.	60	f5.6 (Flash)
Film 1/20	15/02/2017	Glebe Farmhouse: Interior - Ground East Floor.	60	f5.6 (Flash)
Film 1/21	15/02/2017	Glebe Farmhouse: Interior - Ground South-east Floor.	60	f5.6 (Flash)
Film 1/22	15/02/2017	Glebe Farmhouse: Interior - Ground West Floor.	60	f5.6 (Flash)
Film 1/23	15/02/2017	Glebe Farmhouse: Interior - Ground North-west Floor.	60	f5.6 (Flash)
Film 1/24	15/02/2017	Glebe Farmhouse: Interior - Ground South Floor.	60	f5.6 (Flash)
Film 1/25	15/02/2017	Glebe Farmhouse: Interior - Ground West Floor.	60	f5.6 (Flash)
Film 1/26	15/02/2017	Glebe Farmhouse: Interior - Ground East Floor.	60	f5.6 (Flash)
Film 1/27	15/02/2017	Glebe Farmhouse: Interior - Ground East Floor.	60	f5.6 (Flash)
Film 1/28	15/02/2017	Glebe Farmhouse: Interior - Ground West Floor.	60	f5.6 (Flash)
Film 1/29	15/02/2017	Glebe Farmhouse: Interior - Ground South Floor.	60	f5.6 (Flash)
Film 1/30	15/02/2017	Glebe Farmhouse: Interior - Ground North Floor.	60	f5.6 (Flash)

Film 1/31	15/02/2017	Glebe Farmhouse: Interior - Ground Floor.	North-west	60	f5.6 (Flash)
Film 1/32	15/02/2017	Glebe Farmhouse: Interior - Ground Floor.	North	60	f5.6 (Flash)
Film 1/33	15/02/2017	Glebe Farmhouse: Interior - First Floor.	North-east	60	f5.6 (Flash)
Film 1/34	15/02/2017	Glebe Farmhouse: Interior - First Floor.	South-east	60	f5.6 (Flash)
Film 1/35	15/02/2017	Glebe Farmhouse: Interior - First Floor.	East	60	f5.6 (Flash)
Film 1/36	15/02/2017	Glebe Farmhouse: Interior - First Floor.	North	60	f5.6 (Flash)
Film 1/37	15/02/2017	Glebe Farmhouse: Interior - First Floor.	East	60	f5.6 (Flash)
Film 2/1	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/2	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/3	15/02/2017	Glebe Farmhouse: Interior - First Floor.	North	60	f5.6 (Flash)
Film 2/4	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/5	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/6	15/02/2017	Glebe Farmhouse: Interior - First Floor.	South-east	60	f5.6 (Flash)
Film 2/7	15/02/2017	Glebe Farmhouse: Interior - First Floor.	East	60	f5.6 (Flash)
Film 2/8	15/02/2017	Glebe Farmhouse: Interior - First Floor.	South	60	f5.6 (Flash)
Film 2/9	15/02/2017	Glebe Farmhouse: Interior - First Floor.	South	60	f5.6 (Flash)
Film 2/10	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/11	15/02/2017	Glebe Farmhouse: Interior - First Floor.	North	60	f5.6 (Flash)
Film 2/12	15/02/2017	Glebe Farmhouse: Interior - Attic.	West	60	f5.6 (Flash)
Film 2/13	15/02/2017	Glebe Farmhouse: Interior - Attic.	West	60	f5.6 (Flash)
Film 2/14	15/02/2017	Glebe Farmhouse: Interior - First Floor.	West	60	f5.6 (Flash)
Film 2/15	15/02/2017	Glebe Farmhouse: Exterior - North Elevation	South	60	f22
Film 2/16	15/02/2017	Glebe Farmhouse: Exterior - North Elevation	South	60	f22
Film 2/17	15/02/2017	Glebe Farmhouse: Exterior - South Elevation	North	60	f22
Film 2/18	15/02/2017	Glebe Farmhouse: Exterior - South Elevation	North	60	f22
Film 2/19	15/02/2017	Glebe Farmhouse: Exterior - South Elevation	North	60	f22

Digital Shots

Camera: Panasonic FG (14 Megapixel)

File	Date	Description	Facing
P1090196	11/08/2016	Glebe Farmhouse: Exterior - South Elevation	North
P1090197	11/08/2016	Glebe Farmhouse: Exterior - South and East Elevations	North-west
P1090198	11/08/2016	Glebe Farmhouse: Exterior - East Elevation	West
P1090199	11/08/2016	Glebe Farmhouse: Exterior - East Elevation	West
P1090200	11/08/2016	Glebe Farmhouse: Exterior - West and North Elevations	South-east
P1090201	11/08/2016	Glebe Farmhouse: Exterior - North Elevation	South
P1090202	11/08/2016	Glebe Farmhouse: Exterior - North and East Elevations	South-west
P1090203	11/08/2016	Glebe Farmhouse: Exterior - North and East Elevations	South-west
P1090204	11/08/2016	Glebe Farmhouse: Exterior - East Elevation	West
P1090205	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
P1090206	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
IMGP7291	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
IMGP7292	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	West
IMGP7293	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	West
IMGP7294	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South-east
IMGP7295	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South-west
IMGP7296	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	West
IMGP7297	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South-east
IMGP7298	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North
IMGP7299	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South
IMGP7300	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	West
IMGP7301	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
IMGP7302	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
IMGP7303	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South-west
IMGP7304	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	South

IMGP7305	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North
IMGP7306	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North-west
IMGP7307	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North
IMGP7308	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7309	11/08/2016	Glebe Farmhouse: Interior - First Floor.	North
IMGP7310	11/08/2016	Glebe Farmhouse: Interior - First Floor.	South
IMGP7311	11/08/2016	Glebe Farmhouse: Interior - First Floor.	North-east
IMGP7312	11/08/2016	Glebe Farmhouse: Interior - First Floor.	East
IMGP7313	11/08/2016	Glebe Farmhouse: Interior - First Floor.	East
IMGP7314	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	East
IMGP7315	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North-west
IMGP7316	11/08/2016	Glebe Farmhouse: Interior - Ground Floor.	North
IMGP7317	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7318	11/08/2016	Glebe Farmhouse: Interior - First Floor.	North
IMGP7319	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7320	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7321	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7322	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7323	11/08/2016	Glebe Farmhouse: Interior - First Floor.	South
IMGP7324	11/08/2016	Glebe Farmhouse: Interior - First Floor.	East
IMGP7325	11/08/2016	Glebe Farmhouse: Interior - First Floor.	South
IMGP7326	11/08/2016	Glebe Farmhouse: Interior - First Floor.	South-west
IMGP7327	11/08/2016	Glebe Farmhouse: Interior - First Floor.	West
IMGP7328	11/08/2016	Glebe Farmhouse: Interior - First Floor.	North
IMGP7329	11/08/2016	Glebe Farmhouse: Interior - Attic.	West
IMGP7330	11/08/2016	Glebe Farmhouse: Interior - Attic.	West
IMGP7331	11/08/2016	Glebe Farmhouse: Interior - Attic.	East
IMGP7332	11/08/2016	Glebe Farmhouse: Interior - Attic.	South-east

