

DB 19/2/18

Cow Tag

256

Function Code

520.2

Brief Description: [timber element, p/s, condition, fragments]

Part of fore scarf missing from Park  
for end heavily damaged

Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING

- I.B. T.1 for of cantay (c. 20cm)
- T.6 c. 60cm from aft edge
- marking lines on wood, c. 70cm from aft edge
- T.1 between 5th & 6th T.N from aft edge

O.B - N.D.R


IB: - type 3 -> sampled crack (no. 263g)

- Sapwood?
- axe marks on aft end of land form a very slight step
- aft end: clamp marks + possible clamp marks (recorded as limits) see other side

T.1	T.2	T.3	T.4	T.5	T.6	T.7	T.8
✓		✓		✓	✓		✓

Wood Science: [rings, ARW, knots, sapwood, conversion]

Intermediate at aft scarf.  
Pith beyond upper edge.  
C70 H. ARW ≈ 255 / 70.  
possibly.

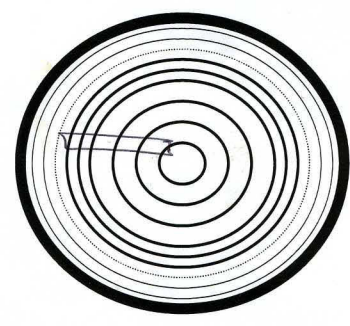

Recommended action: [samples, additional photos, moulding, queries and problems]

Cleaned: BJ VT EC  
12/09/06

Recorded: 13/09/06 DV

Photos:

Checked: [corrections needed]  
✓

Initials & Date: NN 17/10/06

Corrections Done [desktop, Faro Arm?]:

Initials & Date:

1B: two nice staple marks: one with 2 nail angles on it, because hole varies  
~~1B~~ - Rim of 1B & 0B land sampled for different caulking material <sup>in depth</sup> (no. 2640 + 2649)  
0B: forward end; land area of broken end: above 6th nail hole  
there's a square limit with nail angle, out of which came  
a small piece of metal (?) with a round bottom  
→ put in a sample bag