


NORTH

0 2 3 4 5 6 7 8 9

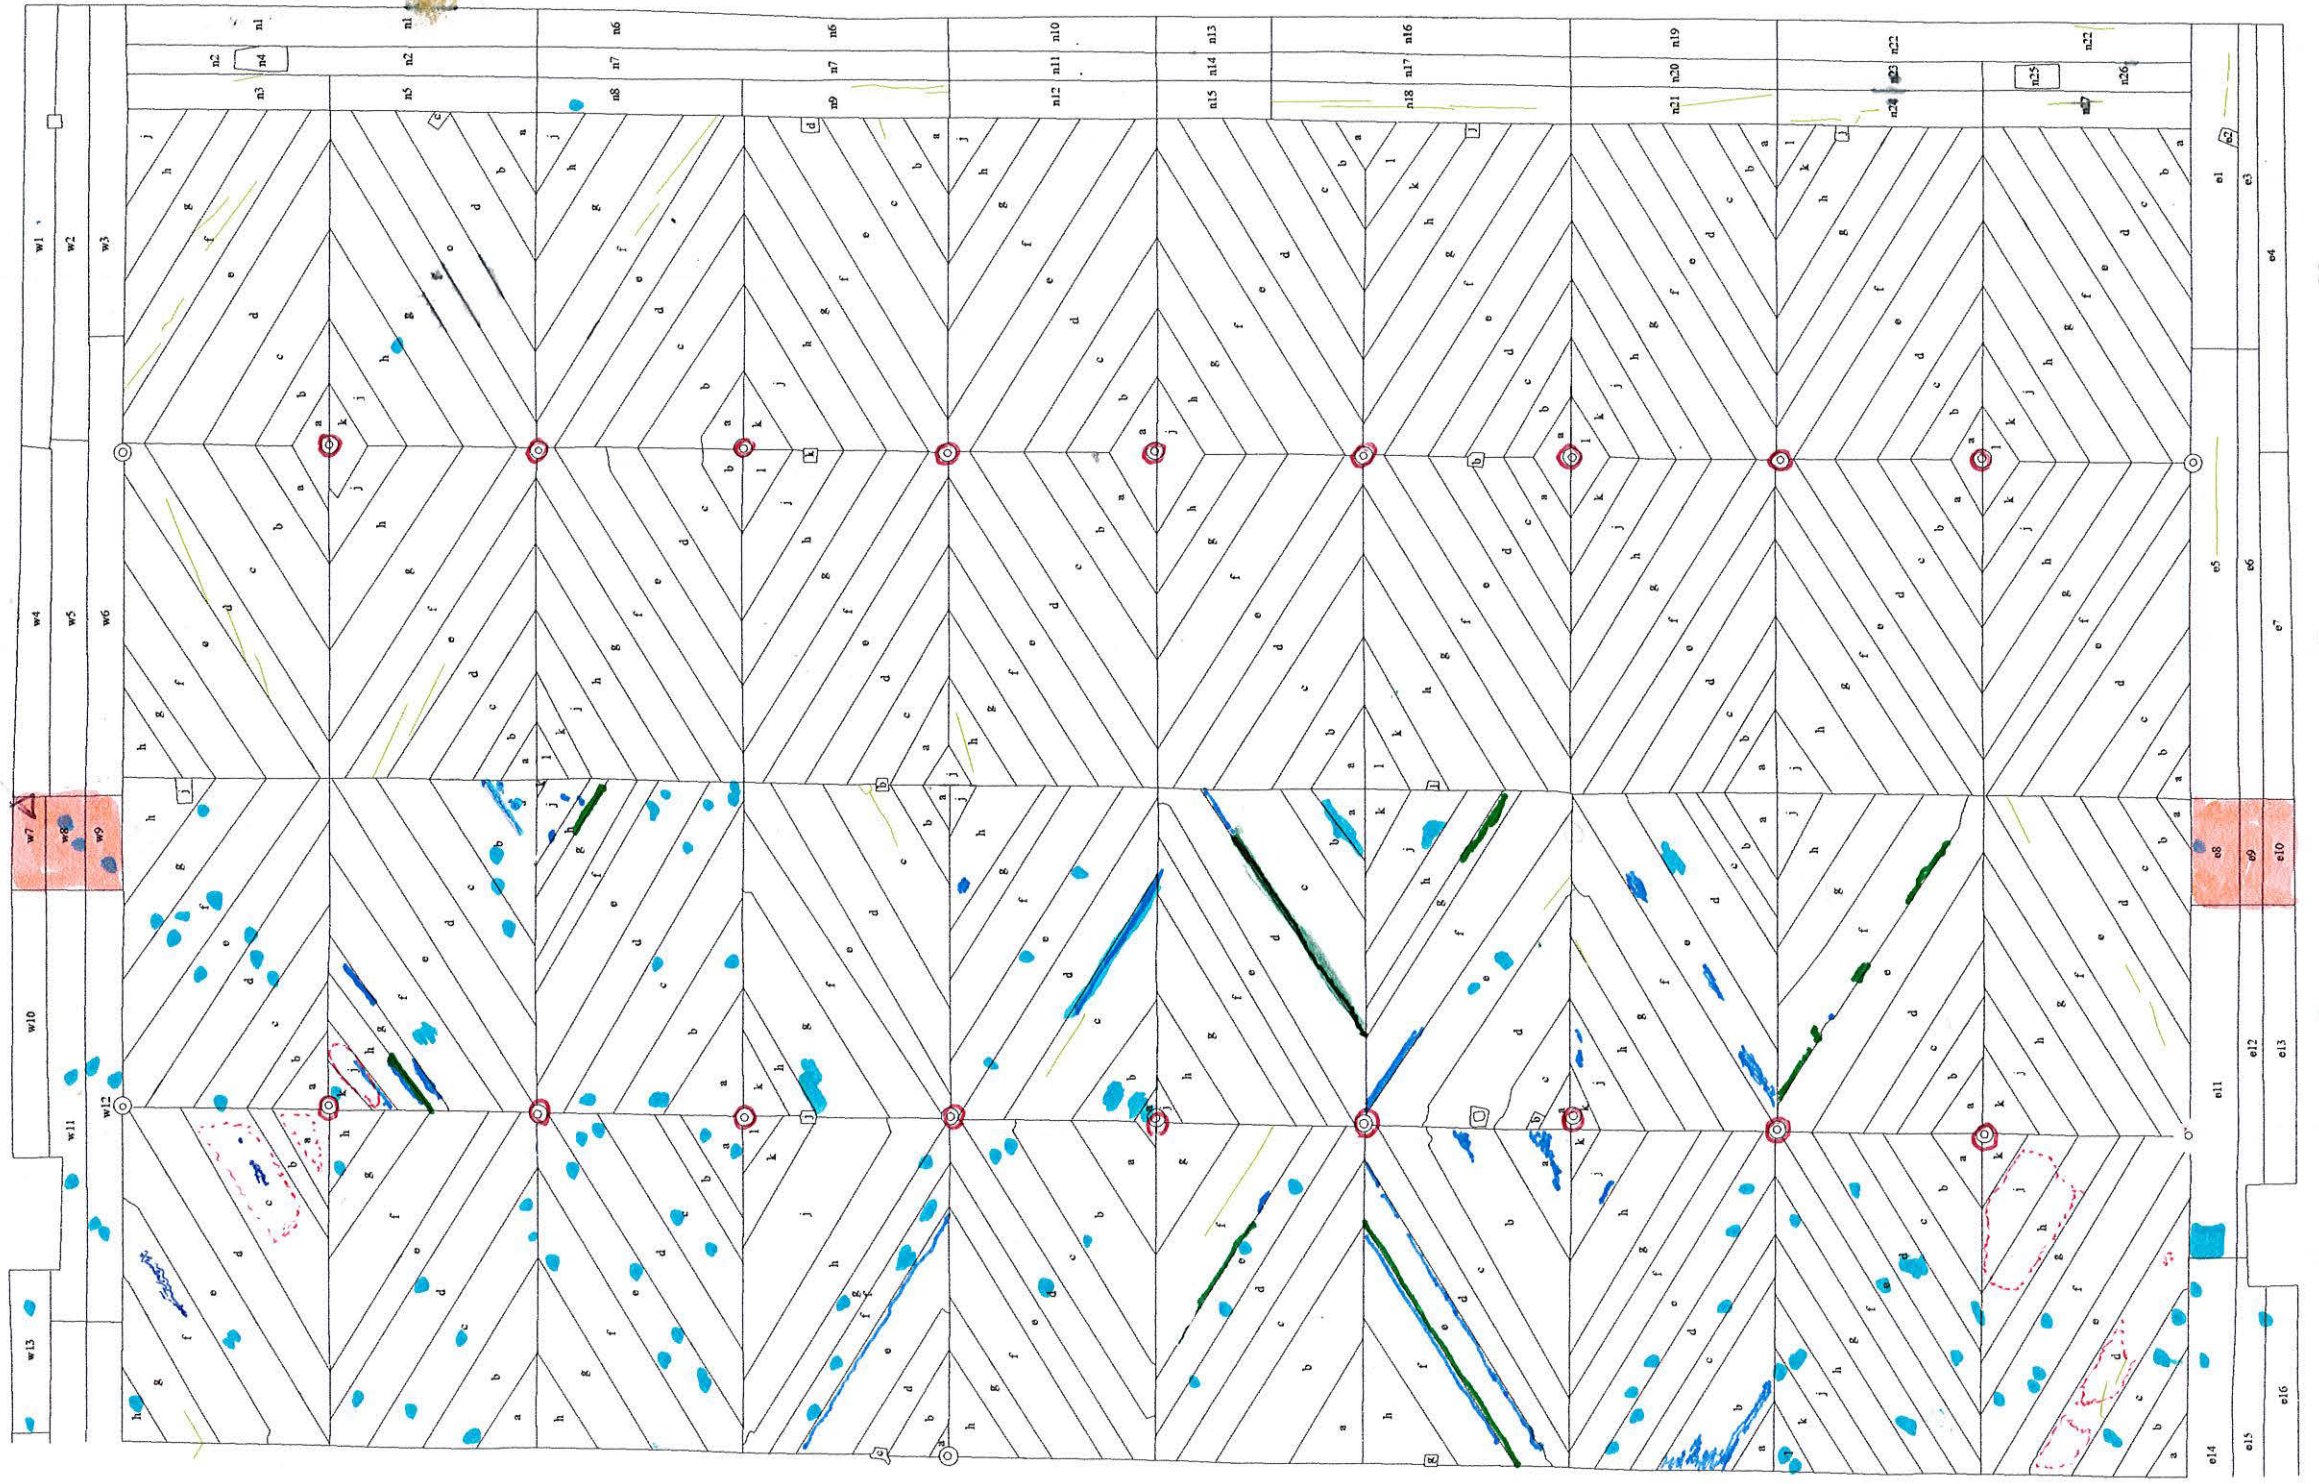

WEST

EAST


SOUTH

KEY ○ Bolts lowered plastagate washers

INSECT
GUN SHOT
WET ROT



SCALE
1:35

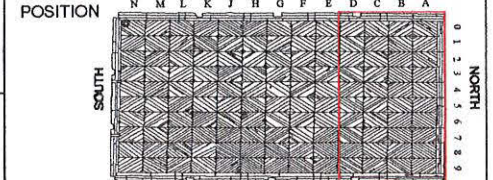


DRAWING:

TITLE
CONDITION SURVEY
AND TREATMENT

PROJECT
PETERBOROUGH CATHEDRAL
Restoration of Fire Damage
July-October 2002

AREA
SOUTH TRANSEPT
CEILING
Rows: A B C D

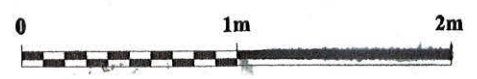


The Perry Lithgow Partnership
1 Langston Lane, Station Rd, Kingham,
Oxon OX7 6UW Tel. 01608 658067

Photogrammetry by:
The Downland Partnership
Lychgate House, Ramsbury
Wiltshire SN8 2PB

NORTH

0 1 2 4 5 6 7 8 9

Revised
Caption
Name & Date

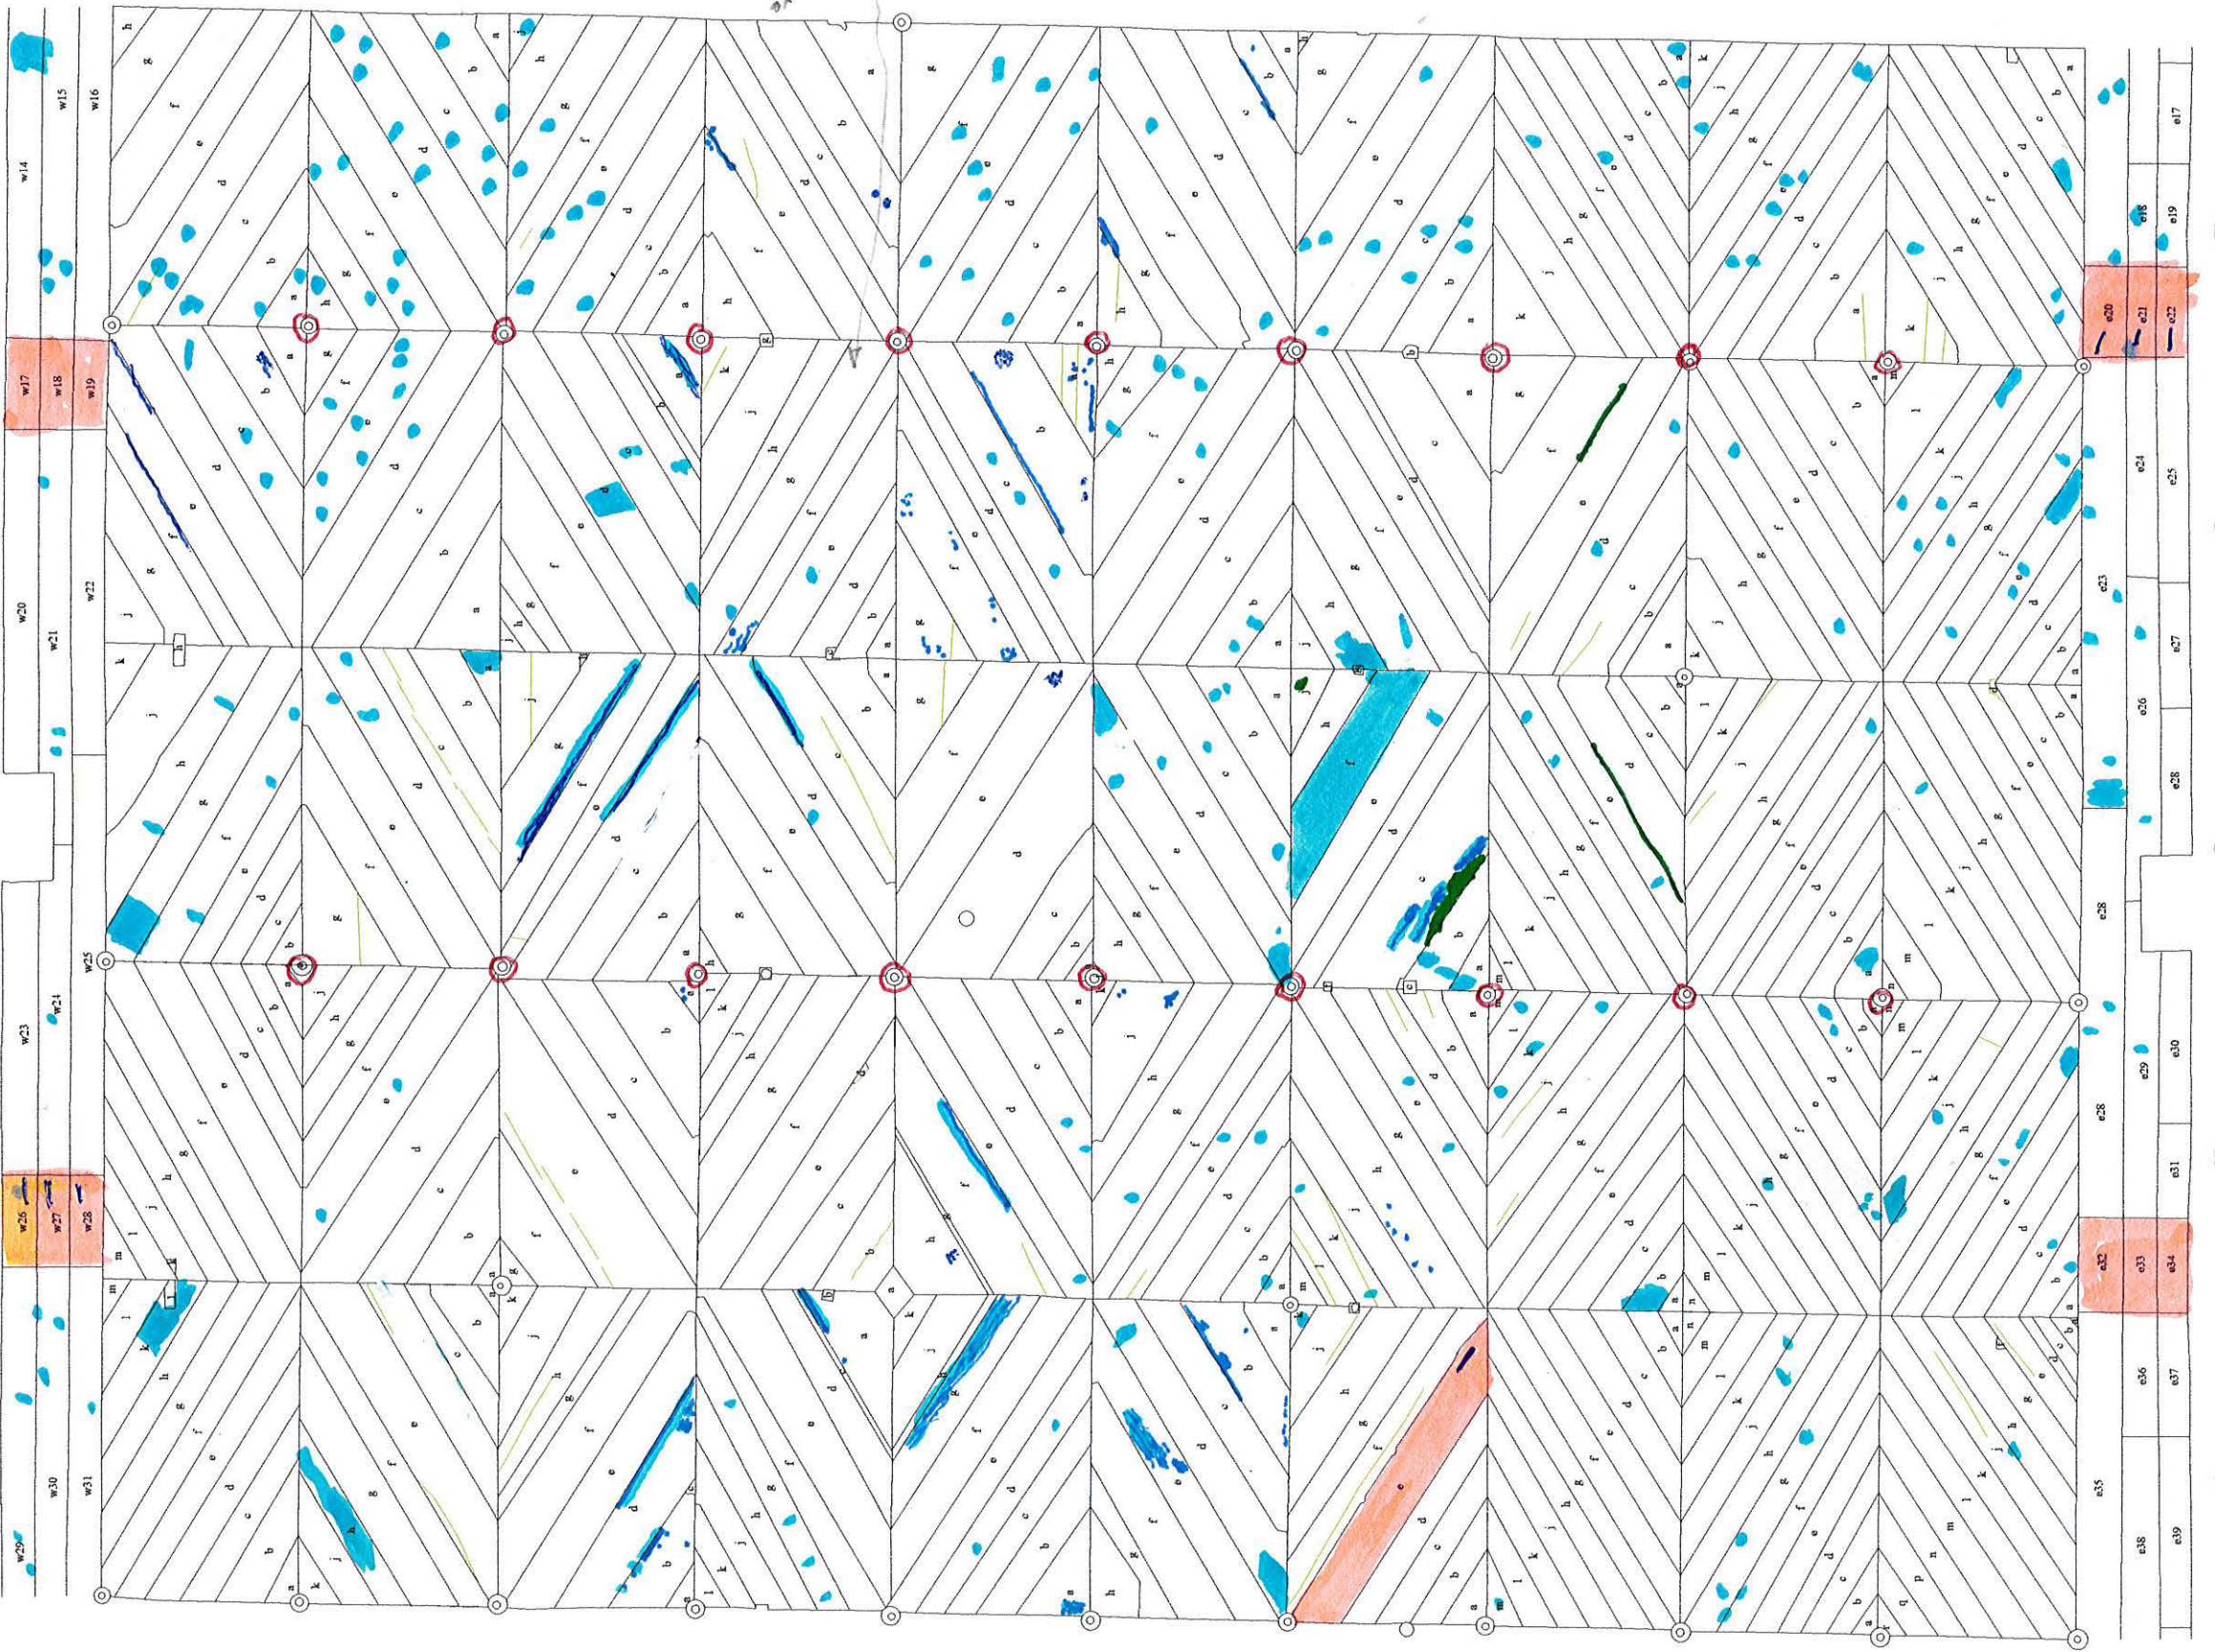

WEST

EAST

SOUTH

DRAWING:	TITLE	PROJECT	AREA			SCALE 1:35	Photogrammetry by: The Downland Partnership Lychgate House, Ramsbury Wiltshire SN8 2PB	POSITION
	CONDITION SURVEY AND TREATMENT	PETERBOROUGH CATHEDRAL Restoration of Fire Damage July-October 2002	SOUTH TRANSEPT CEILING Rows: E F G H J					

KEY
 BOARDS REMOVED FOR DENDRO
 BOARDS USED FOR DENDRO

INSECT
GUN SHOT
WET ROT


Bolts lowered
Plactagote Washers

NORTH

MAY HAVE BEEN MISTAKEN FOR KB


WEST


EAST

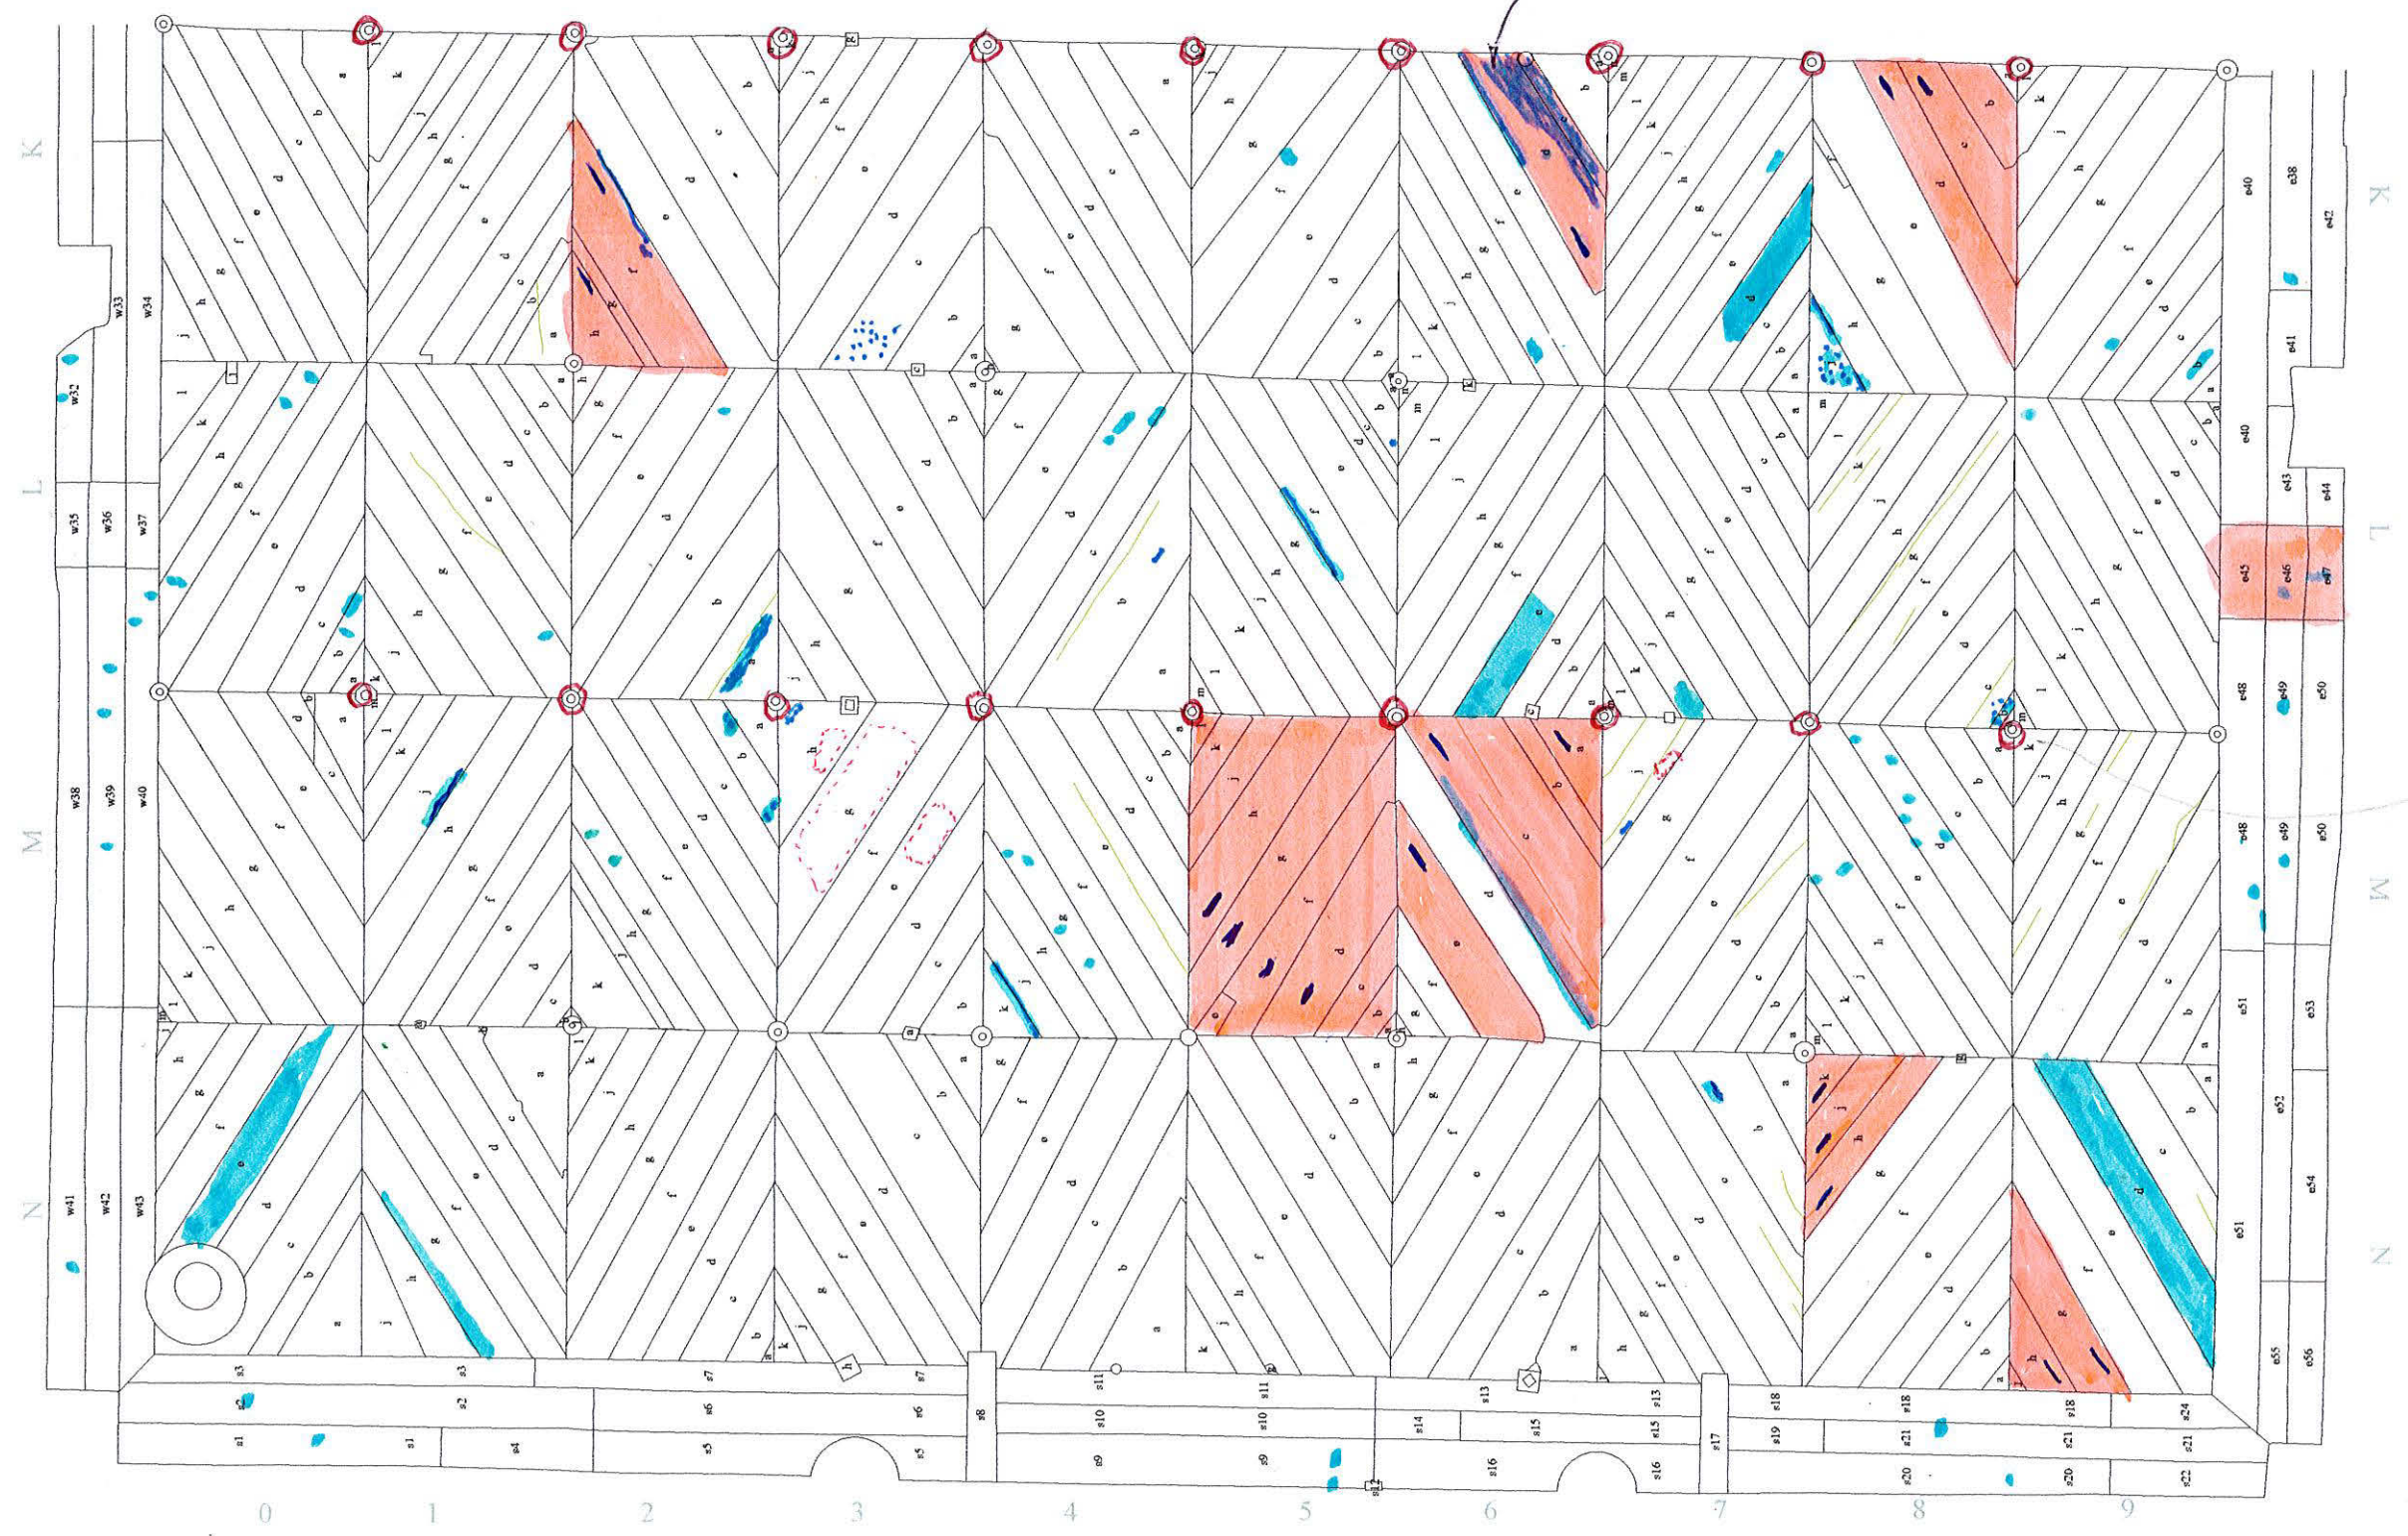



SOUTH


KEY

 BOARDS REMOVED FOR DEVAIRO

 BOARDS USED FOR DEVAIRO

 INSECT

 GUN SHOT

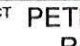
 WET ROT

54 O Belts lowered Plastazote Washers



SCALE
1:35


Photogrammetry by:
The Downland Partnership
Lychgate House, Ramsbury
Wiltshire SN8 2PB

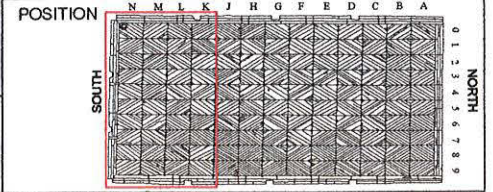


DRAWING: TITLE
CONDITION SURVEY AND TREATMENT

PROJECT PETERBOROUGH CATHEDRAL
Restoration of Fire Damage
July-October 2002

AREA SOUTH TRANSEPT
CEILING
Rows: K L M N

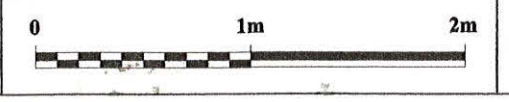

The Perry Lithgow Partnership
1 Langston Lane, Station Rd, Kingham,
Oxon OX7 6UW Tel. 01608 658067

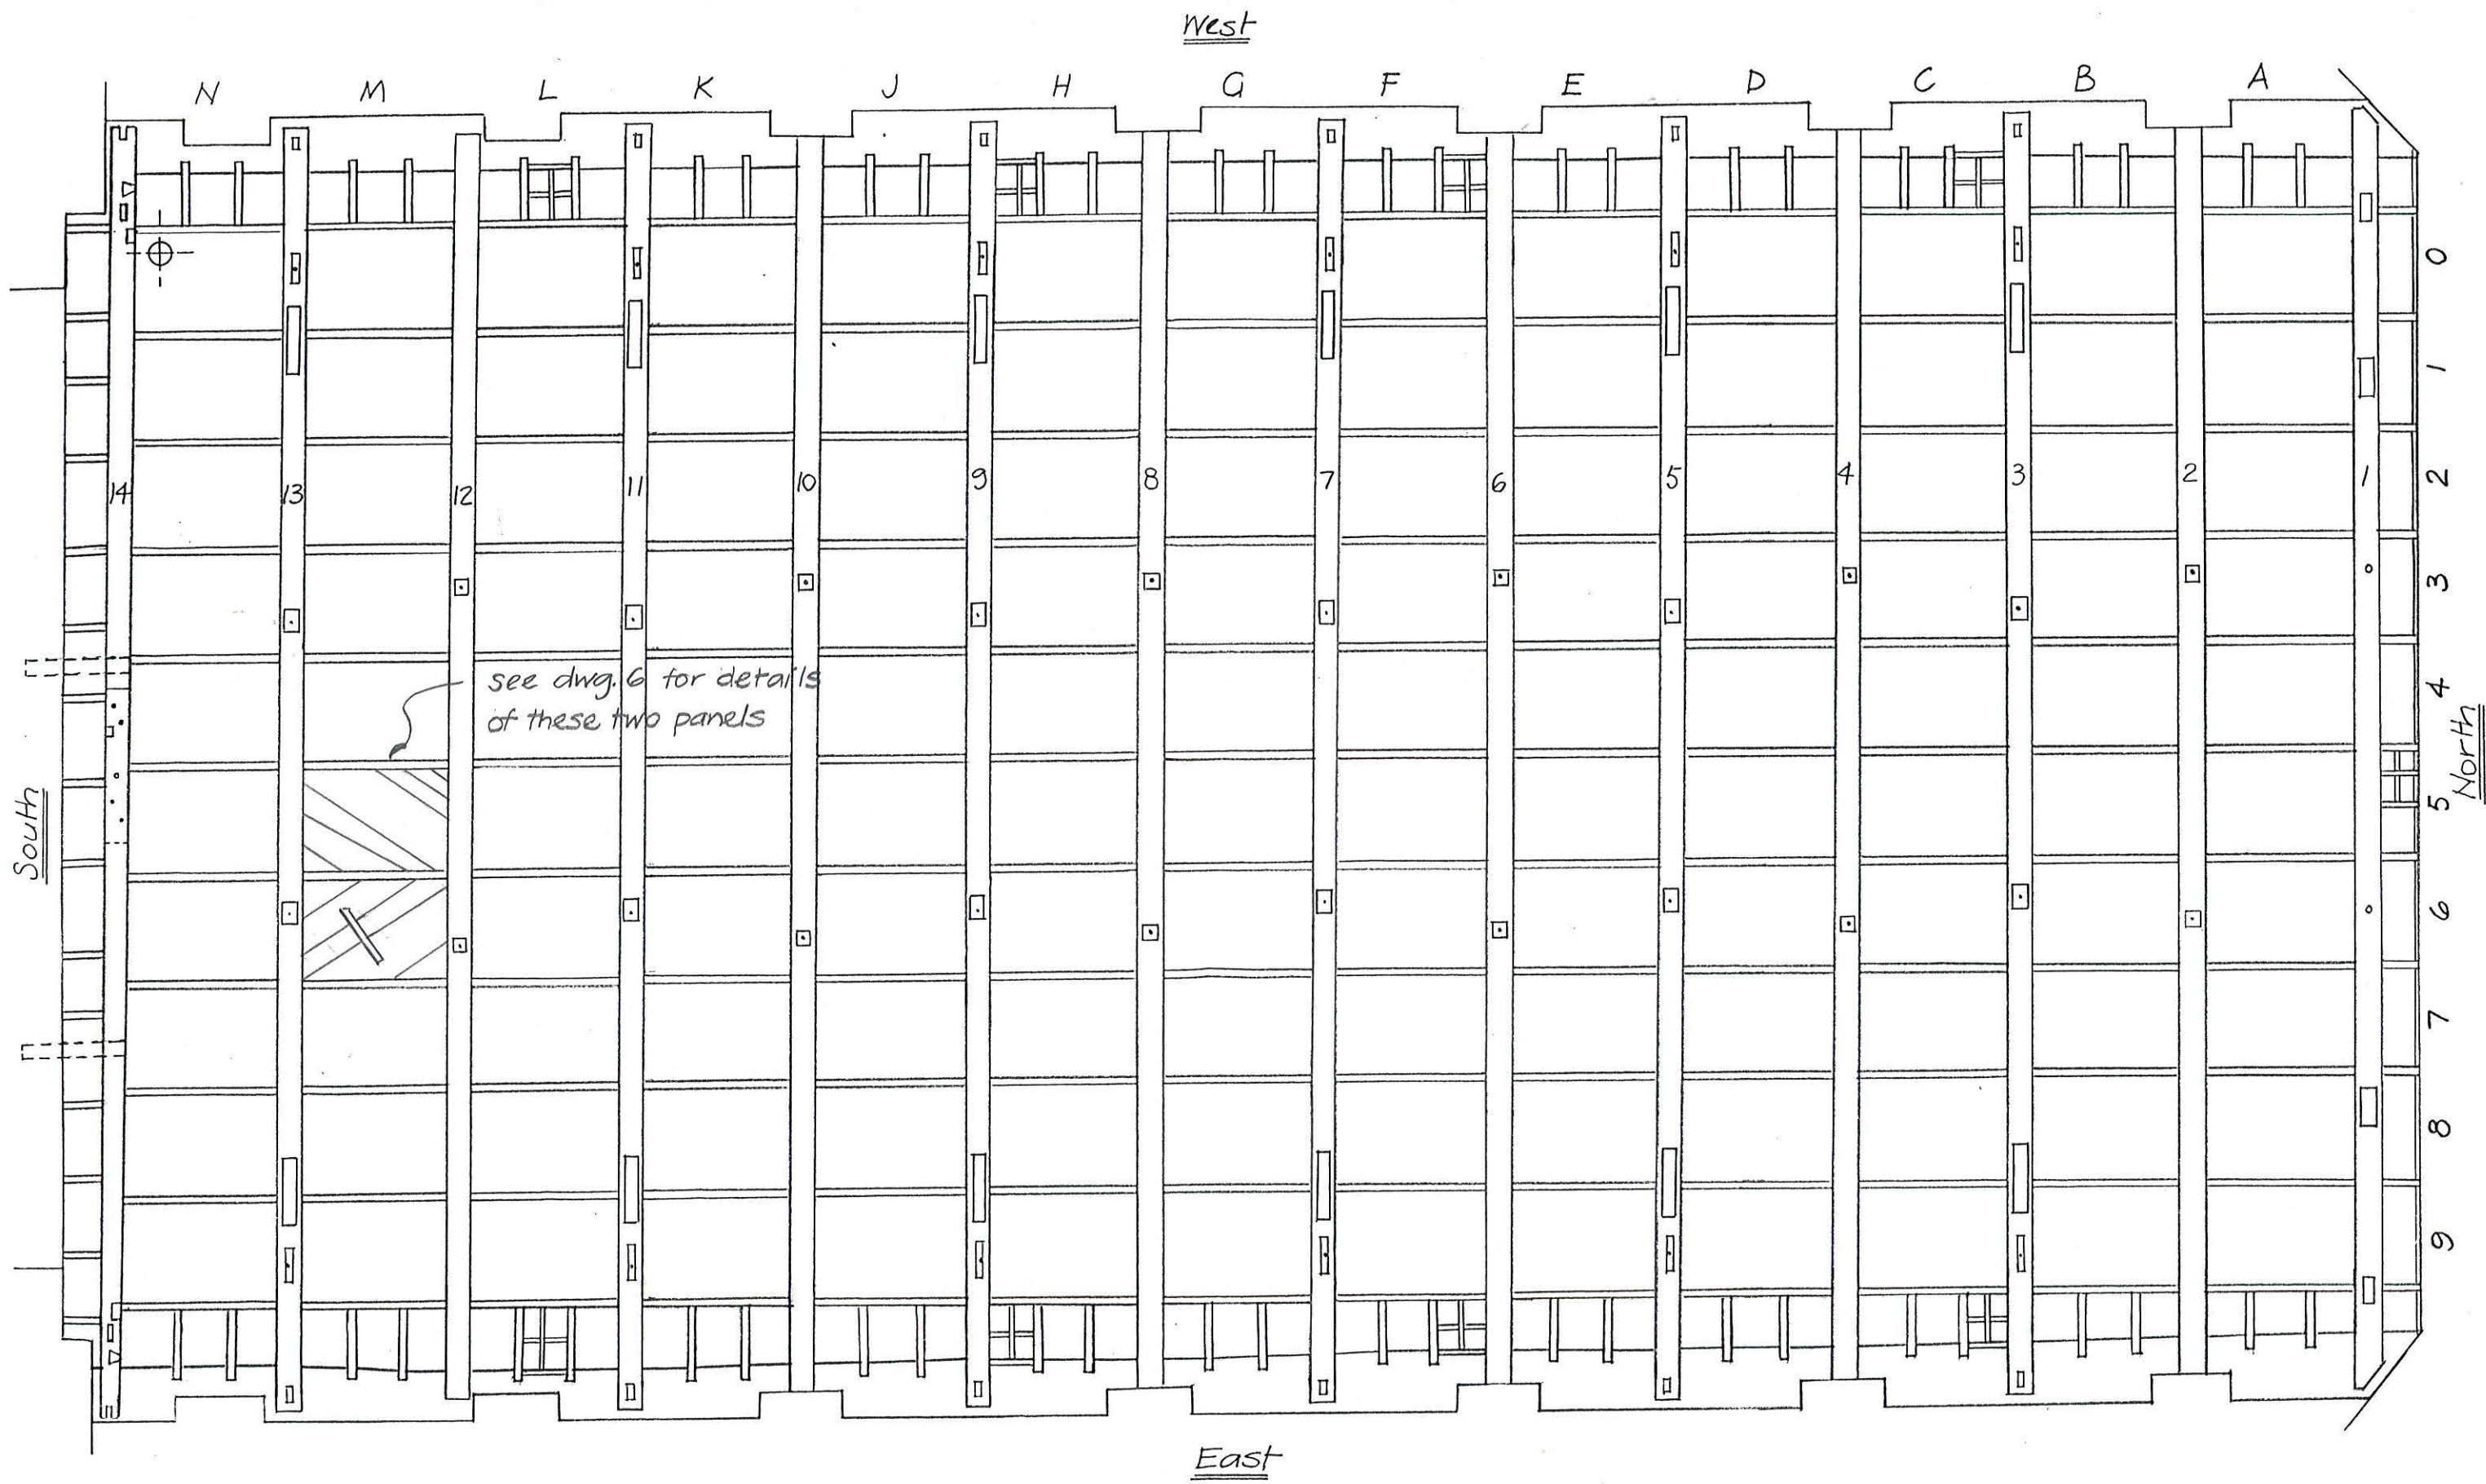

PETERBOROUGH CATHEDRAL South Transept ceiling plan from above

HUGH HARRISON CONSERVATION drawn Peter Ferguson October 2002