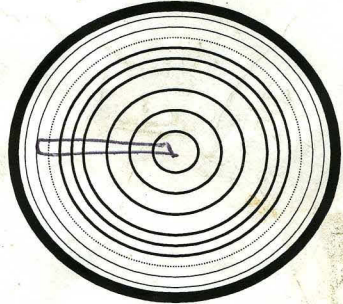


DB 5/3/2008

Cow Tag 465	Function Code 515.4	
Brief Description: [timber element, p/s, condition, fragments] Large plank, <u>deformed</u> otherwise good condition		
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos Inboard: inscribed lines next to cow tag (type 1). Tool marks (axe) on upper side. Outboard: inscribed lines. 2 additional marks		
Wood Science: [rings, ARW, knots, sapwood, conversion] Several distinct knots (epicormic?) Radial 80H+5S. ARW = 250/85 Pith beyond upper edge.		
Recommended action: [samples, additional photos, moulding, queries and problems] <ul style="list-style-type: none"> inboard: possible clamp-mark next to label F29 cut but recorded as limit of original edge nail angles of small additional nails <u>not</u> taken with 15cm rod outboard: between 3rd & 4th treenail outboard: wedge in 6th treenail inboard: inscribed lines type 1 inboard: line recorded as wear (purple) looks like a compression mark but unlikely to be of a frame because of the angle. <div style="text-align: right; margin-top: 10px;"> + ③ type 2 mark between trees with 5&6 followed by a type 1 mark </div>		
Cleaned: MS/VT/KHM 23/06/06	Recorded: DV 3/7/06	Photos:
Checked: [corrections needed] ✓		Initials & Date: NN 31/8/06
Corrections Done [desktop, Faro Arm?]:		Initials & Date:

T5

T1

485 S15_4 Yardeni Vorst 3 July 2006

more likely
with bar
outer

clump neck

