

Oak, orig no. 221, decoded No. **DB 19/05/2010**

Cow Tag **14** Type **futtock fragment.**

**Description** Poor condition - dry and cracked; 42cm in length  
 Widens from 4cm at one end to 10cm at opposite end.  
 5.5cm thick, tapering to 0.3cm. No metal fasteners. One partial  
 blind treenail. Appears to have a diameter of 2.8cm and depth  
 of 3.3cm remaining. May be some evidence of inscribed <sup>lines</sup> however  
 surface is quite degraded. Large crack, 2cm in length, penetrates  
 the piece. Too small to be part of Newport ship.


**Wood Science:** extreme cracking  
 tree ring structure unclear ?

Bark Yes  No

Sapwood Yes  No


Knotty  Yes  No some small knots

Straight grained Yes  No

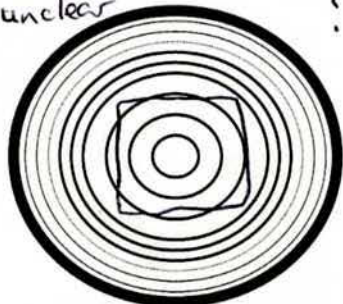

Recommended action: [samples, additional photos, moulding, queries and problems]


Checked: [corrections needed]

Cleaned: Recorded: **EMC 13/6/2010.** Photos: 


INBOARD




AFT

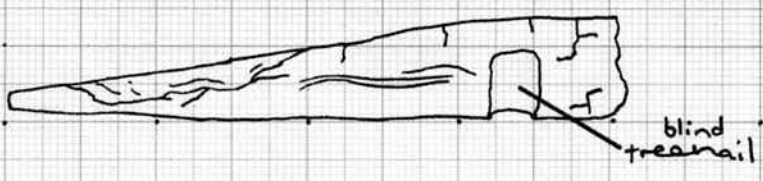

Outboard

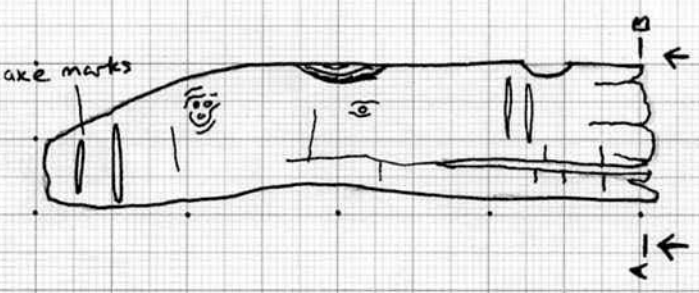

Forward

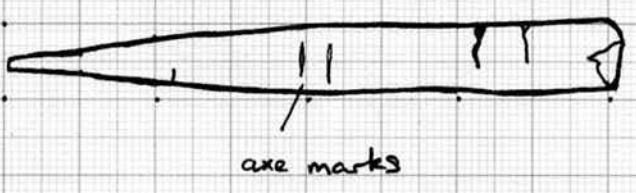

SECTION



scale 1:5