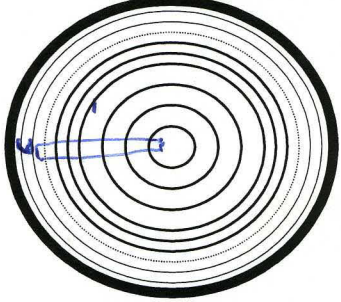


19/2/08

Cow Tag 264		Function Code S 22-2	
Brief Description: [timber element, p/s, condition, fragments] COMPLETE PLANK			
Notable Features: [tool marks, scribed lines, decoration, repairs] POINTS TO LOOK OUT FOR WHEN RECORDING ufos			
<p>INSBOARD:- INSCRIBED LINES ON LOWER EDGE OF AFT SCARF - GUIDE LINES WHERE TO CUT</p> <p>T. 1 line c. 30cm from aft scarf T. 2 line c. 20cm from aft scarf New eye lines - ' ' crossing over T. 1 line aft I convex T. 1. line c. 20cm aft of scarf</p> <p>overboard:- V. HARD CONCRETIONS + MACRO SEDIMENT + SOFT TIMBER = occasional recubital abrasion</p> <p>Small area of aft scarf feather edge 'crossing' in Rhine</p>			
Wood Science: [rings, ARW, knots, sapwood, conversion]			
<p>c 100H + 5S. Sapwood remains on after upper edge. Radial, clear growth trend. ARW = 225/105.</p> <p>1 slightly protruding central point removed.</p>			
Recommended action: [samples, additional photos, moulding, queries and problems]			
Cleaned: BJ/VT 25/07/06	Recorded: MA 28 July/06	Photos:	
Checked: [corrections needed] ✓		Initials & Date: NN 28/7/06	
Corrections Done [desktop, Faro Arm?]:		Initials & Date:	

Unusual, small (25 mm of 30mm norm) treated next to usual treated (3rd from aft). No head to this treated but does overlap next head. - STAKE?? - REPAIR??