

Cow Tag

33

Type


Plank - Hooded End

Description 131cm in length, 27cm wide, 3cm thick. Good condition. Thirteen metal fasteners, nails no longer in situ. Head impressions remain. Shafts measure 7cm x 7cm. Heads are 2cm in diameter and roughly circular in shape. Distance between nails horizontally varies from between 27cm and 38cm. Distance between top and bottom row of nails is 22cm. One complete trenail hole and one partial hole exist. Trenails no longer in situ. Diameter of holes are 3.3cm. Large knot hole in centre of the plank. No clench plate impressions. up to 20 inscribed lines are present on upper edge outboard. possible wear marks on outboard surface (End B). Evidence of fire damage at end B - hood end.

Wood Science:

- Bark Yes No
- Sapwood Yes No
- Knotty No
- Straight grained No - except around knots

slow grown
Two large knots
radially split.
Approx 100 rings.

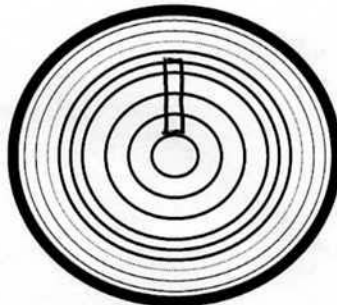

Recommended action: [samples, additional photos, moulding, queries and problems]

Dendro sample 3014

DISCARDED

Checked: [corrections needed]


NN 11/5/10


Cleaned:

Recorded:


EMC 12/4/10

Photos:

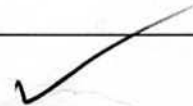


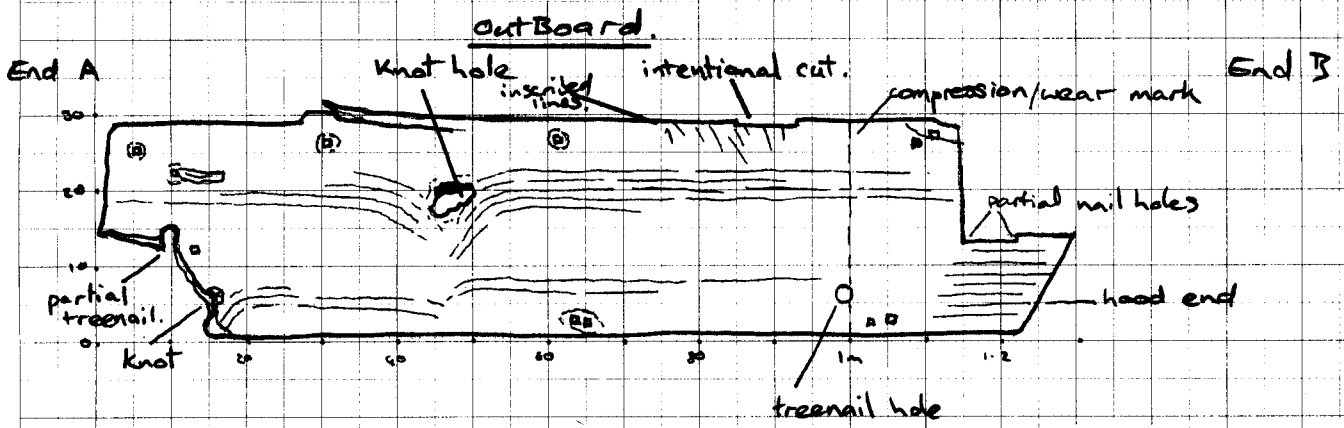


Profile

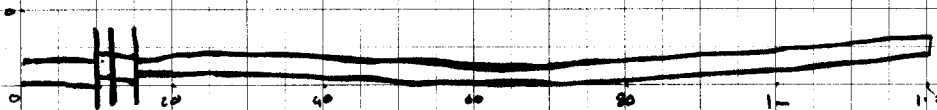

Inboard

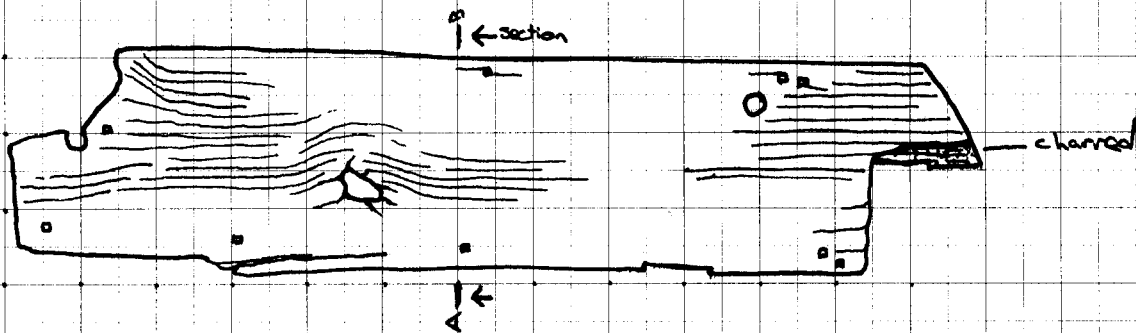

section



scale 1:10