


NORTH

WEST

EAST

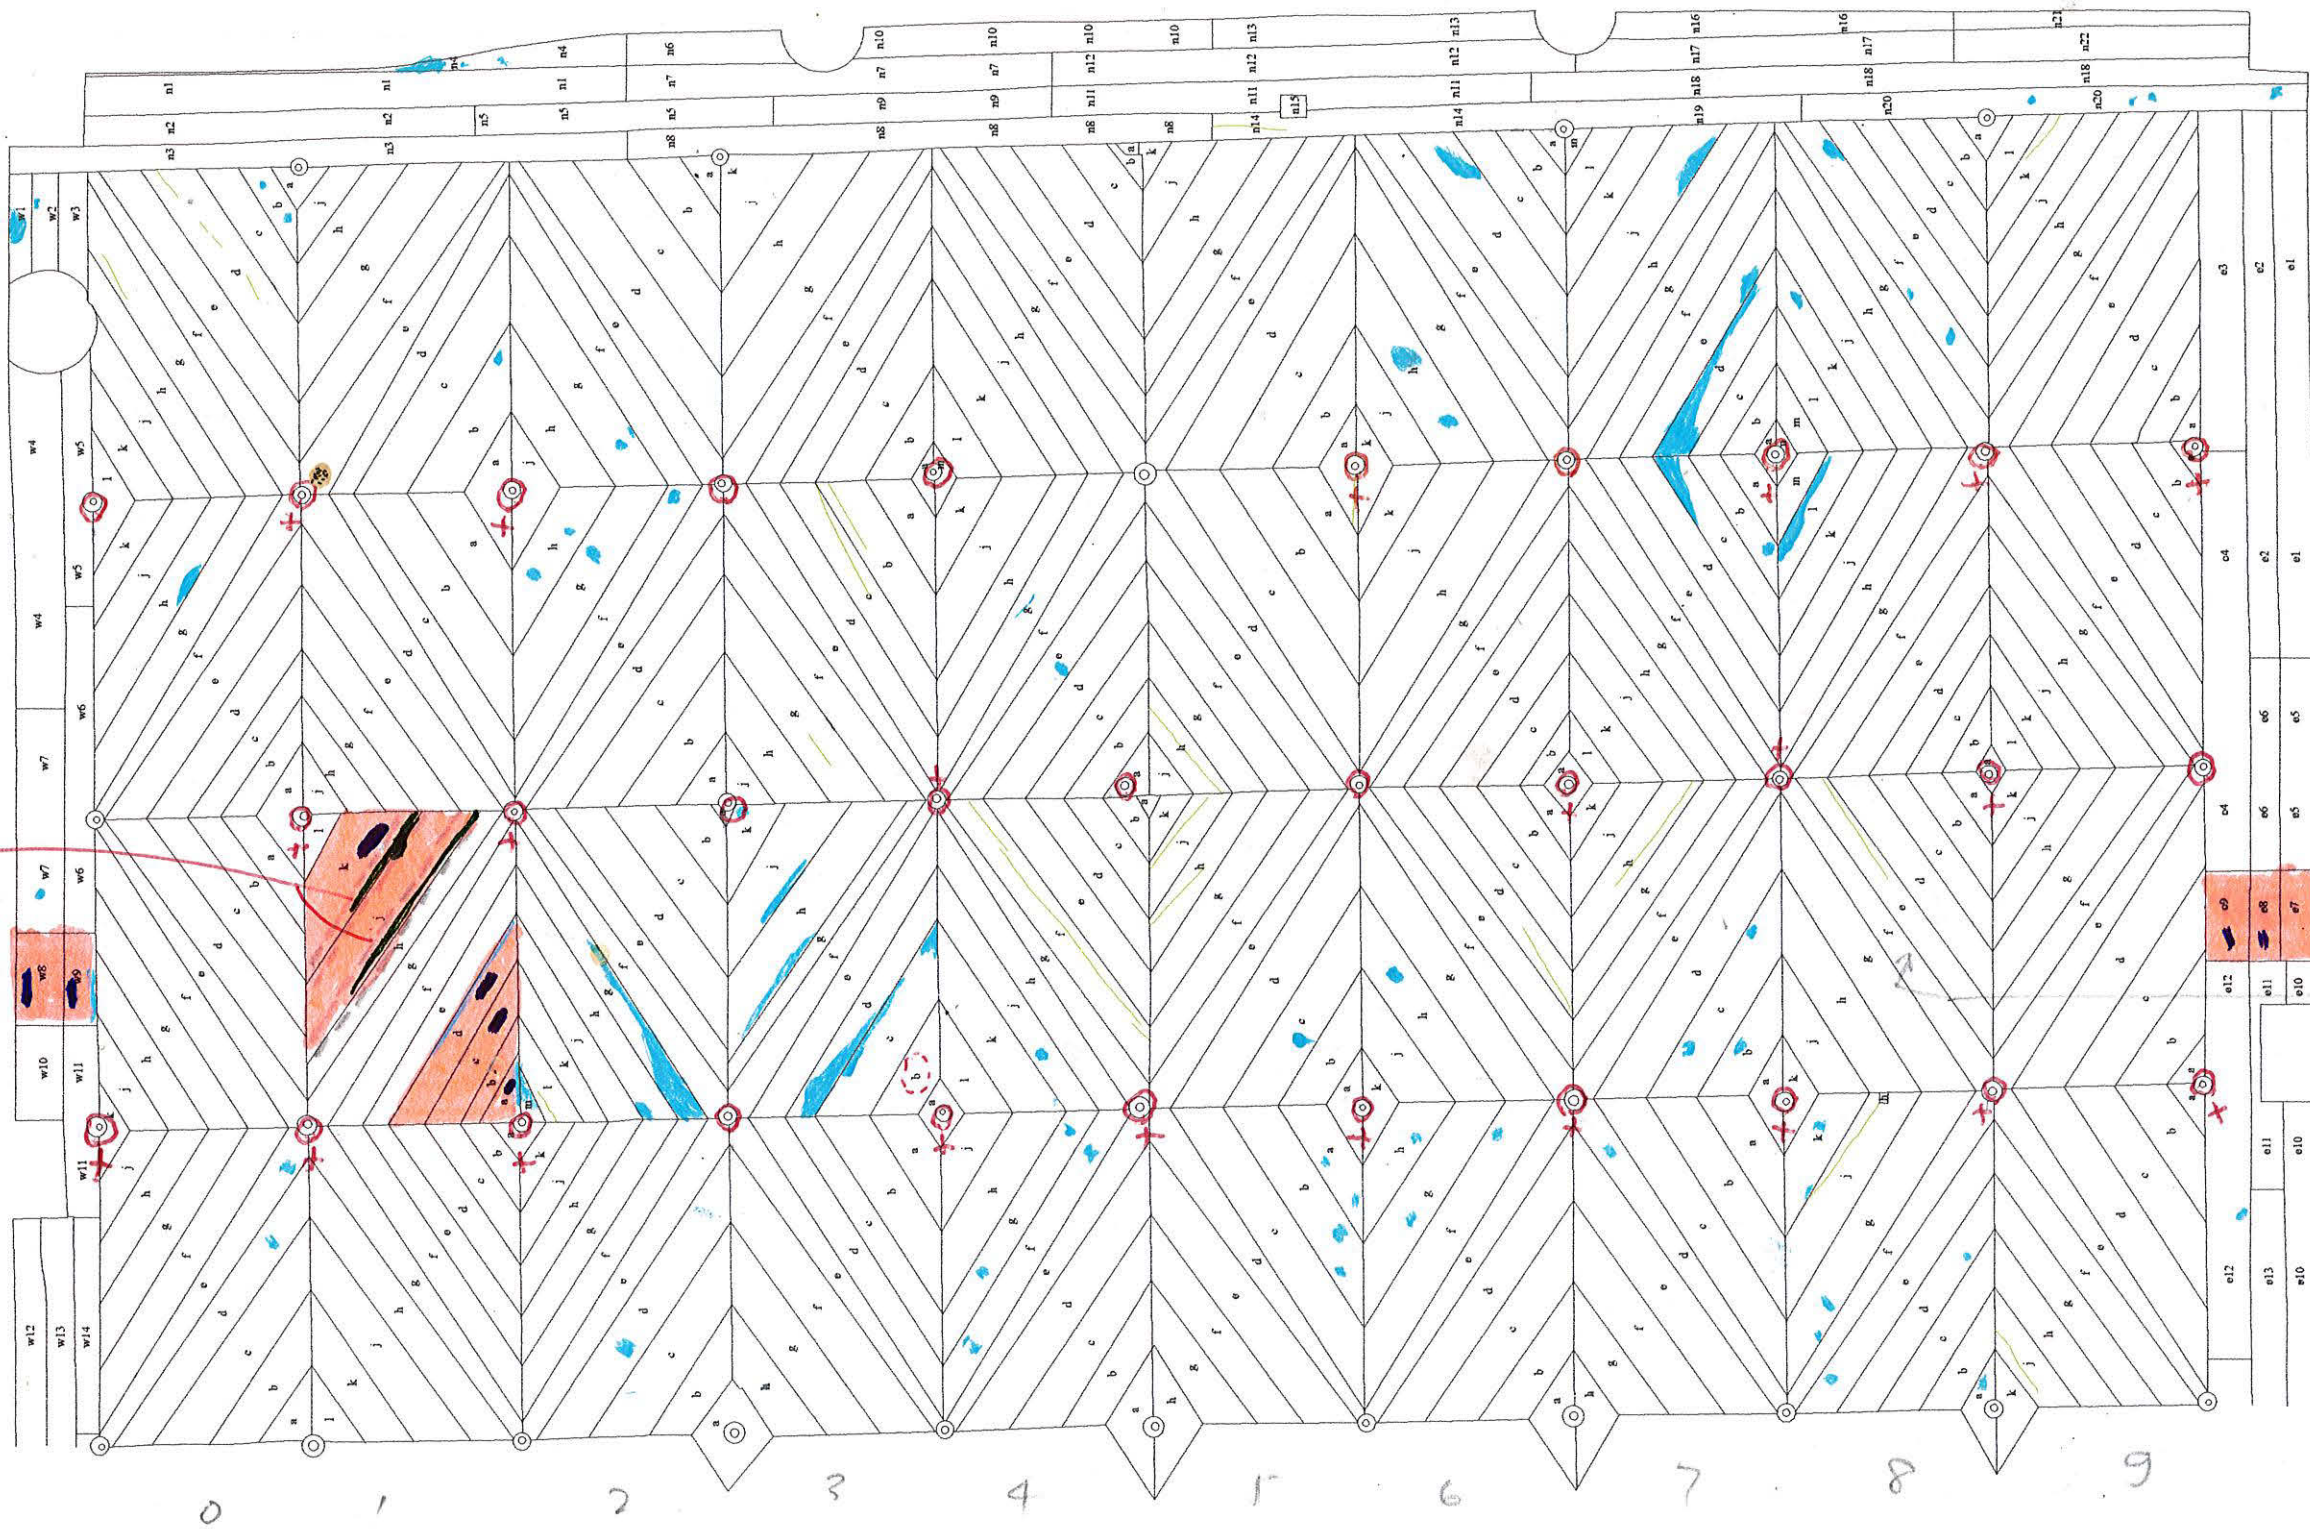

WET ROT

Possible Sewer Board

SOUTH

DRAWING:	TITLE	PROJECT	AREA			SCALE 1:35	Photogrammetry by: The Downland Partnership Lychgate House, Ramsbury Wiltshire SN8 2PB	POSITION
	CONDITION SURVEY AND TREATMENT	PETERBOROUGH CATHEDRAL Restoration of Fire Damage July-October 2002	NORTH TRANSEPT CEILING Rows: A B C D					

KEY


- BOARDS USED FOR DENDRO
- BOARDS REMOVED FOR DENDRO
- INSECT DWB/CFB
- SHOT
- WET ROT
- OAK BATTENS

NORTH

WET ROT

LOOSE
FRAGMENT
ON
BOXED
LINE



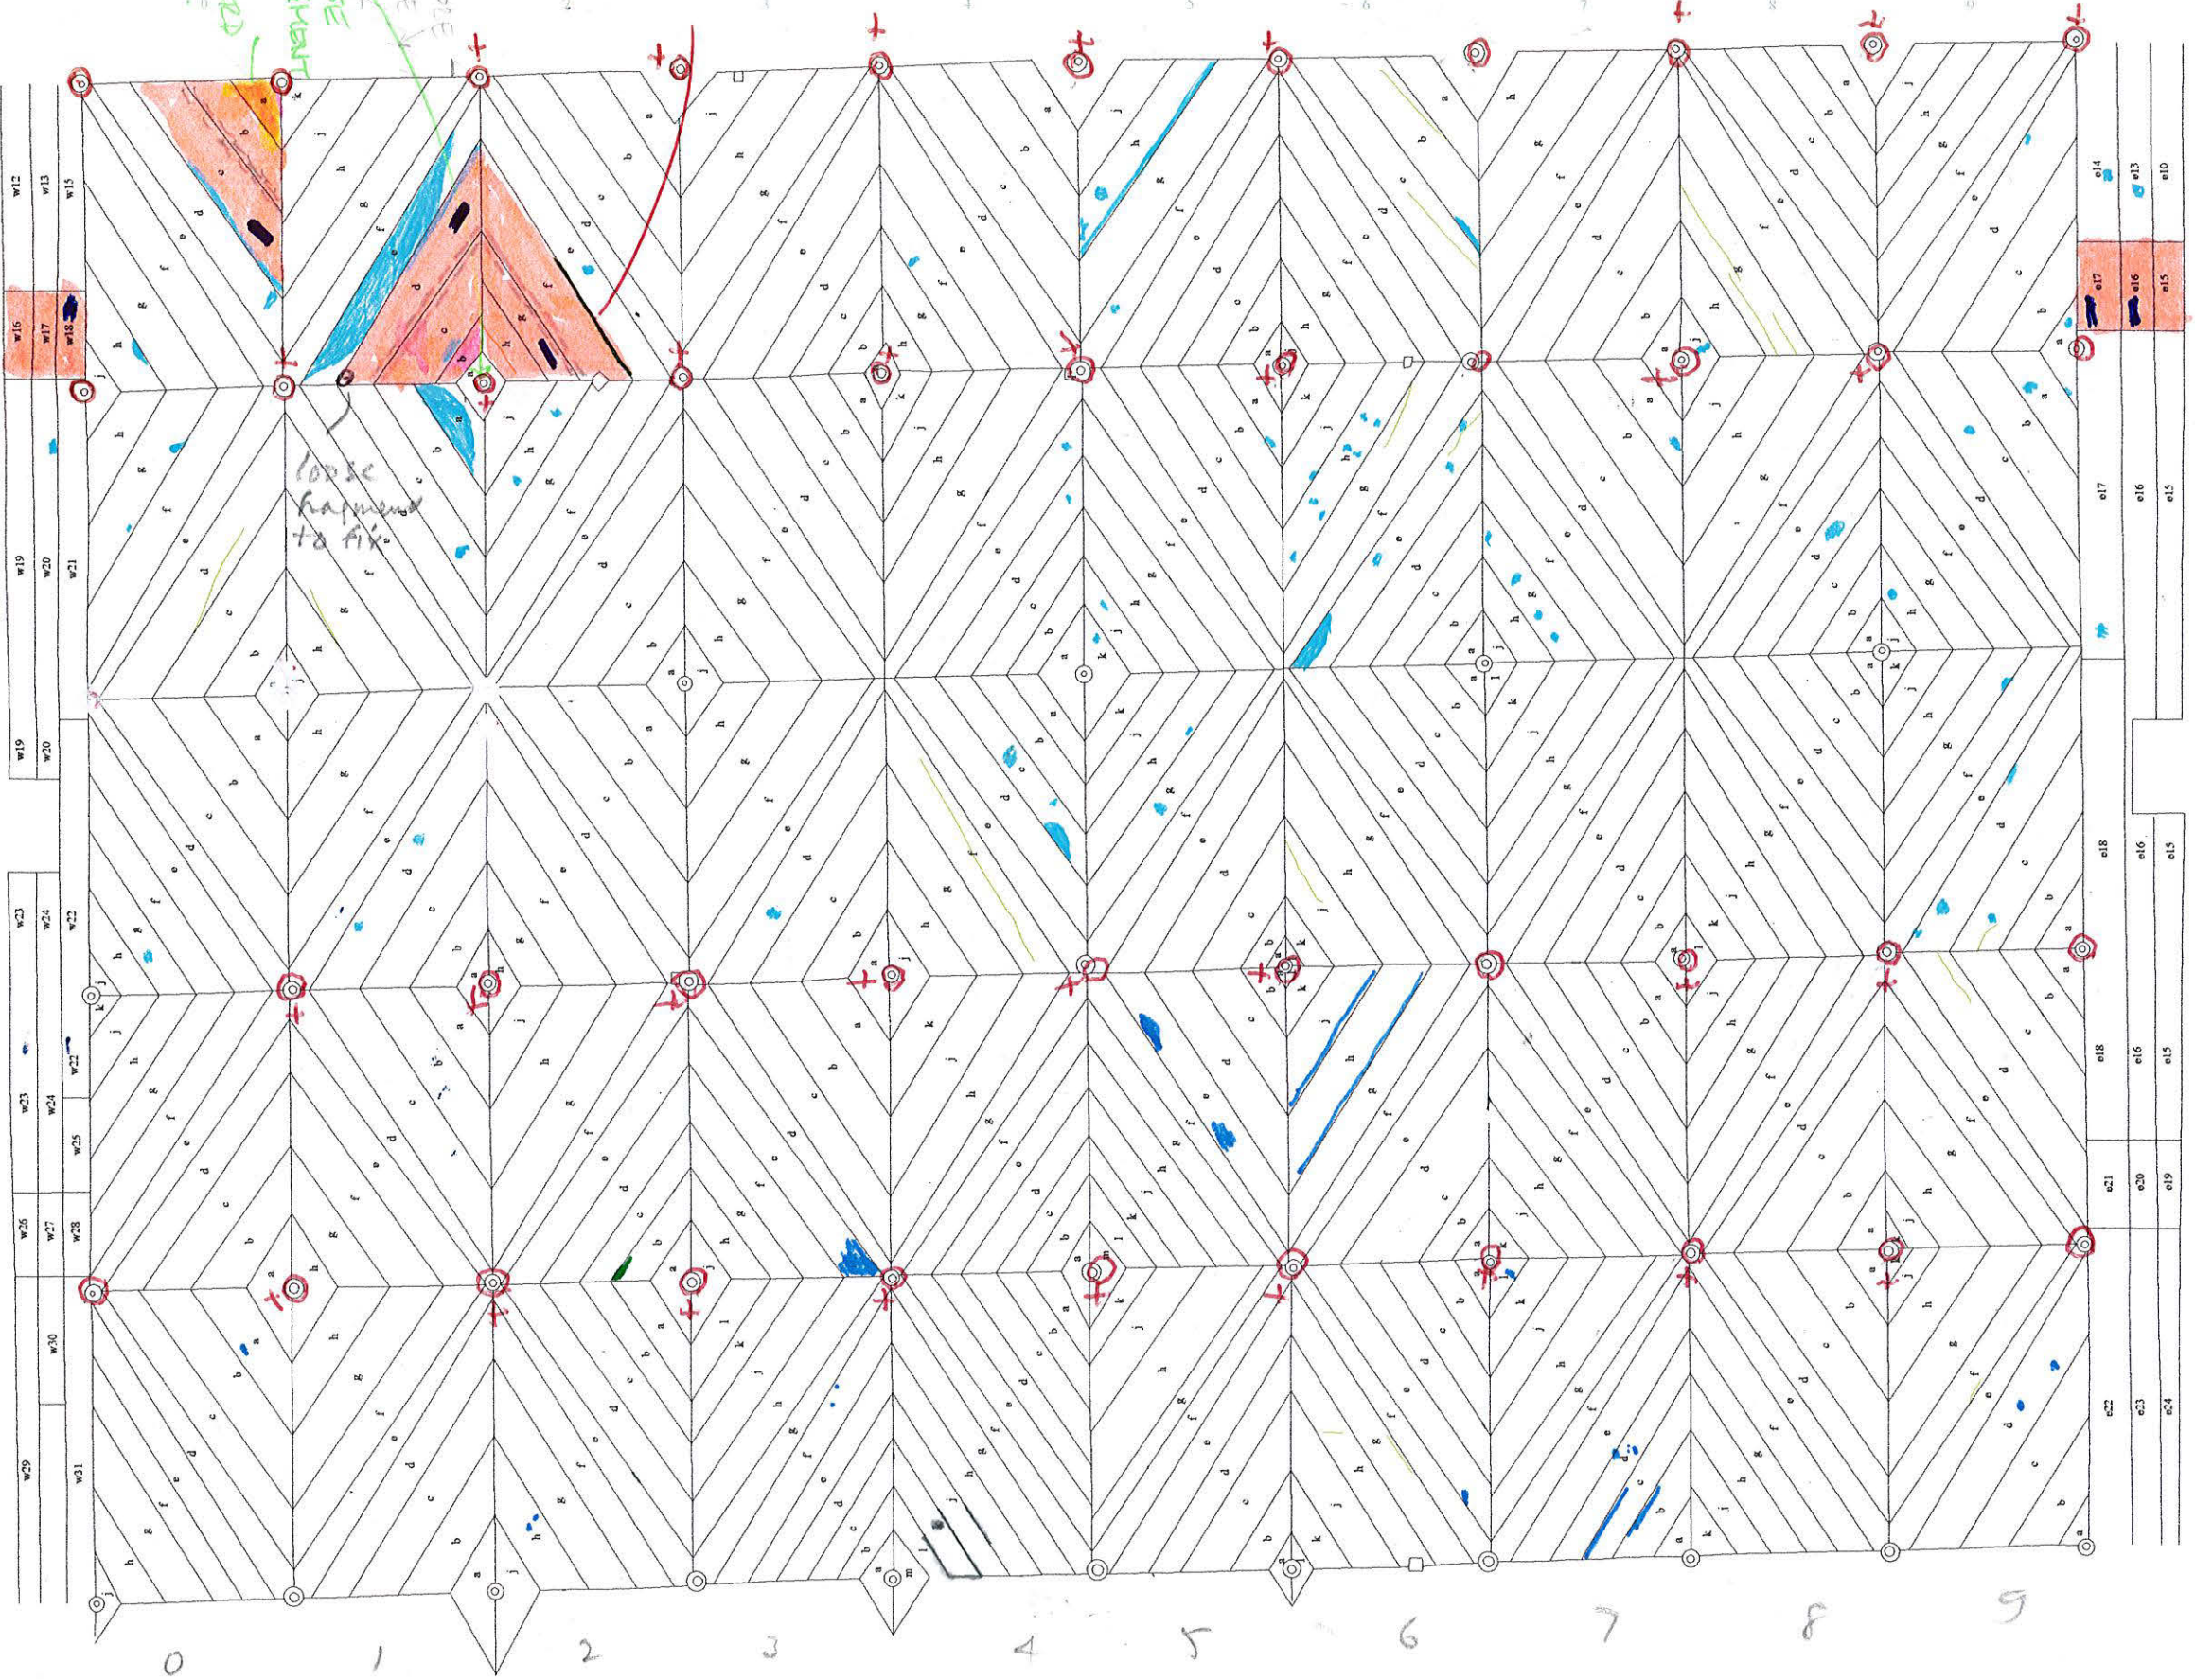

LOOSE
FRAGMENT
TO FIX



WEST


EAST

SOUTH


KEY
 BOARDS USED FOR DENDRO
 BOARDS REMOVED FOR DENDRO
 WET WROT.
 DWB/CFB



SCALE
1:35

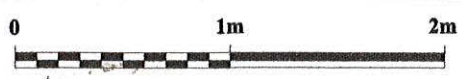

Photogrammetry by:
The Downland Partnership
Lychgate House, Ramsbury
Wiltshire SN8 2PB

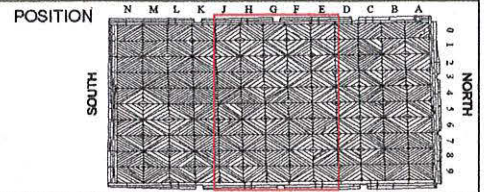

DRAWING:

TITLE
CONDITION SURVEY
AND TREATMENT

PROJECT
PETERBOROUGH CATHEDRAL
Restoration of Fire Damage
July-October 2002

AREA
NORTH TRANSEPT
CEILING
Rows: E F G H J

The Perry Lithgow Partnership
1 Langston Lane, Station Rd, Kingham,
Oxon OX7 6UW Tel. 01608 658067