



**Exterior_007 -
South elevation**

Western bay with plain ground floor, later pierced ventilator to stables and inserted first floor window, added when the building was converted to accommodate a laundry.

**Exterior_008
South elevation**

Inserted 20th century window to first floor, in poor condition, late 19th century ventilator (altered)



**Exterior_009
South elevation**

The rear elevation of the eastern stableblock, with relocated cast-iron window and late 19th century pierced metal ventilators



Exterior_010 - South elevation - eastern bay

The plain elevation reflects the original appearance of the stableblock on this elevation, which did not need rear access onto the garden. The doorway in the central bay and end wall may have been used to provide access for barrowing manure out into the garden. The pierced metal ventilators are later 19th century additions.



Exterior_012 - gable end of western stable block with external staircase access to hayloft and outline of former, added flue in darker bricks



Ground_001 - Internal view of garage (former stables) with timber lining and clay paved block floor

Ground_002 - internal view of garage looking north with panelled lining and hay drop baffle





Ground_003 - lining to garage (former stables) with haydrop curved timber baffle, and re-located cast iron window

Ground_006 - Cast-iron window relocated into south elevation. This window is the original window from the north, courtyard elevation and was moved here after building was adapted as a garage / workshop. The timber panelling was carefully cut to accommodate the repositioned window. It would not have been used when the building was in use as a stables in the late 19th century.





Ground_004 - Blue brick floor to Eastern Stableblock

The blue brick floor laid in brick bond is contemporary with the iron gratings, drainage channels, Stench Trap and the boarded fittings by Musgraves.



Ground_005 - Blue brick floor to Eastern Stableblock

Left - the earlier blue bricks were repaired and replaced in part with small blue clay tiles, with squared pattern, as seen left. Two phases of brick tiles are still evident.

Ground_007 -

Right - "Musgrave's Patent London & Belfast"

detail of casting on the intermediate post to one of the stalls



Ground_008 -

Right below - Musgrave's Patent

cast-iron water bowl or mash feeding trough




Exterior_011 - Pierced ventilator - right

The pierced, non-ferrous, quatrefoil pattern ventilators were inserted during the Musgrave's refurbishment of ca. 1890 and are one of their standard design details for stables.



Ground_015 - Pierced Ventilator - right

Pierced quatrefoil pattern

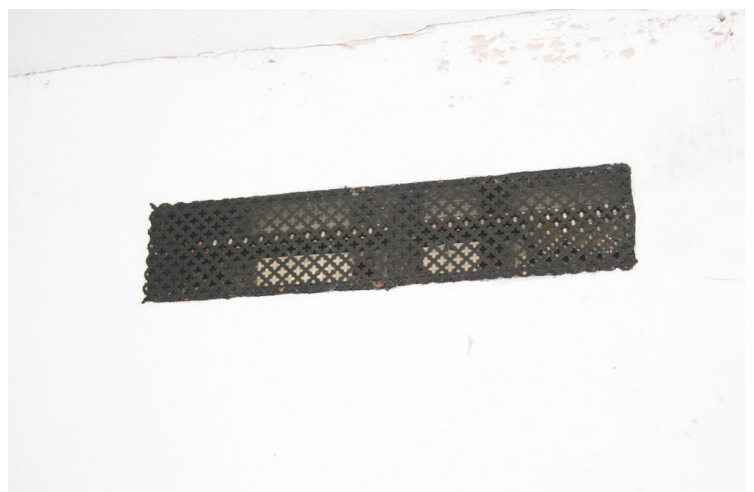



Ground_010 - Impression - left
 Ghosted impression of both former iron mangers and timber boarded baffles from the c1890 refurbishment within the timber boarded lining to the pair of central stalls - now within the garage

**Ground_009
 Boarded baffle - right**

One of two boarded curved baffles surviving from the c1890 refurbishment and now contained within the garage. Located below the chute / hatch in the hayloft floor, it prevented hay from dropping onto the stable floor



Ground_011

Eastern Stableblock - below

Brick party wall between the two stables. The brickwork may have been plastered originally, and later battened to take the boarded lining of c1890, which has been removed from this wall



**Ground_012
 Right -**

iron bracket for a saddle, one of many Musgrave's fittings of c.1890.





Ground_014

Blocked up former stable doorway, with hinge pins in-situ



Ground_022

Cast-iron intermediate post with ball-finial, D-rings and fixing points (Musgrave's fittings) Belfast