

Reproduced from Ordnance Survey's 1:25 000 map of 1998 with the permission of the controller of Her Majesty's Stationery Office. Crown Copyright reserved. Licence No: AL 50125A
Licencee:
Stratascan Ltd.
Vineyard House
Upper Hook Road
Upton Upon Severn
WR8 0SA
OS 100km square = TL




46

45

44

43

42

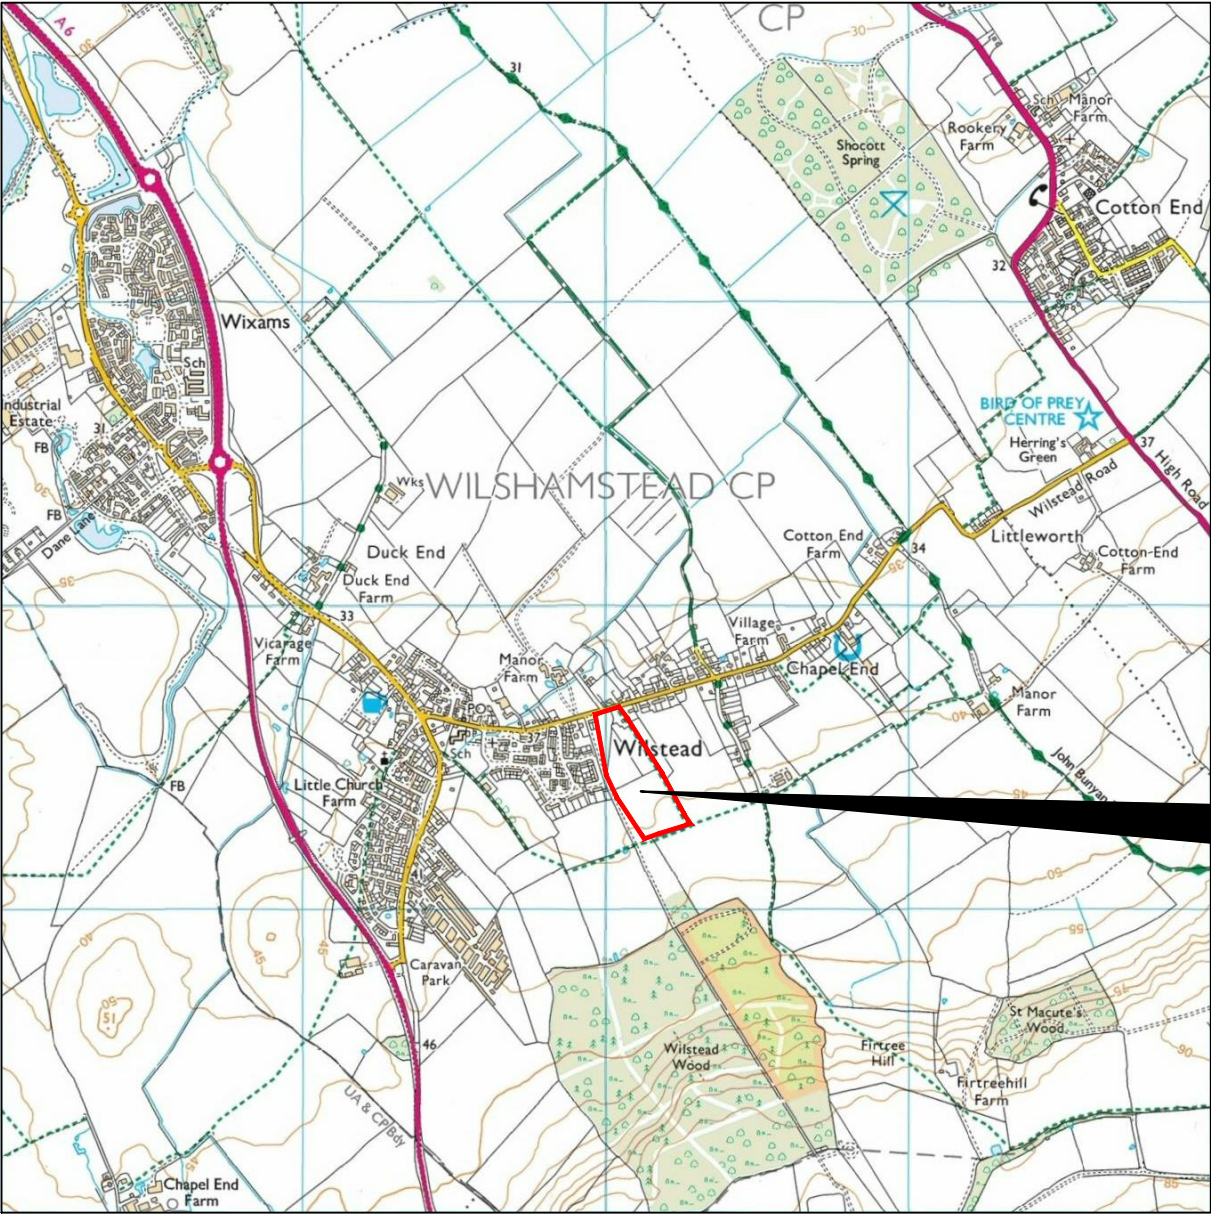

05

06

07

08

09

Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----



Site centred on NGR TL 071 434

Client
ALBION ARCHAEOLOGY

Project Title Job No. J9875
LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Subject
LOCATION PLAN OF SURVEY AREA

STRATASCANTM
GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING
VINEYARD HOUSE T: 01684 592266
UPTON UPON SEVERN E: info@stratascan.co.uk
WR8 0SA www.stratascan.co.uk



SUMO
GROUP
MEMBER




IMS
ISO 9001
certified

UKAS
ISO 14001
certified

IMS
ISO 14001
certified

Scale 1:25000 0m 500 1000m

Plot A3	Checked by DGE	Issue No. 01
Survey date APR 16	Drawn by TR	Figure No. 01

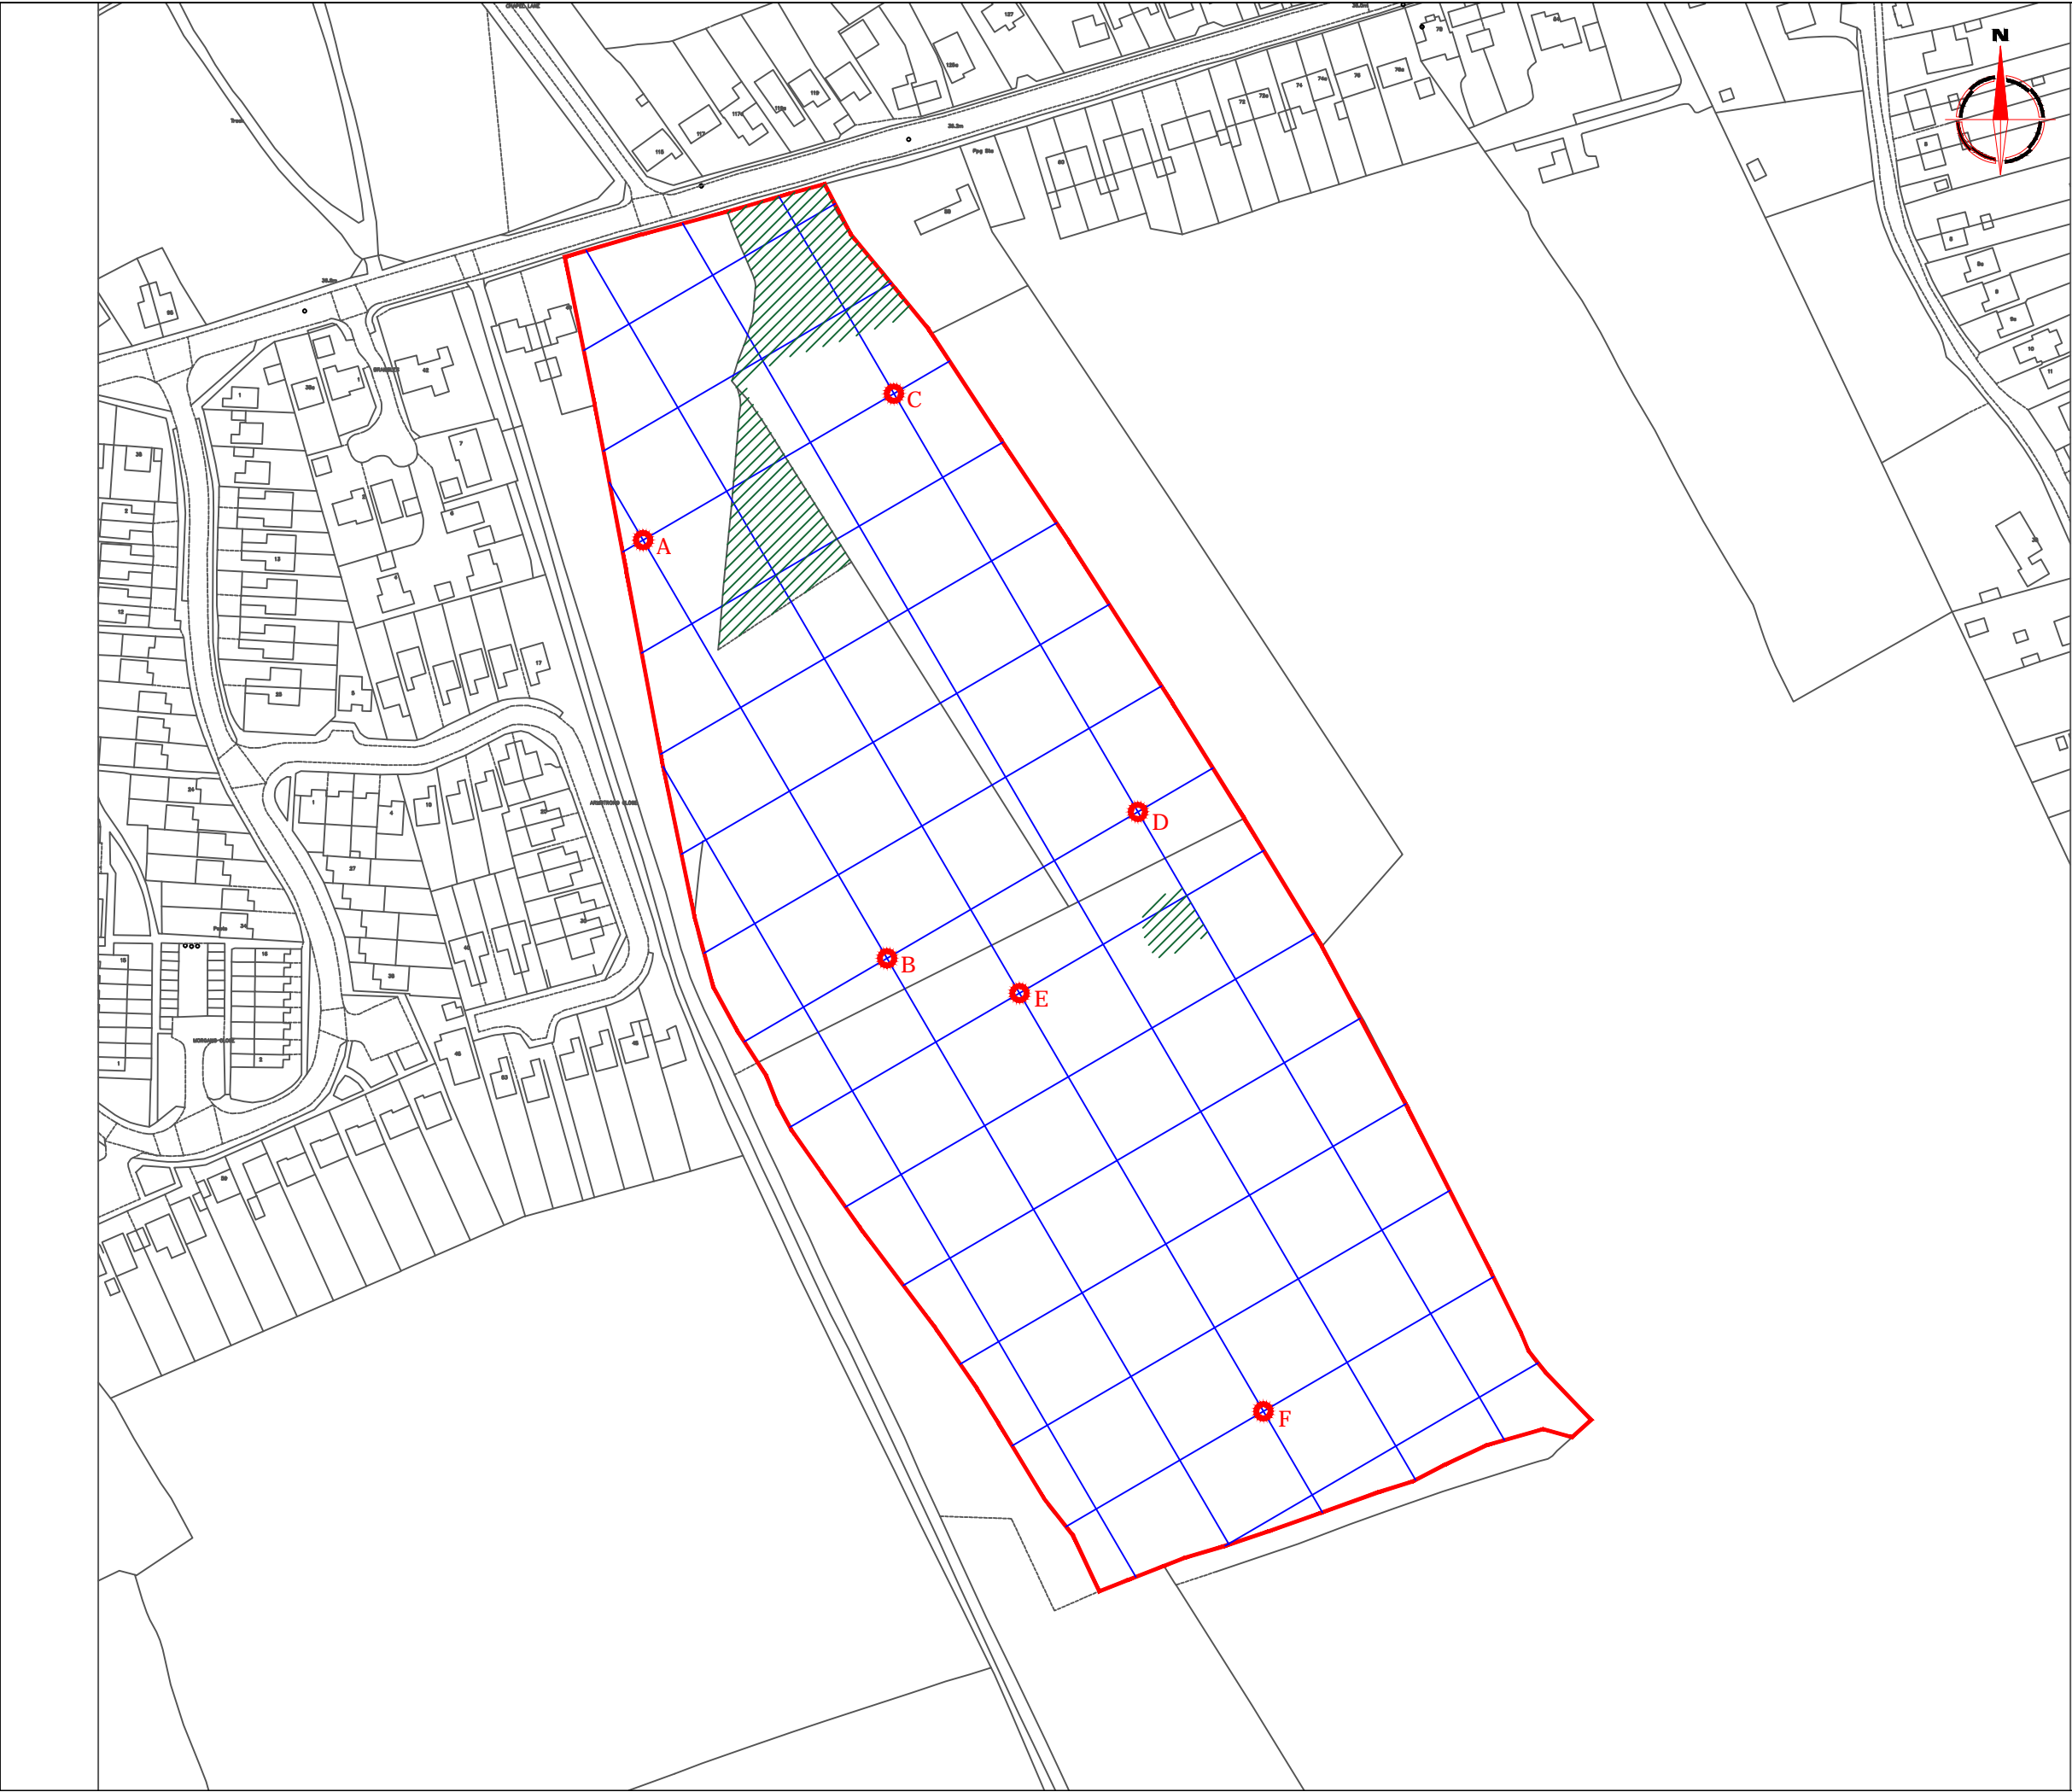

Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

KEY

Area unsurveyable - woodland and access track

OS GRID REFERENCES

A	506990.23, 243553.33
B	507065.83, 243423.77
C	507067.96, 243598.69
D	507143.56, 243469.14
E	507106.86, 243412.99
F	507182.47, 243283.43

Client

ALBION ARCHAEOLOGY

Project Title

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Job No.

J9875

Subject

LOCATION OF SURVEY GRIDS AND
REFERENCING

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE
UPTON UPON SEVERN
WR8 0SA

T: 01684 592266
E: info@stratascan.co.uk
www.stratascan.co.uk

EUROPEAN
GPR
ASSOCIATION

sumo

Survey Services

REGISTERED
ORGANISATION

ims
ISO 9001
certified

UKAS
QUALITY
078

ims
ISO 14001
certified

UKAS
ENVIRONMENTAL
078

Scale

1: 2000

0m

20

40

60

80

100m

Plot	A3	Checked by	DGE	Issue No.	01
Survey date	APR 16	Drawn by	TR	Figure No.	02



Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

Plotting parameters

Maximum + 100nT (red)
Minimum - 100nT (blue)

+ 100nT

+ 25nT

+ 3nT

- 3nT

- 25nT

- 100nT

Client

ALBION ARCHAEOLOGY

Project Title

Job No.

J9875

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Subject

COLOUR PLOT OF GRADIOMETER
DATA SHOWING EXTREME VALUES -
OVERVIEW

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE
UPTON UPON SEVERN
WR8 0SA

T: 01684 592266
E: info@stratascan.co.uk
www.stratascan.co.uk

EUROPEAN
GPR
ASSOCIATION

sumo
Survey
Services

SUMO
GROUP
MEMBER

ims
ISO 9001
certified

UKAS
QUALITY
078

ims
ISO 14001
certified

UKAS
ENVIRONMENTAL
078

Scale

1: 2000

0m 20 40 60 80 100m

Plot

A3

Checked by

DGE

Issue No.

01

Survey date

APR 16

Drawn by

TR

Figure No.

03



Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

Plotting parameters

Maximum + 100nT (red)
Minimum - 100nT (blue)

+ 100nT

+ 25nT

+ 3nT

- 3nT

- 25nT

- 100nT

Client

ALBION ARCHAEOLOGY

Project Title

Job No.

J9875

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Subject

COLOUR PLOT OF GRADIOMETER
DATA SHOWING EXTREME VALUES -
NORTH

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE
UPTON UPON SEVERN
WR8 0SA

T: 01684 592266
E: info@stratascan.co.uk
www.stratascan.co.uk

EUROPEAN
GPR
ASSOCIATION

sumo
Survey
Services

SUMO
GROUP
MEMBER

ims
ISO 9001
certified

UKAS
QUALITY
078

ims
ISO 14001
certified

UKAS
ENVIRONMENTAL
078

Scale

1: 1000

0m 10 20 30 40 50

Plot

A3

Checked by

DGE

Issue No.

01

Survey date

APR 16

Drawn by

TR

Figure No.

04



Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

Plotting parameters

Maximum +2nT (black)

Minimum -2nT (white)

Zero

Mean

-2nT

+2nT

+2nT

-2nT

Client

ALBION ARCHAEOLOGY

Project Title

Job No.

J9875

LAND AT COTTON END ROAD,

WILSTEAD, BEDFORDSHIRE

Subject

PLOT OF MINIMALLY PROCESSED

GRADIOMETER DATA - OVERVIEW

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY

AND ENGINEERING

VINEYARD HOUSE

UPTON UPON SEVERN

WR8 0SA

T: 01684 592266

E: info@stratascan.co.uk

www.stratascan.co.uk

EUROPEAN

GPR

ASSOCIATION

sumo

Survey Services

REGISTERED

ORGANISATION

ims

ISO 9001

certified

UKAS

078

ims

ISO 14001

certified

UKAS

078

Scale

1:2000

0m

20

40

60

80

100m

Plot	A3	Checked by	DGE	Issue No.	01
Survey date	APR 16	Drawn by	TR	Figure No.	06



Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

Plotting parameters

Maximum + 2nT (black)
Minimum - 2nT (white)

Zero Mean

- 2nT + 2nT

+ 2nT

- 2nT

Client

ALBION ARCHAEOLOGY

Project Title

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Job No.

J9875

Subject

PLOT OF MINIMALLY PROCESSED
GRADIOMETER DATA - NORTH

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE T: 01684 592266
UPTON UPON SEVERN E: info@stratascan.co.uk
WR8 0SA www.stratascan.co.uk

Scale

1: 1000

Plot	A3	Checked by	DGE	Issue No.	01
Survey date	APR 16	Drawn by	TR	Figure No.	07



Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

PROBABLE ARCHAEOLOGY

	Positive anomaly / weak positive anomaly - probable cut feature of archaeological origin
	Negative anomaly / weak negative anomaly - probable bank or earthwork of archaeological origin

POSSIBLE ARCHAEOLOGY

	Positive anomaly / weak positive anomaly - possible cut feature of archaeological origin
	Negative anomaly / weak negative anomaly - possible bank or earthwork of archaeological origin

MEDIEVAL/POST-MEDIEVAL AGRICULTURE

	Widely spaced curving parallel linear anomalies - probably related to ridge-and-furrow
	Closely spaced parallel linear anomalies - probably related to agricultural activity such as ploughing
	Linear anomaly - probably related to a former field boundary not present on available mapping
	Linear anomaly - related to a former field boundary present on available mapping

OTHER ANOMALIES

	Linear anomaly - probably related to pipe, cable or other modern service
	Linear anomaly - possibly related to land drain
	Magnetic disturbance associated with nearby metal object such as service or field boundary
	Strong magnetic debris - possible disturbed or made ground
	Scattered magnetic debris - probable modern track way or field boundary
	Area of amorphous magnetic variation - probable natural (e.g. geological or pedological) origin
	Magnetic spike - probable ferrous object

Client

ALBION ARCHAEOLOGY

Project Title

Job No.

J9875

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Subject

ABSTRACTION AND INTERPRETATION
OF GRADIOMETER ANOMALIES -
OVERVIEW

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE
UPTON UPON SEVERN
WR8 0SA

T: 01684 592266
E: info@stratascan.co.uk
www.stratascan.co.uk

GPR
ASSOCIATION

SUMO
GROUP
MEMBER

UKAS
ISO 9001
certified

UKAS
ISO 14001
certified

Scale

1: 2000

0m

20

40
























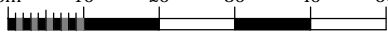
60


80

100m

Plot	Checked by	Issue No.
A3	DGE	01
Survey date	Drawn by	Figure No.
APR 16	TR	09



Amendments		
Issue No.	Date	Description
-	-	-
-	-	-
© Stratascan Ltd - ----		
PROBABLE ARCHAEOLOGY		
	Positive anomaly / weak positive anomaly - probable cut feature of archaeological origin	
	Negative anomaly / weak negative anomaly - probable bank or earthwork of archaeological origin	
POSSIBLE ARCHAEOLOGY		
	Positive anomaly / weak positive anomaly - possible cut feature of archaeological origin	
	Negative anomaly / weak negative anomaly - possible bank or earthwork of archaeological origin	
MEDIEVAL/POST-MEDIEVAL AGRICULTURE		
	Widely spaced curving parallel linear anomalies - probably related to ridge-and-furrow	
	Closely spaced parallel linear anomalies - probably related to agricultural activity such as ploughing	
	Linear anomaly - probably related to a former field boundary not present on available mapping	
	Linear anomaly - related to a former field boundary present on available mapping	
OTHER ANOMALIES		
	Linear anomaly - probably related to pipe, cable or other modern service	
	Linear anomaly - possibly related to land drain	
	Magnetic disturbance associated with nearby metal object such as service or field boundary	
	Strong magnetic debris - possible disturbed or made ground	
	Scattered magnetic debris - probable modern track way or field boundary	
	Area of amorphous magnetic variation - probable natural (e.g. geological or pedological) origin	
	Magnetic spike - probable ferrous object	
Client		
ALBION ARCHAEOLOGY		
Project Title		Job No. J9875
LAND AT COTTON END ROAD, WILSTEAD, BEDFORDSHIRE		
Subject		
ABSTRACTION AND INTERPRETATION OF GRADIOMETER ANOMALIES - NORTH		
 <p>STRATASCAN™</p> <p>GEOPHYSICS FOR ARCHAEOLOGY AND ENGINEERING</p> <p>VINEYARD HOUSE T: 01684 592266 UPTON UPON SEVERN E: info@stratascan.co.uk WR8 0SA www.stratascan.co.uk</p> <div>        </div>		
Scale	0m 10 20 30 40 50	
1:1000		
Plot	Checked by	Issue No.
A3	DGE	01
Survey date	Drawn by	Figure No.
APR 16	TR	10

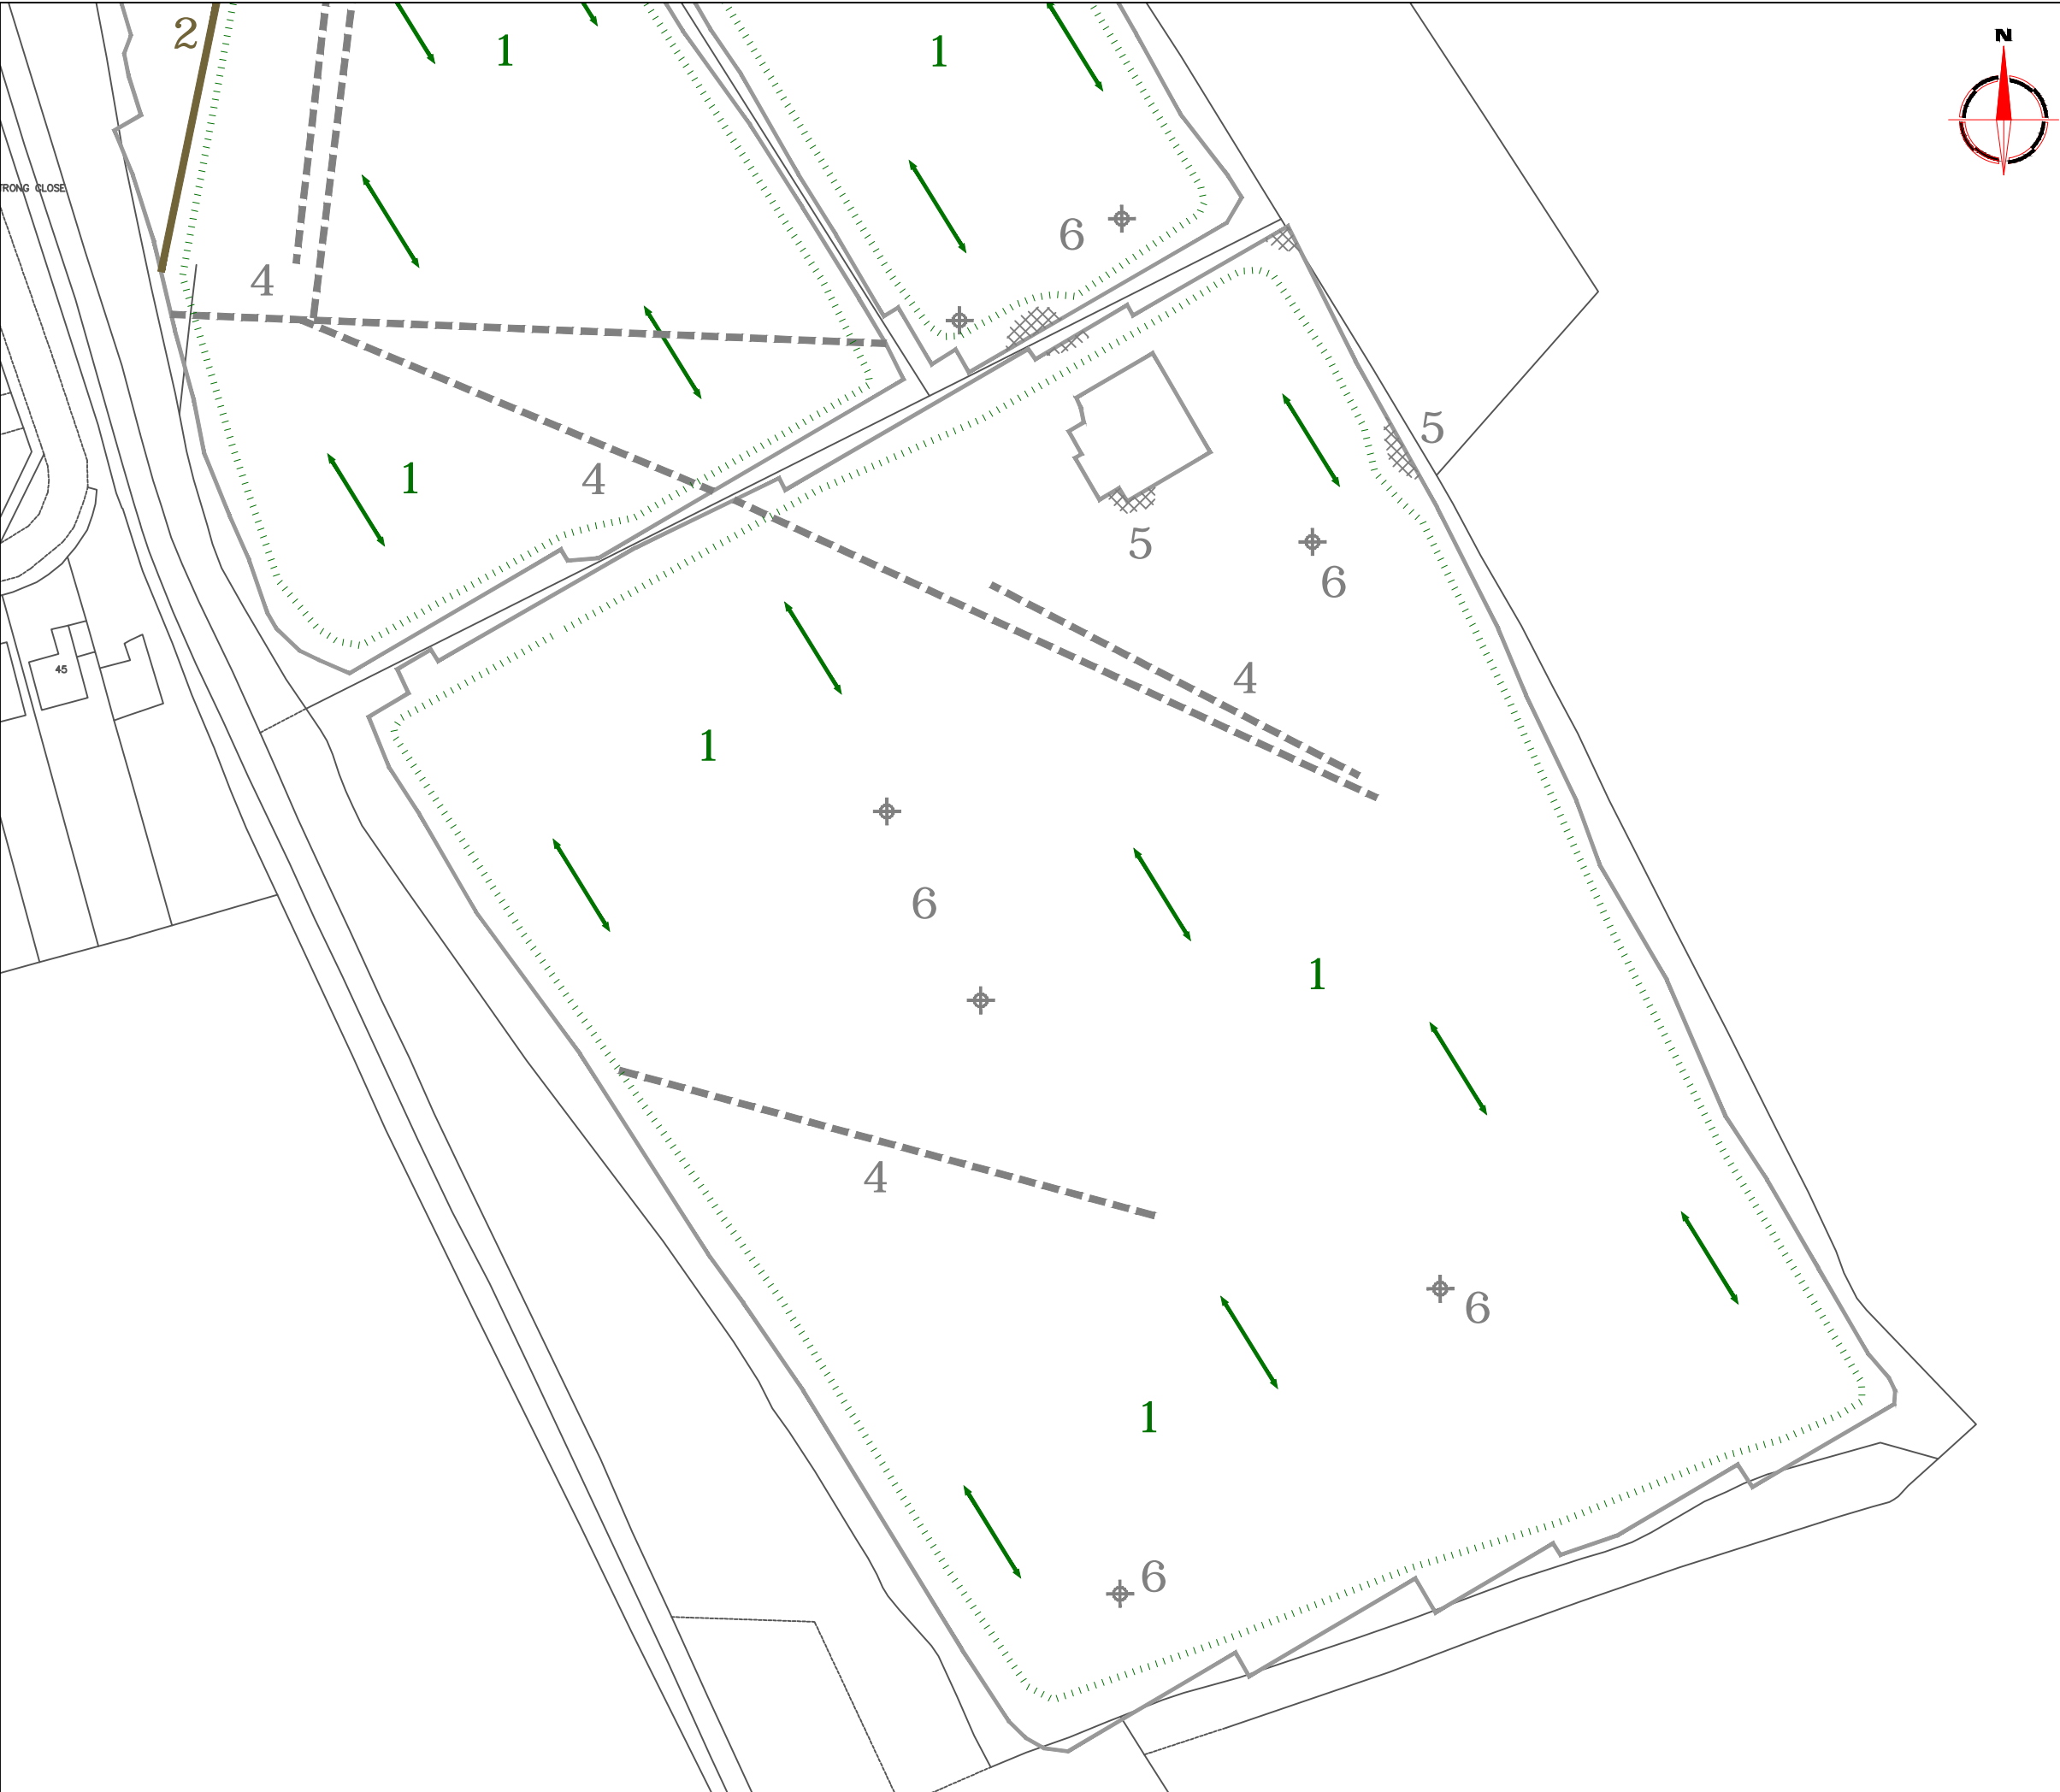

Amendments

Issue No.	Date	Description
-	-	-
-	-	-

© Stratascan Ltd - ----

PROBABLE ARCHAEOLOGY

	Positive anomaly / weak positive anomaly - probable cut feature of archaeological origin
	Negative anomaly / weak negative anomaly - probable bank or earthwork of archaeological origin

POSSIBLE ARCHAEOLOGY

	Positive anomaly / weak positive anomaly - possible cut feature of archaeological origin
	Negative anomaly / weak negative anomaly - possible bank or earthwork of archaeological origin

MEDIEVAL/POST-MEDIEVAL AGRICULTURE

	Widely spaced curving parallel linear anomalies - probably related to ridge-and-furrow
	Closely spaced parallel linear anomalies - probably related to agricultural activity such as ploughing
	Linear anomaly - probably related to a former field boundary not present on available mapping
	Linear anomaly - related to a former field boundary present on available mapping

OTHER ANOMALIES

	Linear anomaly - probably related to pipe, cable or other modern service
	Linear anomaly - possibly related to land drain
	Magnetic disturbance associated with nearby metal object such as service or field boundary
	Strong magnetic debris - possible disturbed or made ground
	Scattered magnetic debris - probable modern track way or field boundary
	Area of amorphous magnetic variation - probable natural (e.g. geological or pedological) origin
	Magnetic spike - probable ferrous object

Client

ALBION ARCHAEOLOGY

Project Title

Job No.

J9875

LAND AT COTTON END ROAD,
WILSTEAD, BEDFORDSHIRE

Subject

ABSTRACTION AND INTERPRETATION
OF GRADIOMETER ANOMALIES -
SOUTH

STRATASCAN™

GEOPHYSICS FOR ARCHAEOLOGY
AND ENGINEERING

VINEYARD HOUSE
UPTON UPON SEVERN
WR8 0SA

T: 01684 592266
E: info@stratascan.co.uk
www.stratascan.co.uk

Scale

1: 1000

Plot	A3	Checked by	DGE	Issue No.	01
Survey date	APR 16	Drawn by	TR	Figure No.	11